Compal confidential

Schematics Document

Mobile Penryn uFCPGA with Intel Cantiga_GM+ICH9-M core logic

2008-01-01

機密 等級 硬體二部 產出人員 產出日期 解密日期

Security Classification	Compal Secret Data		
Issued Date	2007/08/28	Deciphered Date	2006/03/10

Compal Electronics, Inc.		
Title: Cover Sheet		
Size: Custom	Document Number: Montevina Blade UMA LA4101P	Rev: 0.3
Date: Saturday, January 05, 2008	Sheet 1 of 46	

Compal confidential

Montevina Consumer 14" UMA

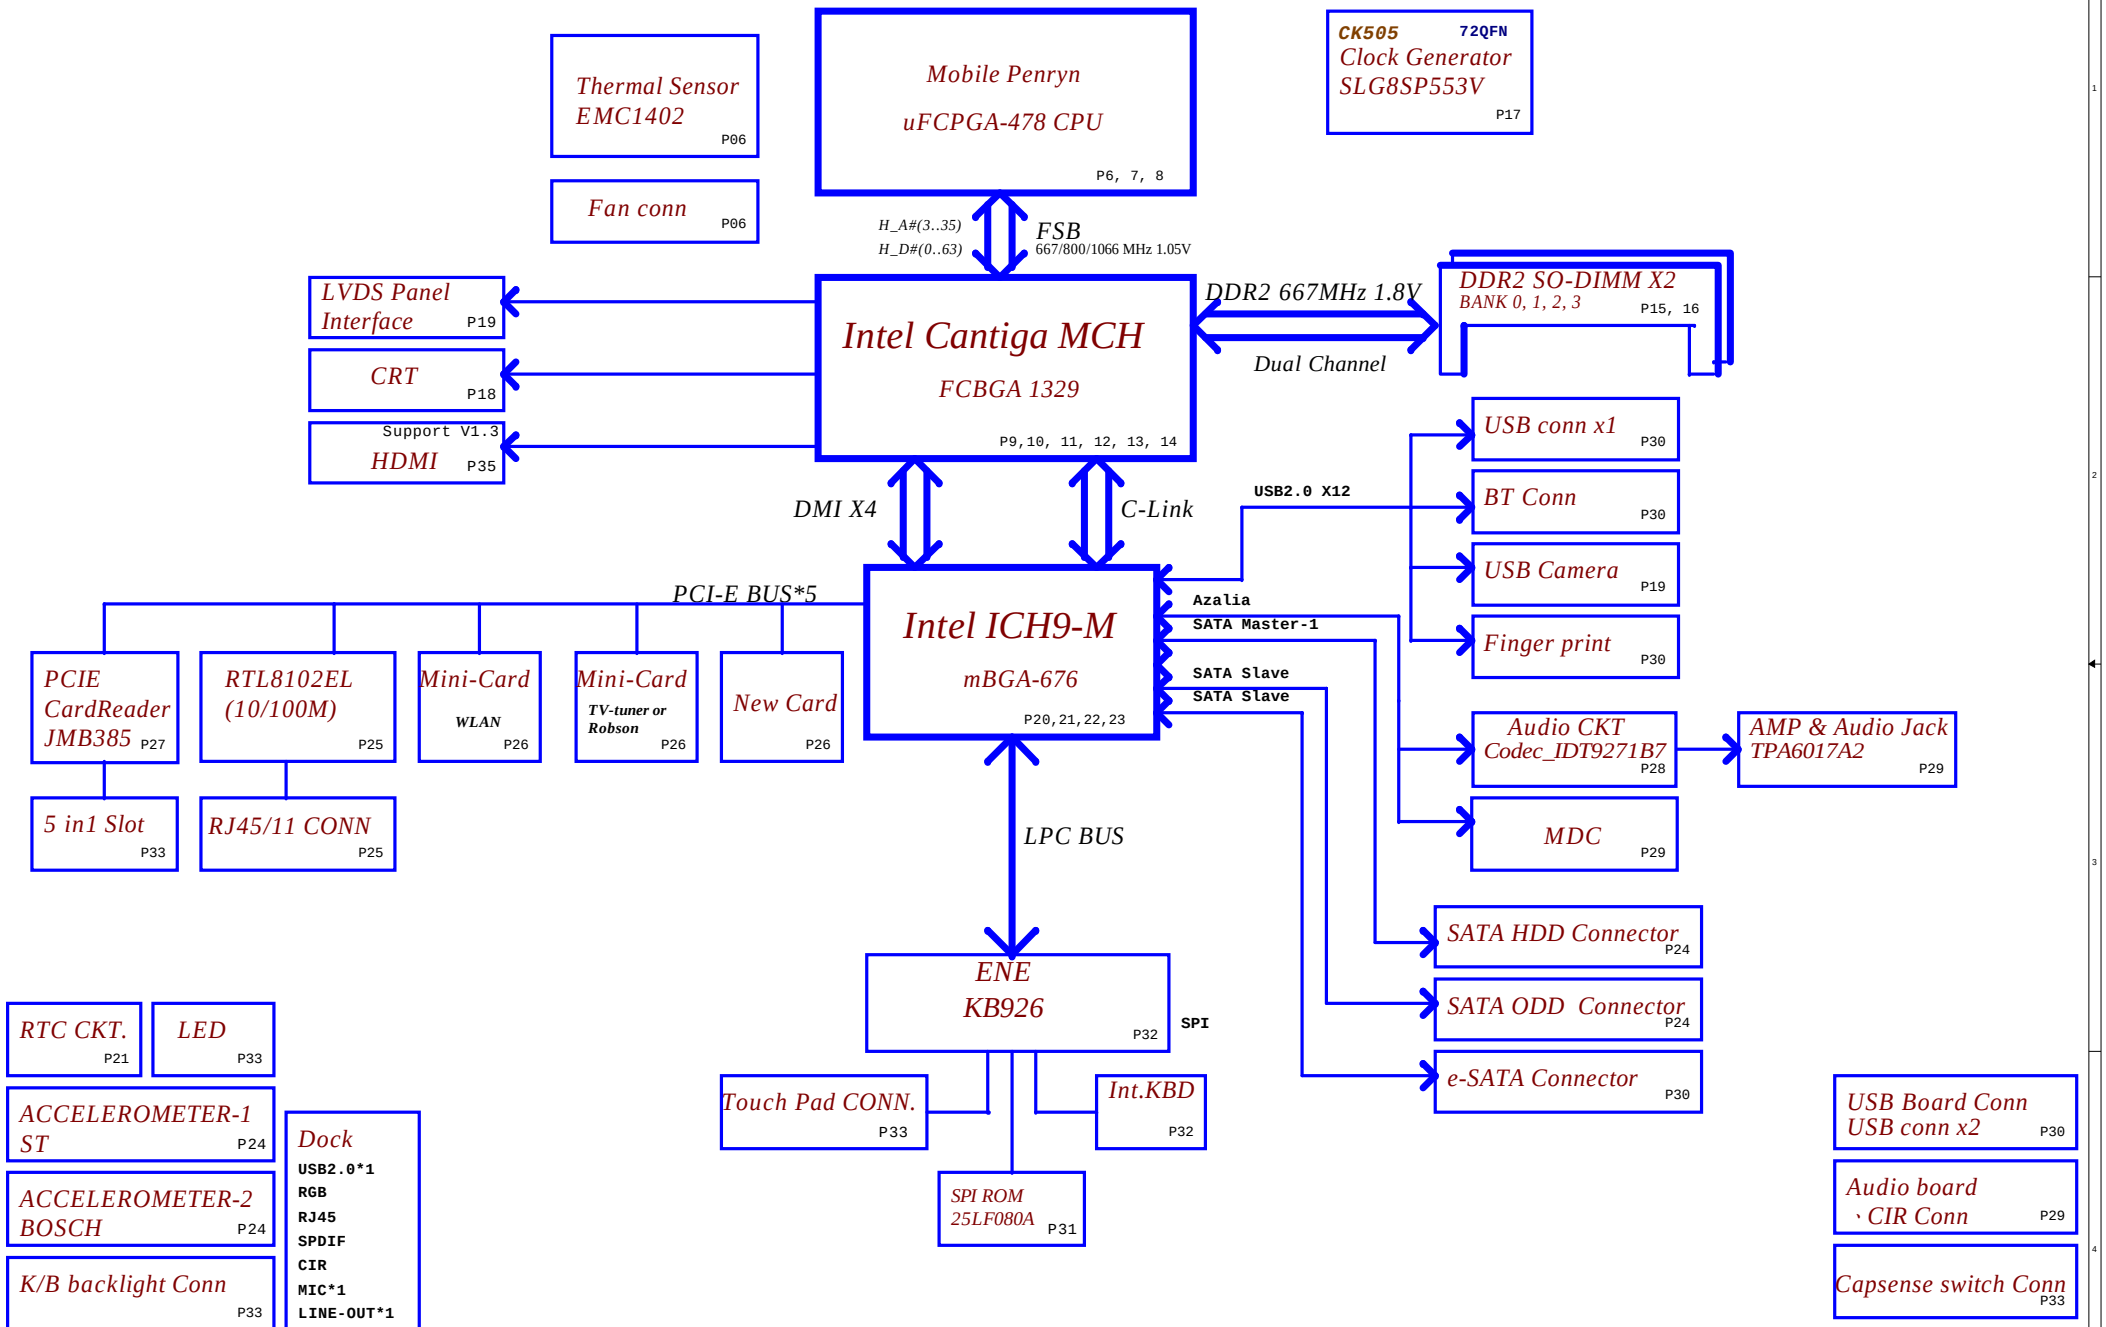

Security Classification	Compal Secret Data		
Issued Date	2006/02/13	Deciphered Date	2006/03/10

Compal Electronics, Inc.

Title: Block Diagram

Size	Document Number	Rev
Custom	Montevina Blade UMA LA4101P	0.3

Date: Saturday, January 05, 2008 Sheet 2 of 46

Voltage Rails

O MEANS ON X MEANS OFF

power plane / State	+B	+5VALW +3VALW	+1.8V	+5VS +3VS +1.5VS +0.9V +VCCP +CPU_CORE +2.5VS +1.8VS
S0	O	O	O	O
S1	O	O	O	O
S3	O	O	O	X
S5 S4/AC	O	O	X	X
S5 S4/ Battery only	O	X	X	X
S5 S4/AC & Battery don't exist	X	X	X	X

Symbol Note :

: means Digital Ground

: means Analog Ground

@ :	means just reserve , no build
45@ :	means need be mounted when 45 level assy or rework stage.
DEBUG@ :	means just reserve for debug.
BATT @ :	means need be mounted when 45 level assy or rework stage.
CONN@ :	means ME part
ESATA @ :	means just reserve for ESATA
GS @ :	means just reserve for G sensor
FP @ :	means just reserve for Finger Print
Multi @ :	means just reserve for Multi Bay
NewC@ :	means just reserve for New card
DOCK@ :	means just reserve for Docking
Main@ :	means just reserve for Main stream
OPP@ :	means just reserve for OPP
2MiniC@ :	means just reserve for 2nd Mini card slot

USB assignment:

USB-0	Right side
USB-1	Right side
USB-2	Left side(with ESATA)
USB-3	Dock
USB-4	Camera
USB-5	WLAN
USB-6	Bluetooth
USB-7	Finger Printer
USB-8	MiniCard(WWAN/TV)
USB-9	Express card
USB-10	X
USB-11	X

PCIe assignment:

PCIe-1	TV /WWAN/Robeson
PCIe-2	X
PCIe-3	WLAN
PCIe-4	GLAN (Realtek)
PCIe-5	Card reader
PCIe-6	New Card

SMBUS Control Table

	SOURCE	INVERTER	BATT	SERIAL EEPROM	Thermal Sensor	SODIMM	CLK CHIP	MINI CARD	LCD	Cap sensor board	NEW CARD	G sensor
SMB_EC_CK1 SMB_EC_DA1	KB926	X	V	V	X	X	X	X	X	V	X	X
SMB_EC_CK2 SMB_EC_DA2	KB926	X	X	X	V	X	X	X	X	X	X	X
SMB_CK_CLK1 SMB_CK_DAT1	ICH9	X	X	X	X	V	V	V	X	X	V	V
LCD_CLK LCD_DAT	Cantiga	X	X	X	X	X	X	X	V	X	X	X

I2C / SMBUS ADDRESSING

DEVICE	HEX	ADDRESS
DDR SO-DIMM 0	A0	1 0 1 0 0 0 0 0
DDR SO-DIMM 1	A4	1 0 1 0 0 1 0 0
CLOCK GENERATOR (EXT.)	D2	1 1 0 1 0 0 1 0

43154432L01 : Main@/DEBUG@/DOCK@/NewC@/FP@/ESATA@/GS@/Multi@/2MiniC@
43154432L02 : Main@/DEBUG@/DOCK@/NewC@/FP@/ESATA@/GS@/2MiniC@
43154432L03 : Main@/DEBUG@/DOCK@/NewC@/FP@/2MiniC@
43154432L04 : OPP@/DEBUG@
43154432L05 : OPP@/DEBUG@

43154432L01 : UMA GM PA FF (SI-1)
43154432L02 : UMA GM PR FF (SI-1)
43154432L03 : UMA GL PR FF-
43154432L04 : UMA GM OPP (SI-1)
43154432L05 : UMA GL OPP

Cantiga GM45 B0(QR32) : SA00001P930
ICH9M A2 ES2 Base : SA00002AN10

DA600007100 --->Main
DAZ03V00100 --->OPP

Security Classification	Compal Secret Data		
Issued Date	2007/08/28	Deciphered Date	2006/03/10

Compal Electronics, Inc.

Title: Notes List

Size: Custom | Document Number: Montevina Blade UMA LA4101P | Rev: 0.3

Date: Saturday, January 05, 2008 | Sheet 3 of 46

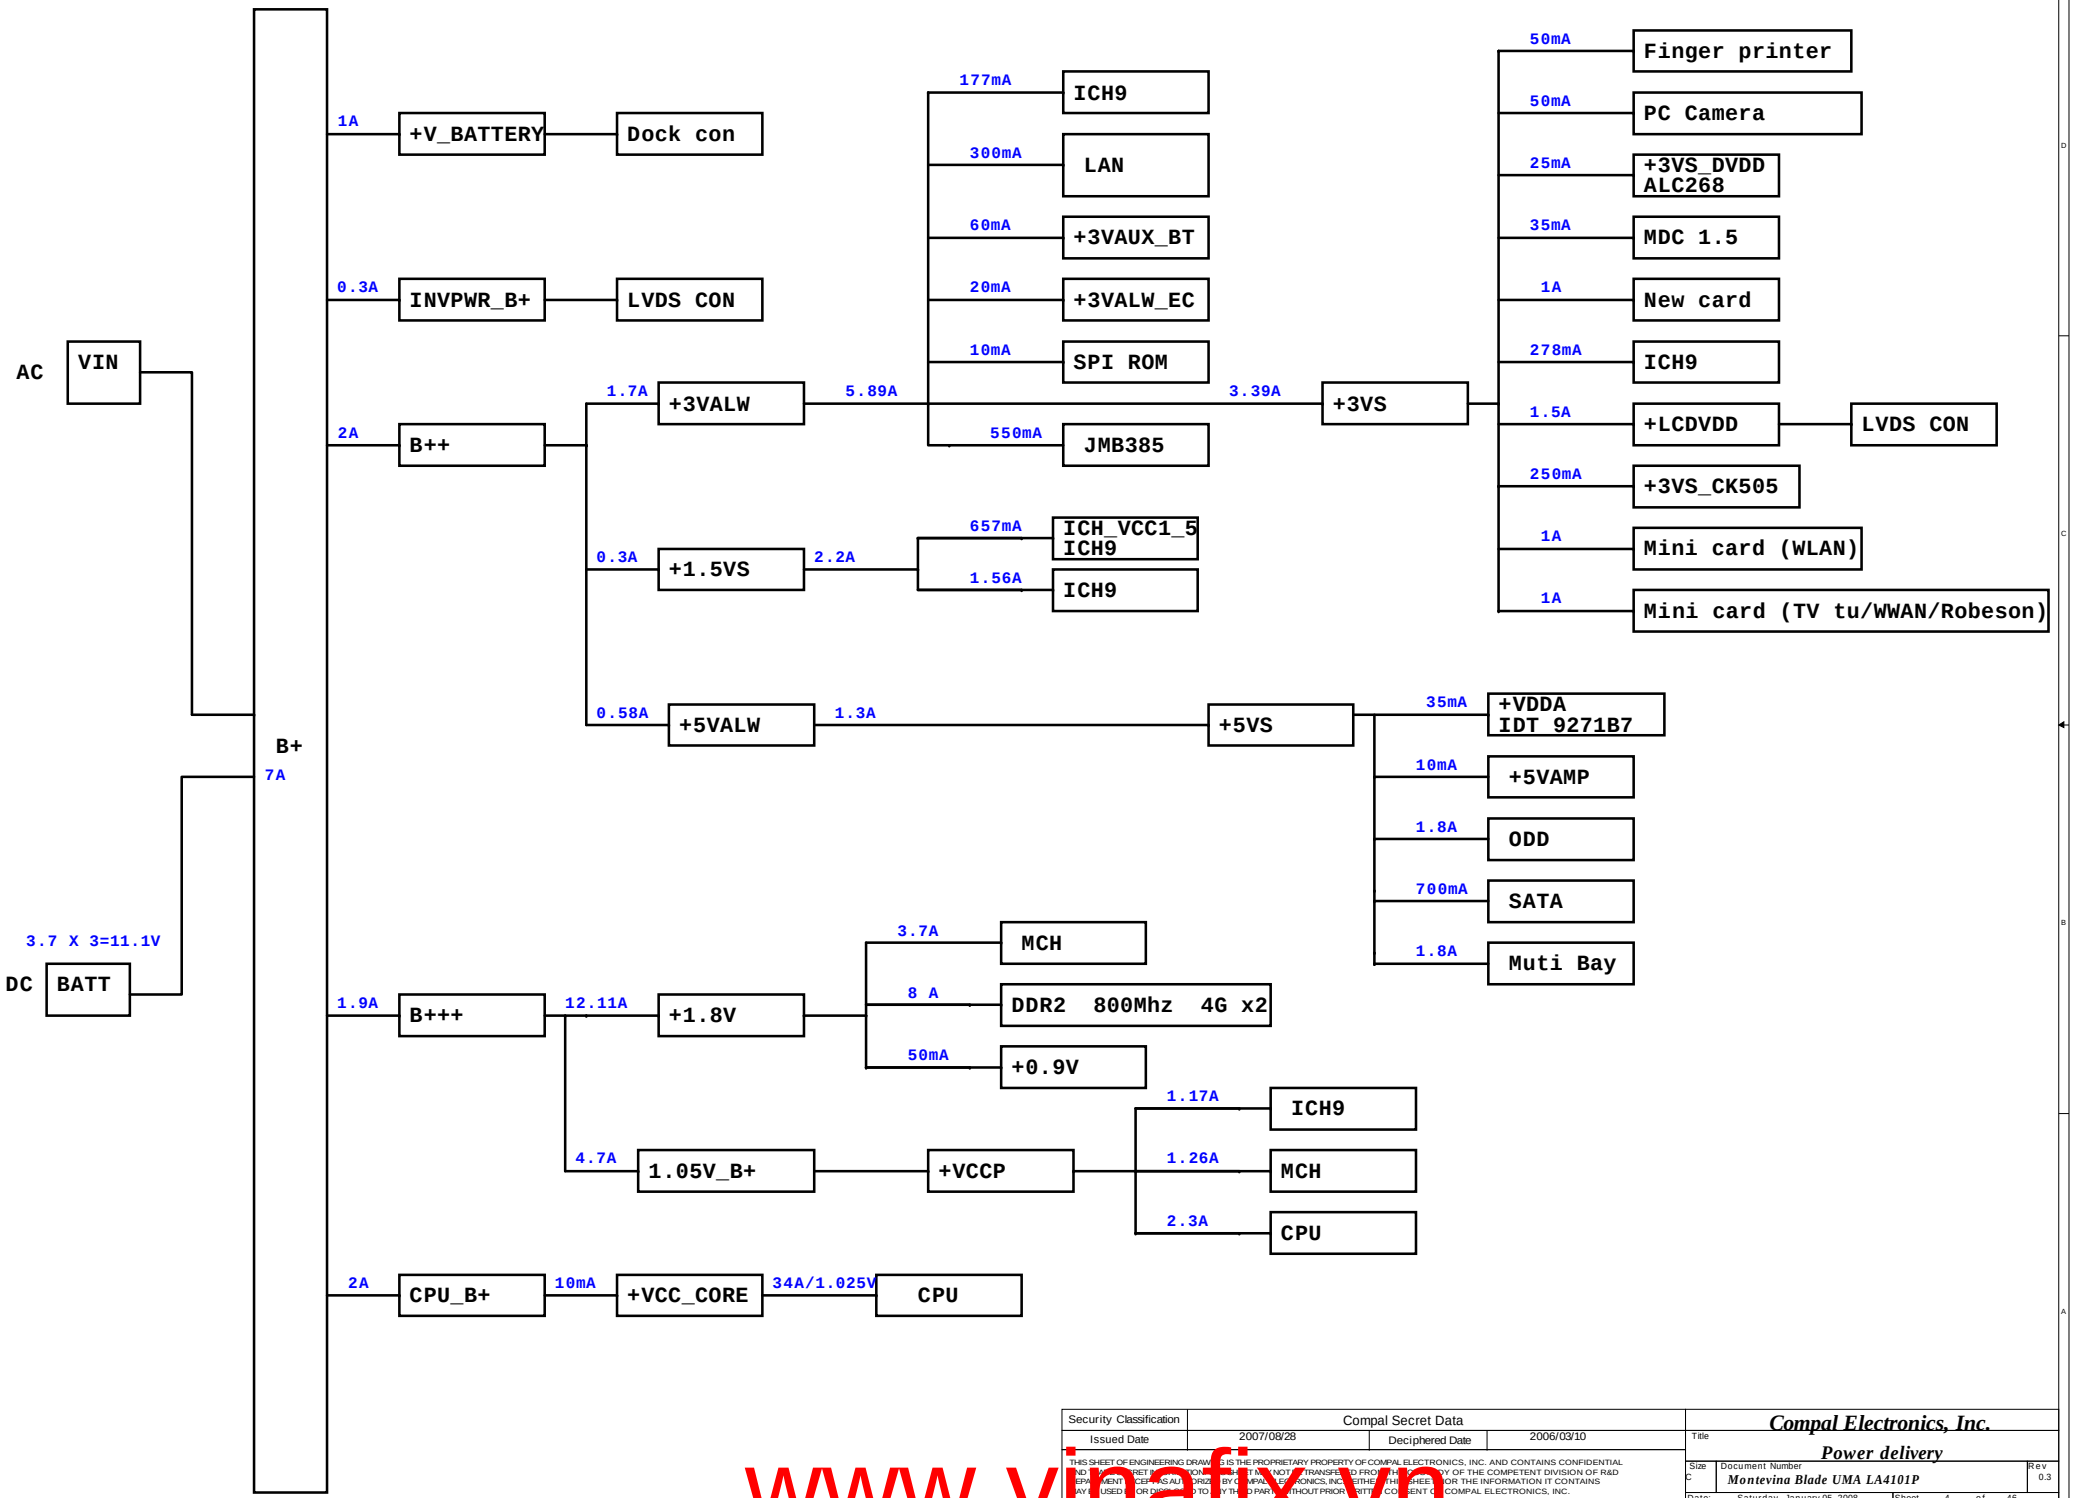

Security Classification	Compal Secret Data		
Issued Date	2007/08/28	Deciphered Date	2006/03/10

Compal Electronics, Inc.

Title: Power delivery

Size	Document Number	Rev
C	Montevina Blade UMA LA4101P	0.3

Date: Saturday, January 05, 2008 Sheet 4 of 46

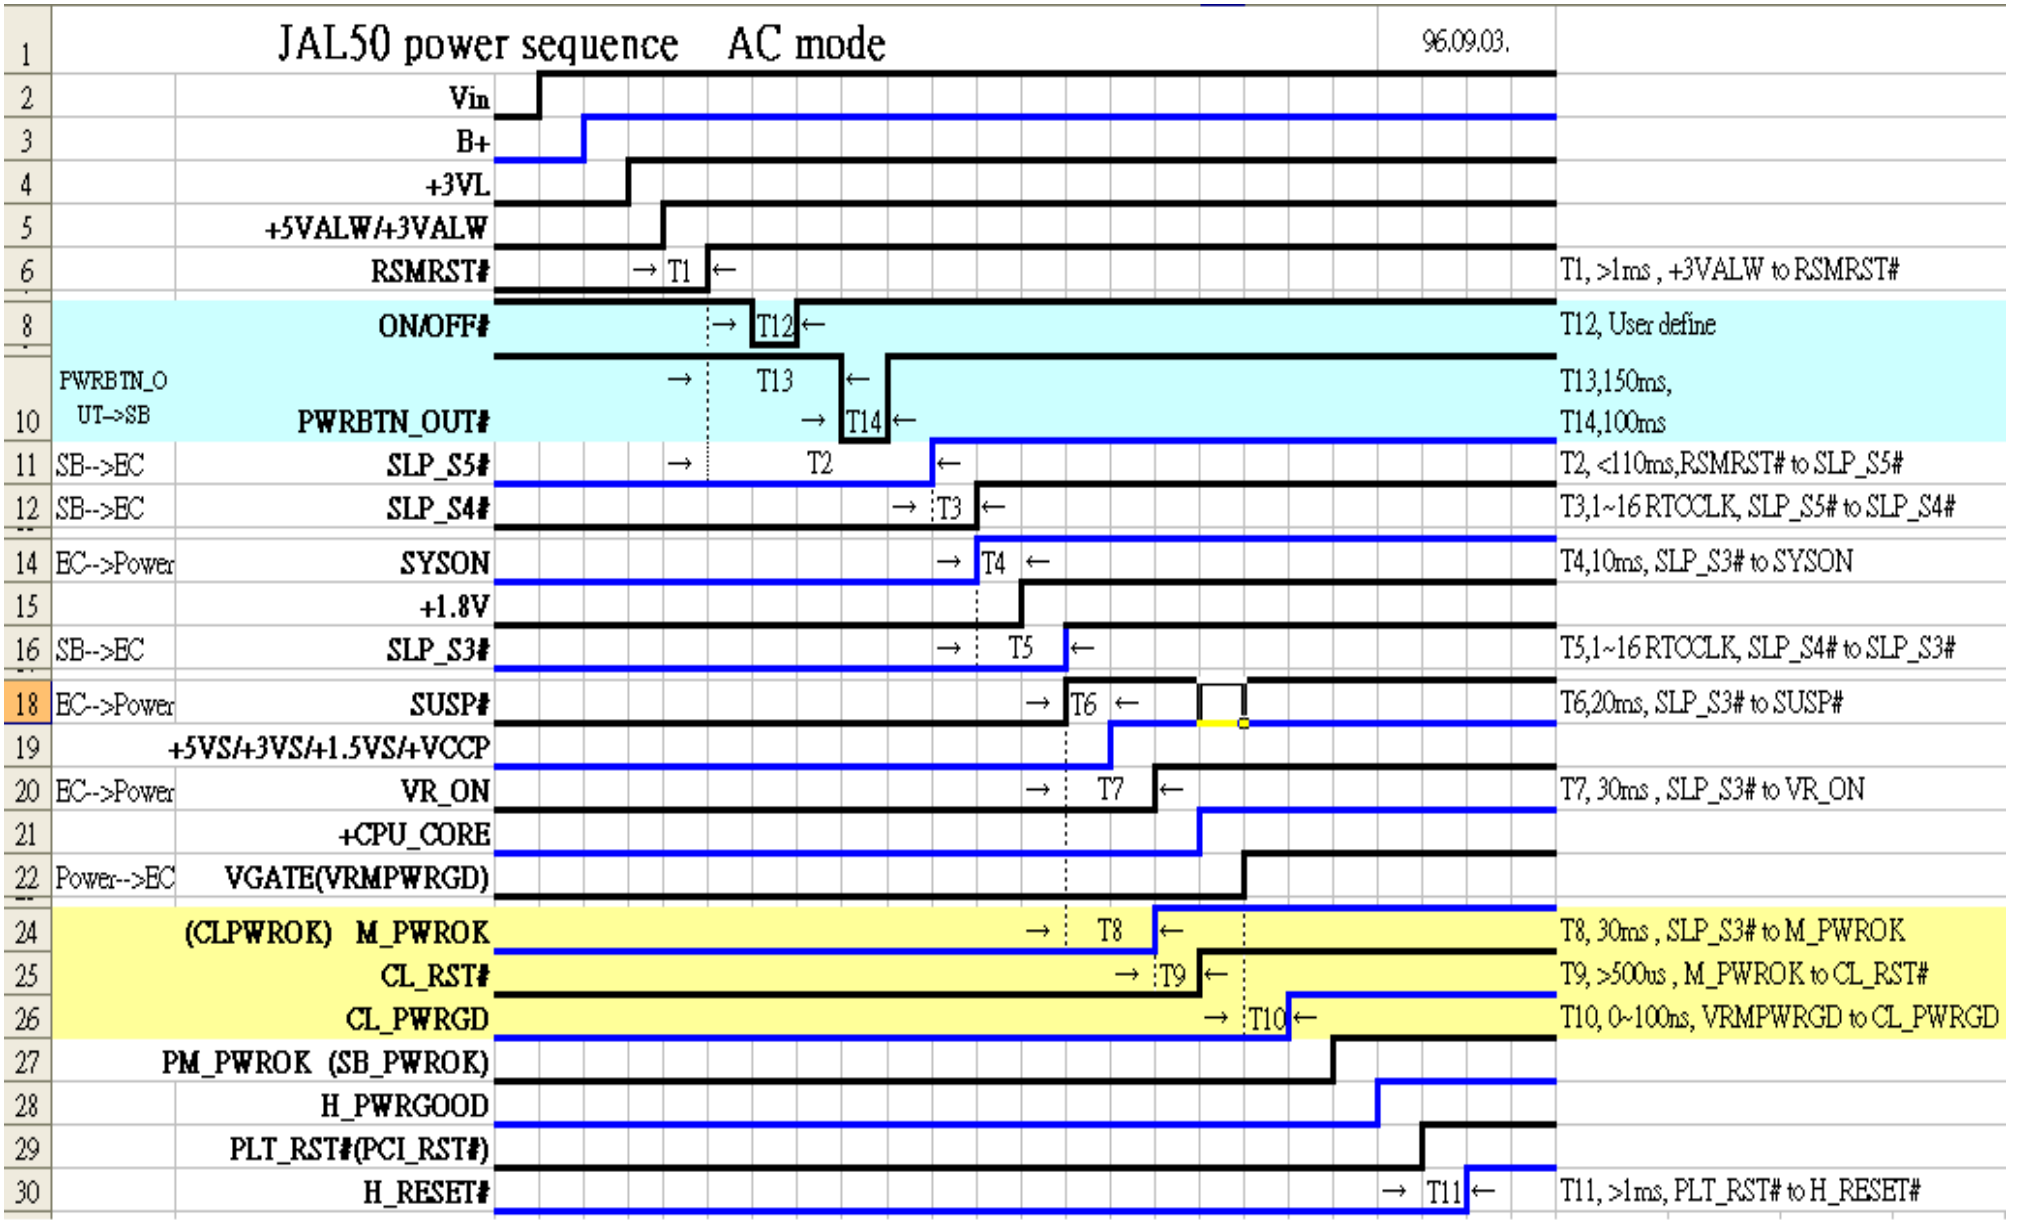

Security Classification	Compal Secret Data		
Issued Date	2007/08/28	Deciphered Date	2006/03/10

Compal Electronics, Inc.			
Title: Power sequence			
Size: Custom	Document Number: Montevina Blade UMA LA4101P		Rev: 0.3
Date: Saturday, January 05, 2008	Sheet 5 of 46		

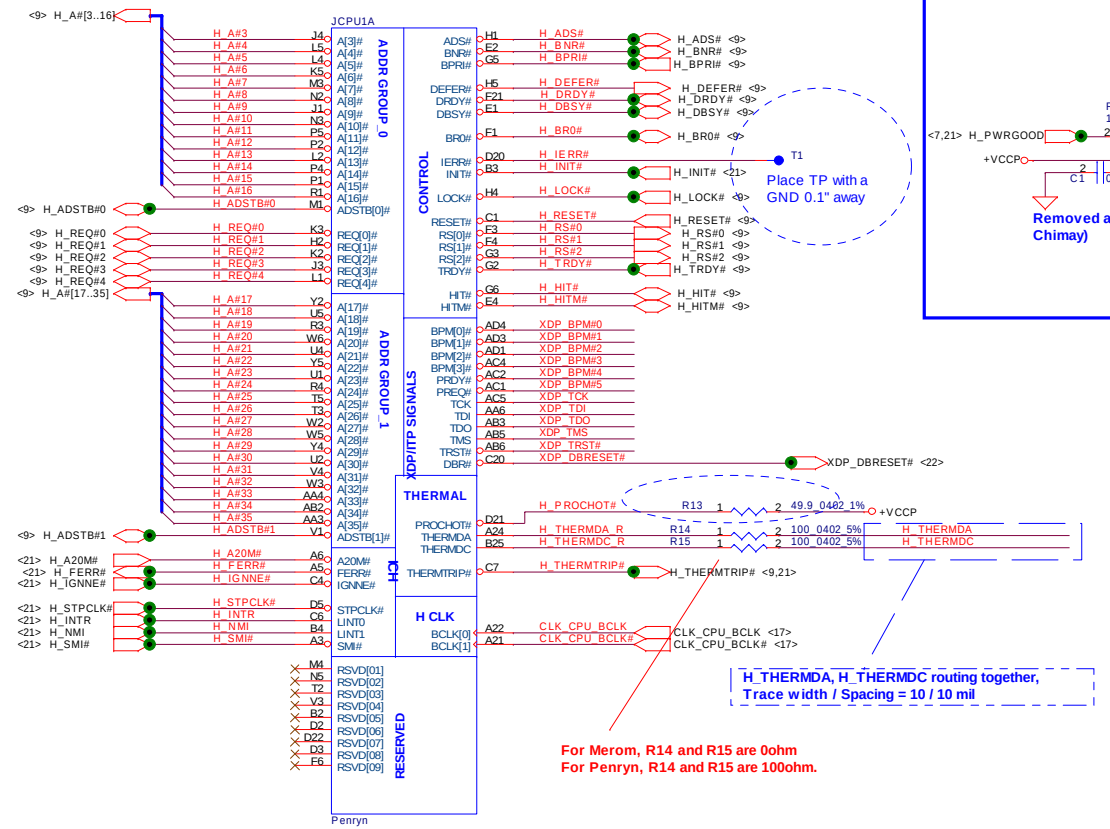

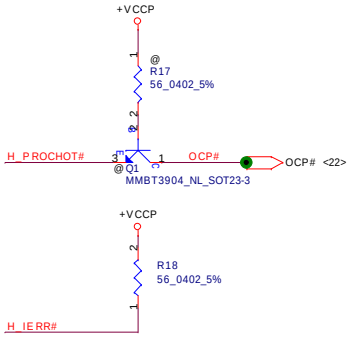

ITP-XDP Connector

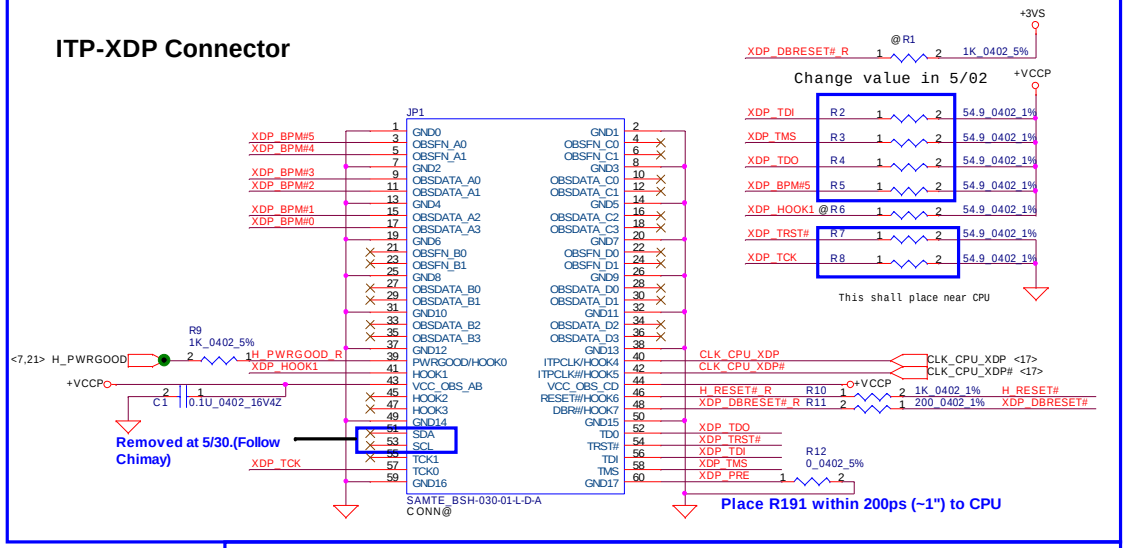

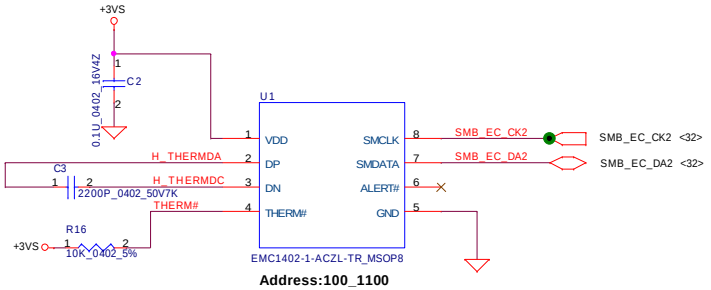

PWM Fan Control circuit

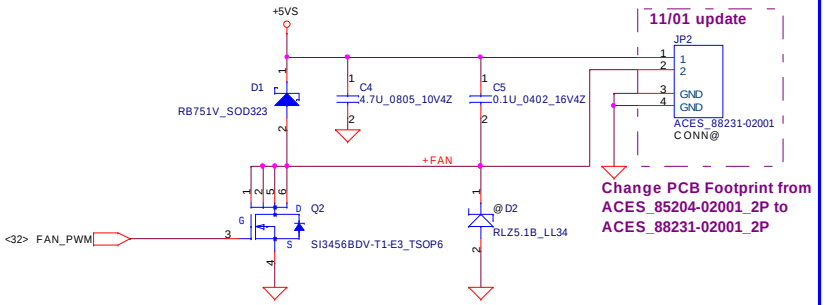

Security Classification	Compal Secret Data		
Issued Date	2007/08/28	Deciphered Date	2006/03/10

Compal Electronics, Inc.

Title: Penryn(1/3)-AGTL+/ITP-XDP

Size: Custom | Document Number: Montevina Blade UMA LA4101P | Rev: 0.3

Date: Saturday, January 05, 2008 | Sheet 6 of 46

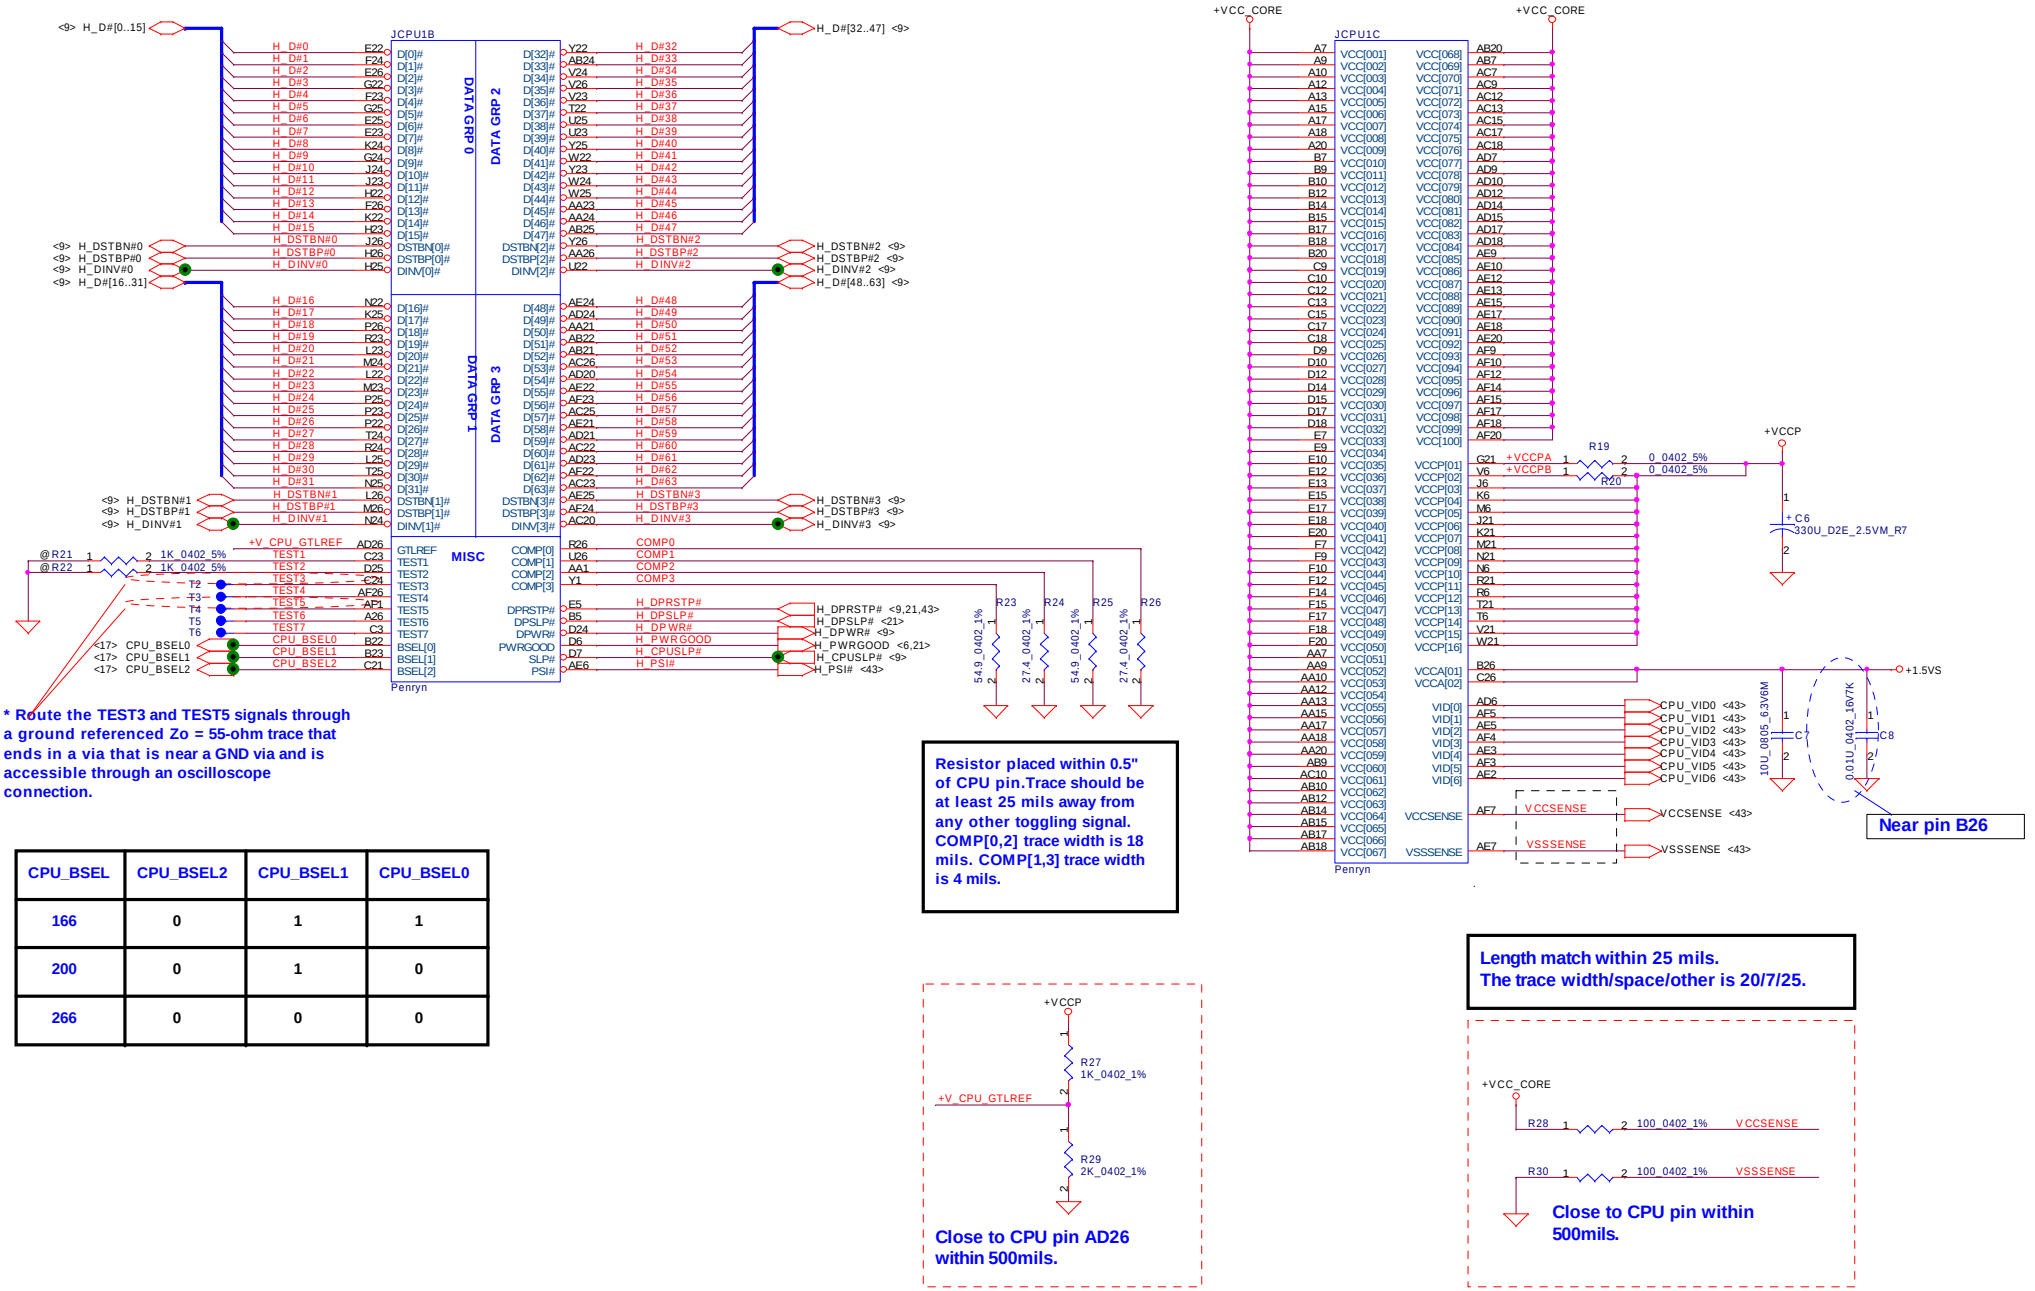

* Route the TEST3 and TEST5 signals through a ground referenced Zo = 55-ohm trace that ends in a via that is near a GND via and is accessible through an oscilloscope connection.

CPU_BSEL	CPU_BSEL2	CPU_BSEL1	CPU_BSEL0
166	0	1	1
200	0	1	0
266	0	0	0

Resistor placed within 0.5" of CPU pin.Trace should be at least 25 mils away from any other toggling signal. COMP[0,2] trace width is 18 mils. COMP[1,3] trace width is 4 mils.

Close to CPU pin AD26 within 500mils.

Length match within 25 mils.
The trace width/space/other is 20/7/25.

Close to CPU pin within 500mils.

Security Classification	Compal Secret Data		
Issued Date	2007/08/28	Deciphered Date	2006/03/10

Compal Electronics, Inc.

Title: Penryn(2/3)-AGTL+/ITP-XDP

Size: Custom | Document Number: Montevina Blade UMA LA4101P | Rev: 0.3

Date: Saturday, January 05, 2008 | Sheet 7 of 46

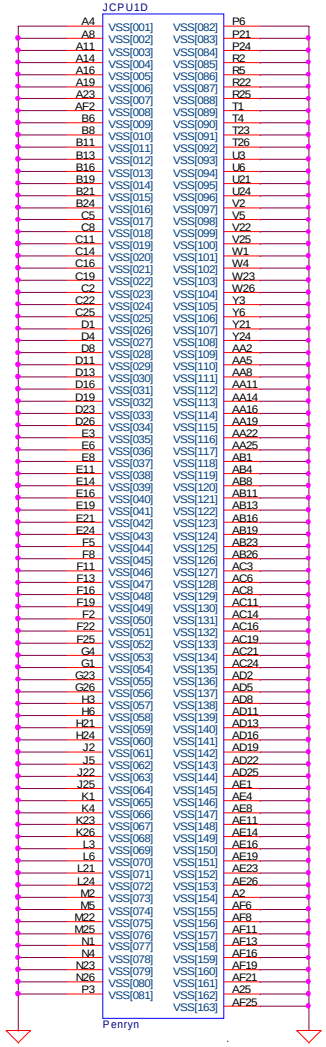

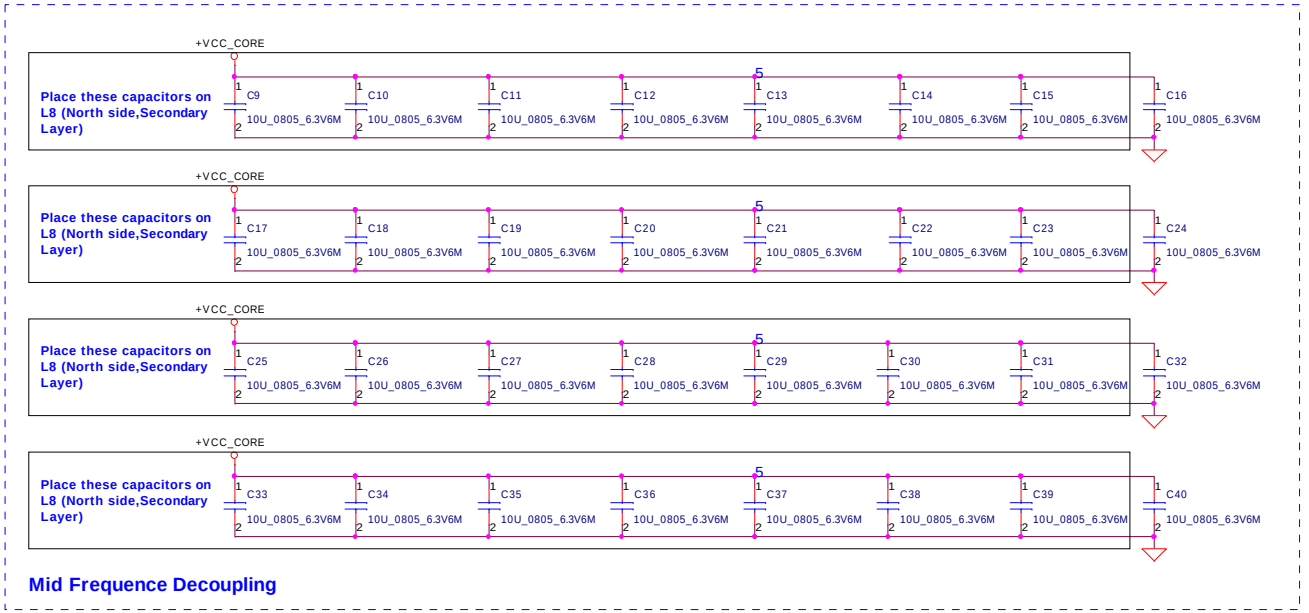

Near CPU CORE regulator

ESR <= 1.5m ohm
Capacitor > 1980uF

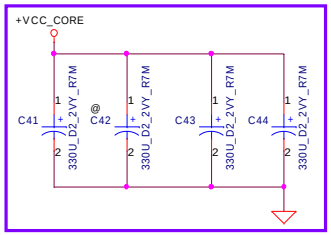

11/21 Change ESR=7m ohm

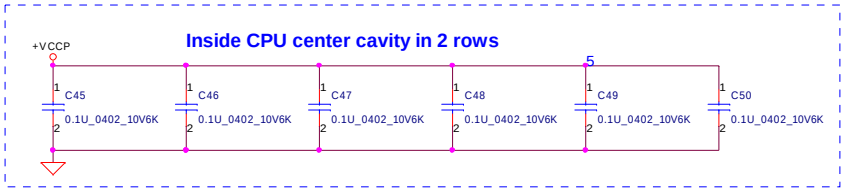

Security Classification	Compal Secret Data		
Issued Date	2007/08/28	Deciphered Date	2006/03/10

Compal Electronics, Inc.		
Title: Penryn(3/3)-AGTL+/ITP-XDP		
Size: Custom	Document Number: Montevina Blade UMA LA4101P	Rev: 0.3
Date: Saturday, January 05, 2008	Sheet 8 of 46	

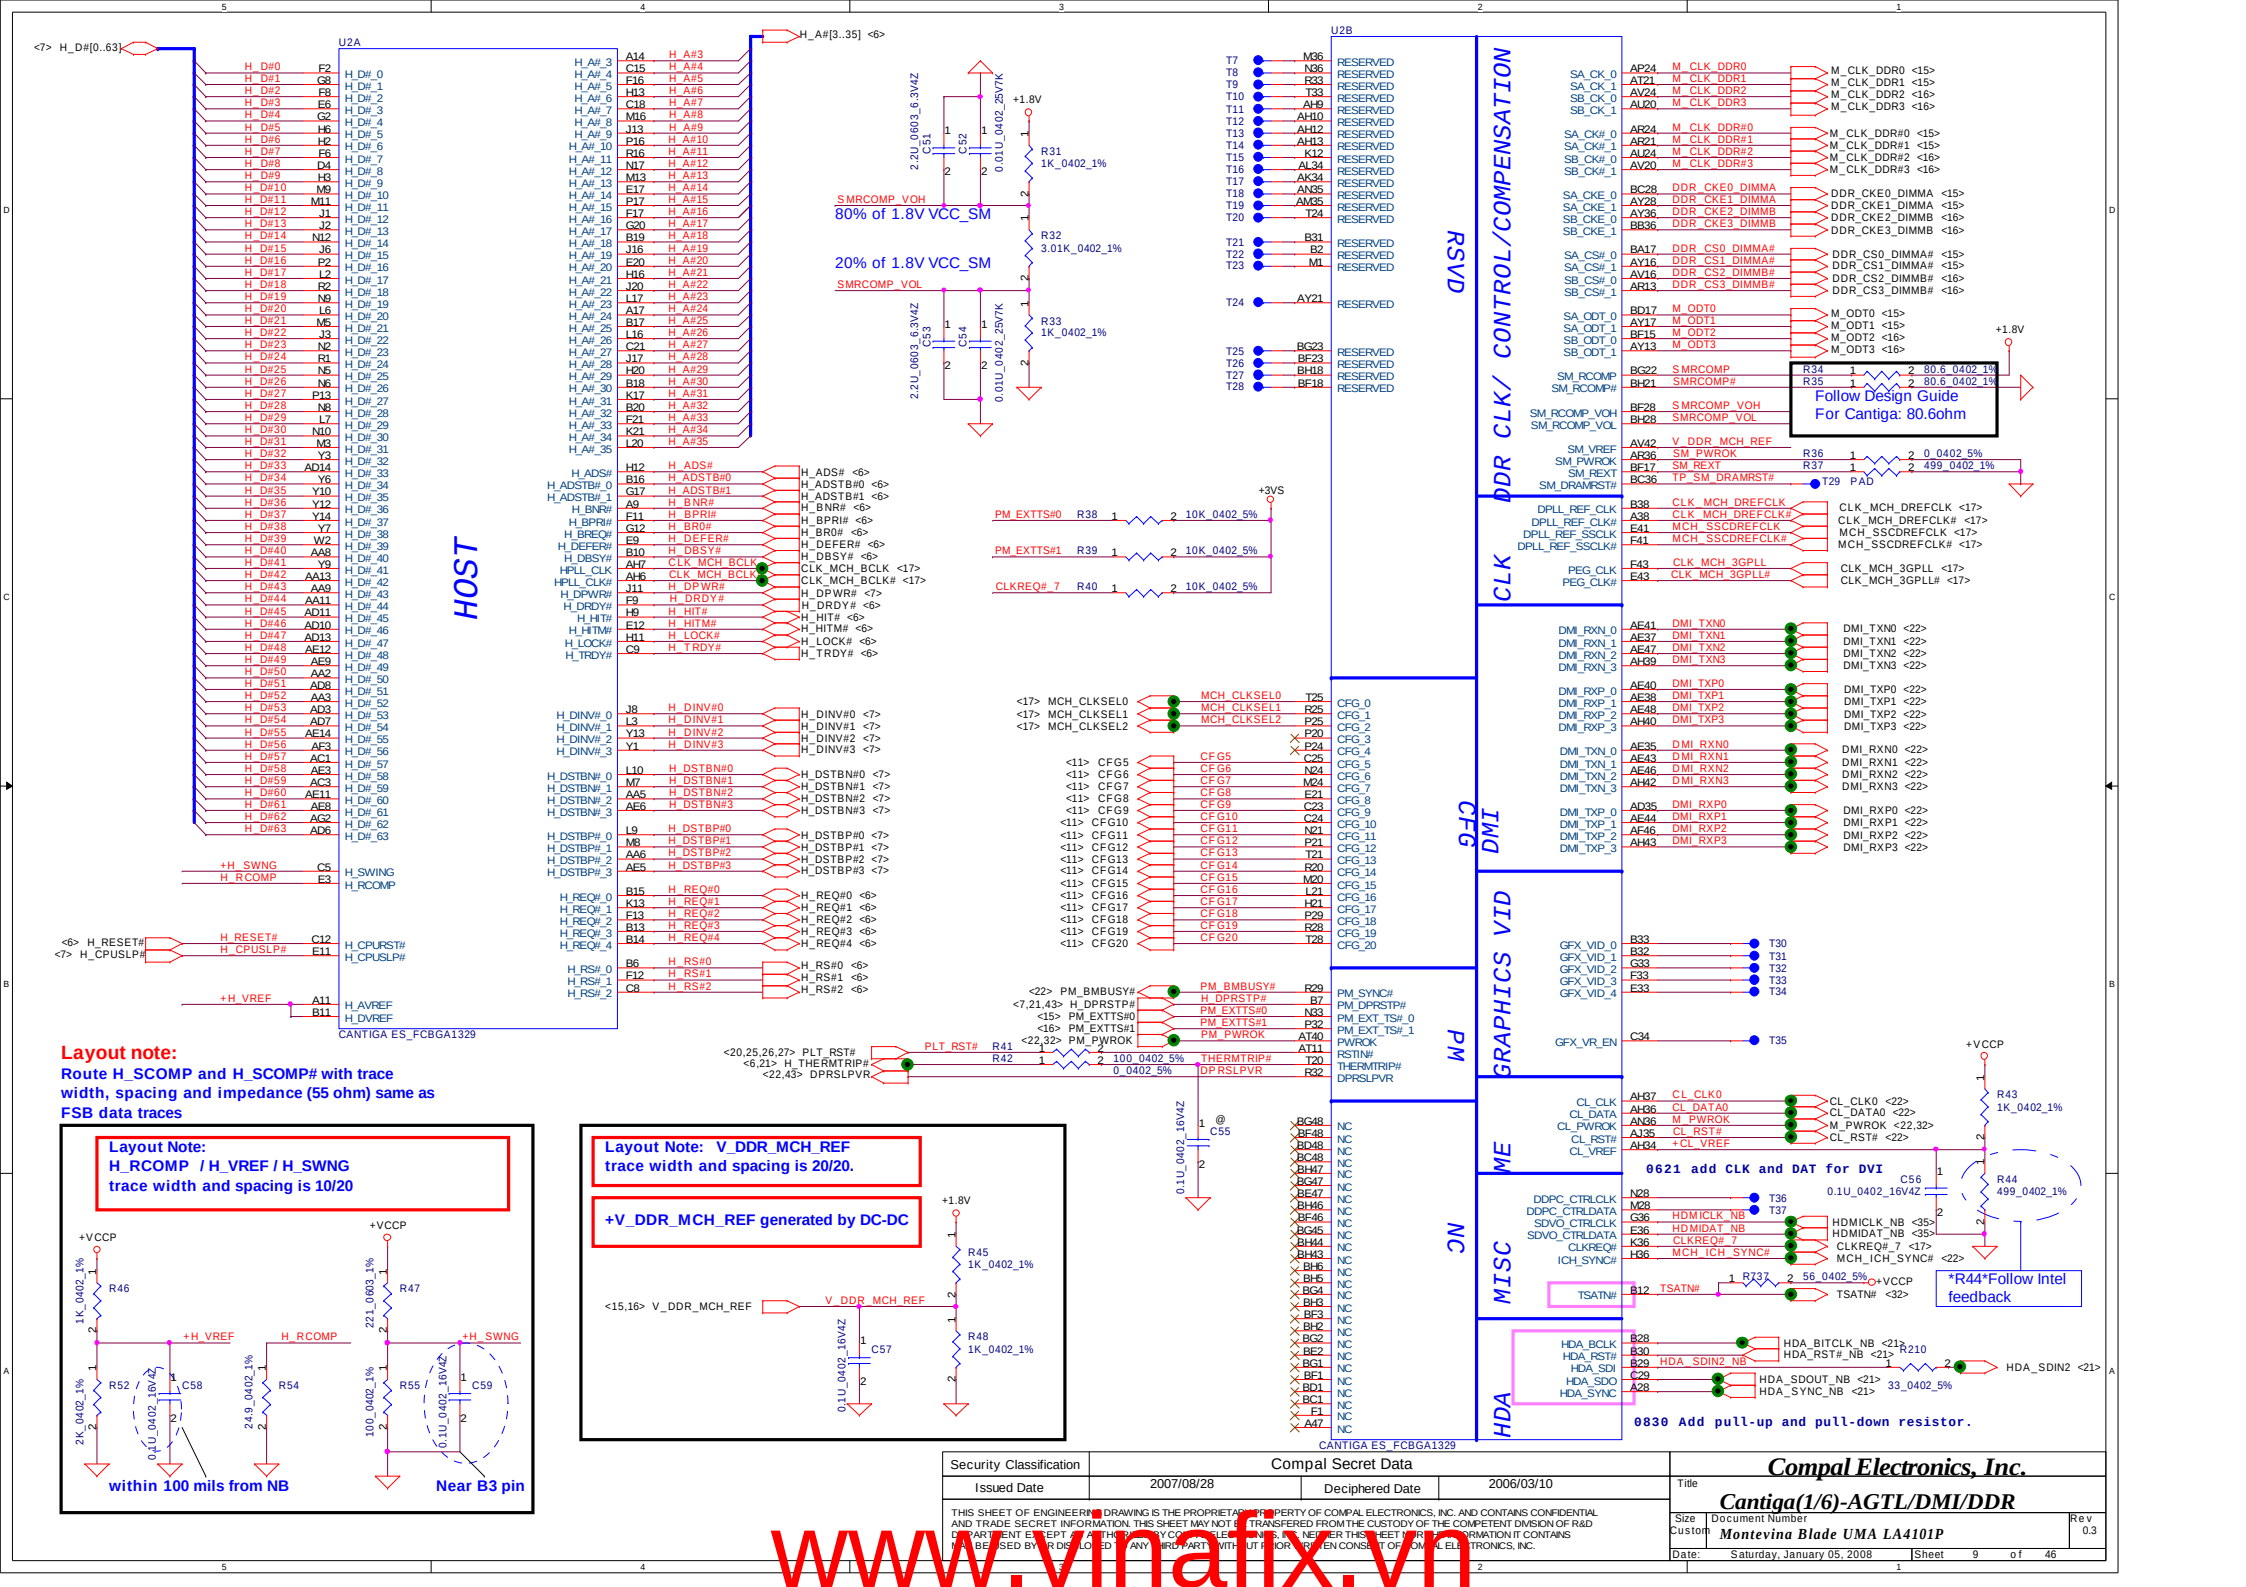

Security Classification	Compal Secret Data		
Issued Date	2007/08/28	Deciphered Date	2006/03/10

Compal Electronics, Inc.

Title: **Cantiga(1/6)-AGTL/DMI/DDR**

Size	Document Number	Rev
Custom	Montevina Blade UMA LA4101P	0.3

Date: Saturday, January 05, 2008 | Sheet 9 of 46

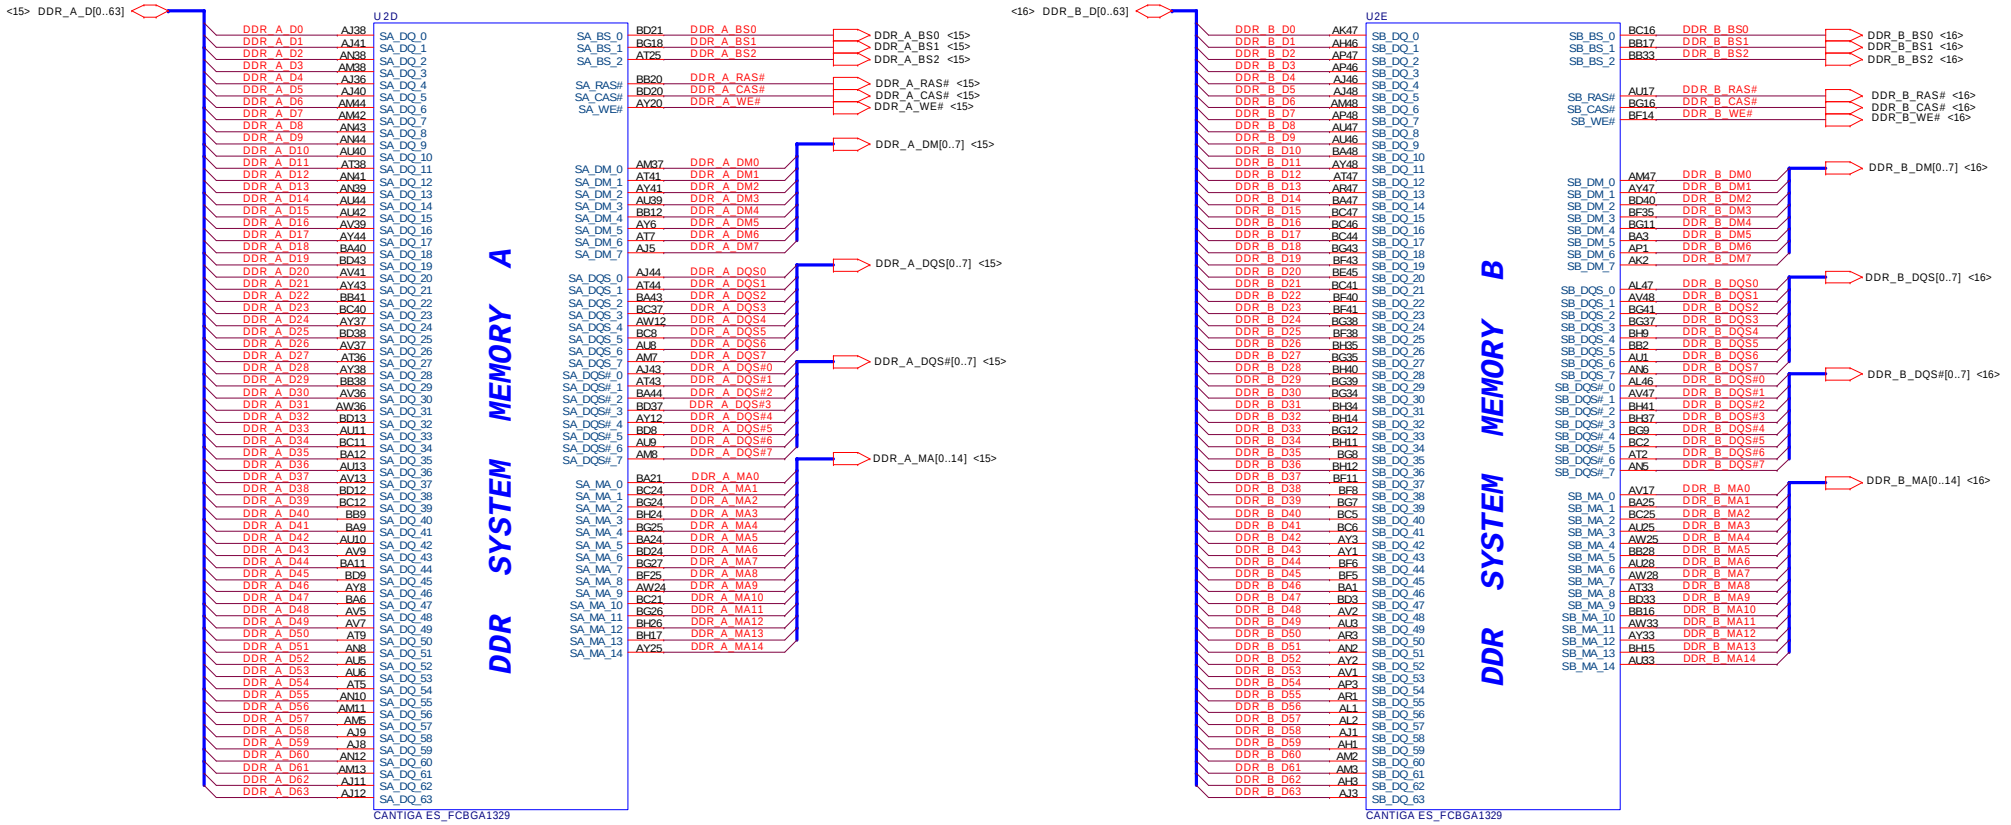

Security Classification	Compal Secret Data		
Issued Date	2007/08/28	Deciphered Date	2006/03/10

Compal Electronics, Inc.

Title: **Cantiga(2/6)-DDR2 A/B CH**

Size	Document Number	Rev
Custom	Montevina Blade UMA LA4101P	0.3

Date: Saturday, January 05, 2008 | Sheet 10 of 46

Strap Pin Table

CFG[2:0] FSB Freq select	000 = FSB 1066MHz 010 = FSB 800MHz 011 = FSB 667MHz Others = Reserved
CFG[4:3]	Reserved
CFG5 (DMI select)	0 = DMI x 2 1 = DMI x 4 *
CFG6	0 = The iTPM Host Interface is enable 1 = The iTPM Host Interface is disable *
CFG7 (Intel Management Engine Crypto strap)	0 =(TLS)chiper suite with no confidentiality 1 =(TLS)chiper suite with confidentiality *
CFG8	Reserved
CFG9 (PCIE Graphics Lane Reversal)	0 = Reverse Lane,15->0, 14->1 1 = Normal Operation,Lane Number in order *
CFG10 (PCIE Lookback enable)	0 = Enable 1 = Disable *
CFG11	Reserved
CFG[13:12] (XOR/ALLZ)	00 = Reserved 01 = XOR Mode Enabled 10 = All Z Mode Enabled 11 = Normal Operation (Default) *
CFG[15:14]	Reserved
CFG16 (FSB Dynamic ODT)	0 = Disabled 1 = Enabled *
CFG[18:17]	Reserved
CFG19 (DMI Lane Reversal)	0 = Normal Operation (Lane number in Order) * 1 = Reverse Lane
CFG20 (PCIE/SDVO concurrent)	0 = Only PCIE or SDVO is operational. * 1 = PCIE/SDVO are operating simu.

PEGCOMP trace width and spacing is 20/25 mils.

Follow Intel DG & Checklist

Follow Intel DG & Checklist

11/10 Disable TV out

Follow Intel DG & Checklist

Solve 3G WWAN issue

Security Classification	Compal Secret Data
Issued Date	2007/08/28
Deciphered Date	2006/03/10

THIS SHEET OF ENGINEERING DRAWING IS THE PROPRIETARY PROPERTY OF COMPAL ELECTRONICS, INC. AND CONTAINS CONFIDENTIAL AND TRADE SECRET INFORMATION. THIS SHEET MAY NOT BE TRANSFERED FROM THE CUSTODY OF THE COMPETENT DIVISION OF R&D DEPARTMENT EXCEPT AS AUTHORIZED BY COMPAL ELECTRONICS, INC. NEITHER THIS SHEET NOR THE INFORMATION IT CONTAINS MAY BE USED BY OR DISCLOSED TO ANY THIRD PARTY WITHOUT PRIOR WRITTEN CONSENT OF COMPAL ELECTRONICS, INC.

Compal Electronics, Inc.

Title: Cantiga(3/6)-VGA/LVDS/TV

Size: Custom | Document Number: Montevina Blade UMA LA4101P | Rev: 0.3

Date: Saturday, January 05, 2008 | Sheet 11 of 46

RED Mark: Means UMA & dis@ Power select
~It check by INTEL Graphics Disable Guidelines~

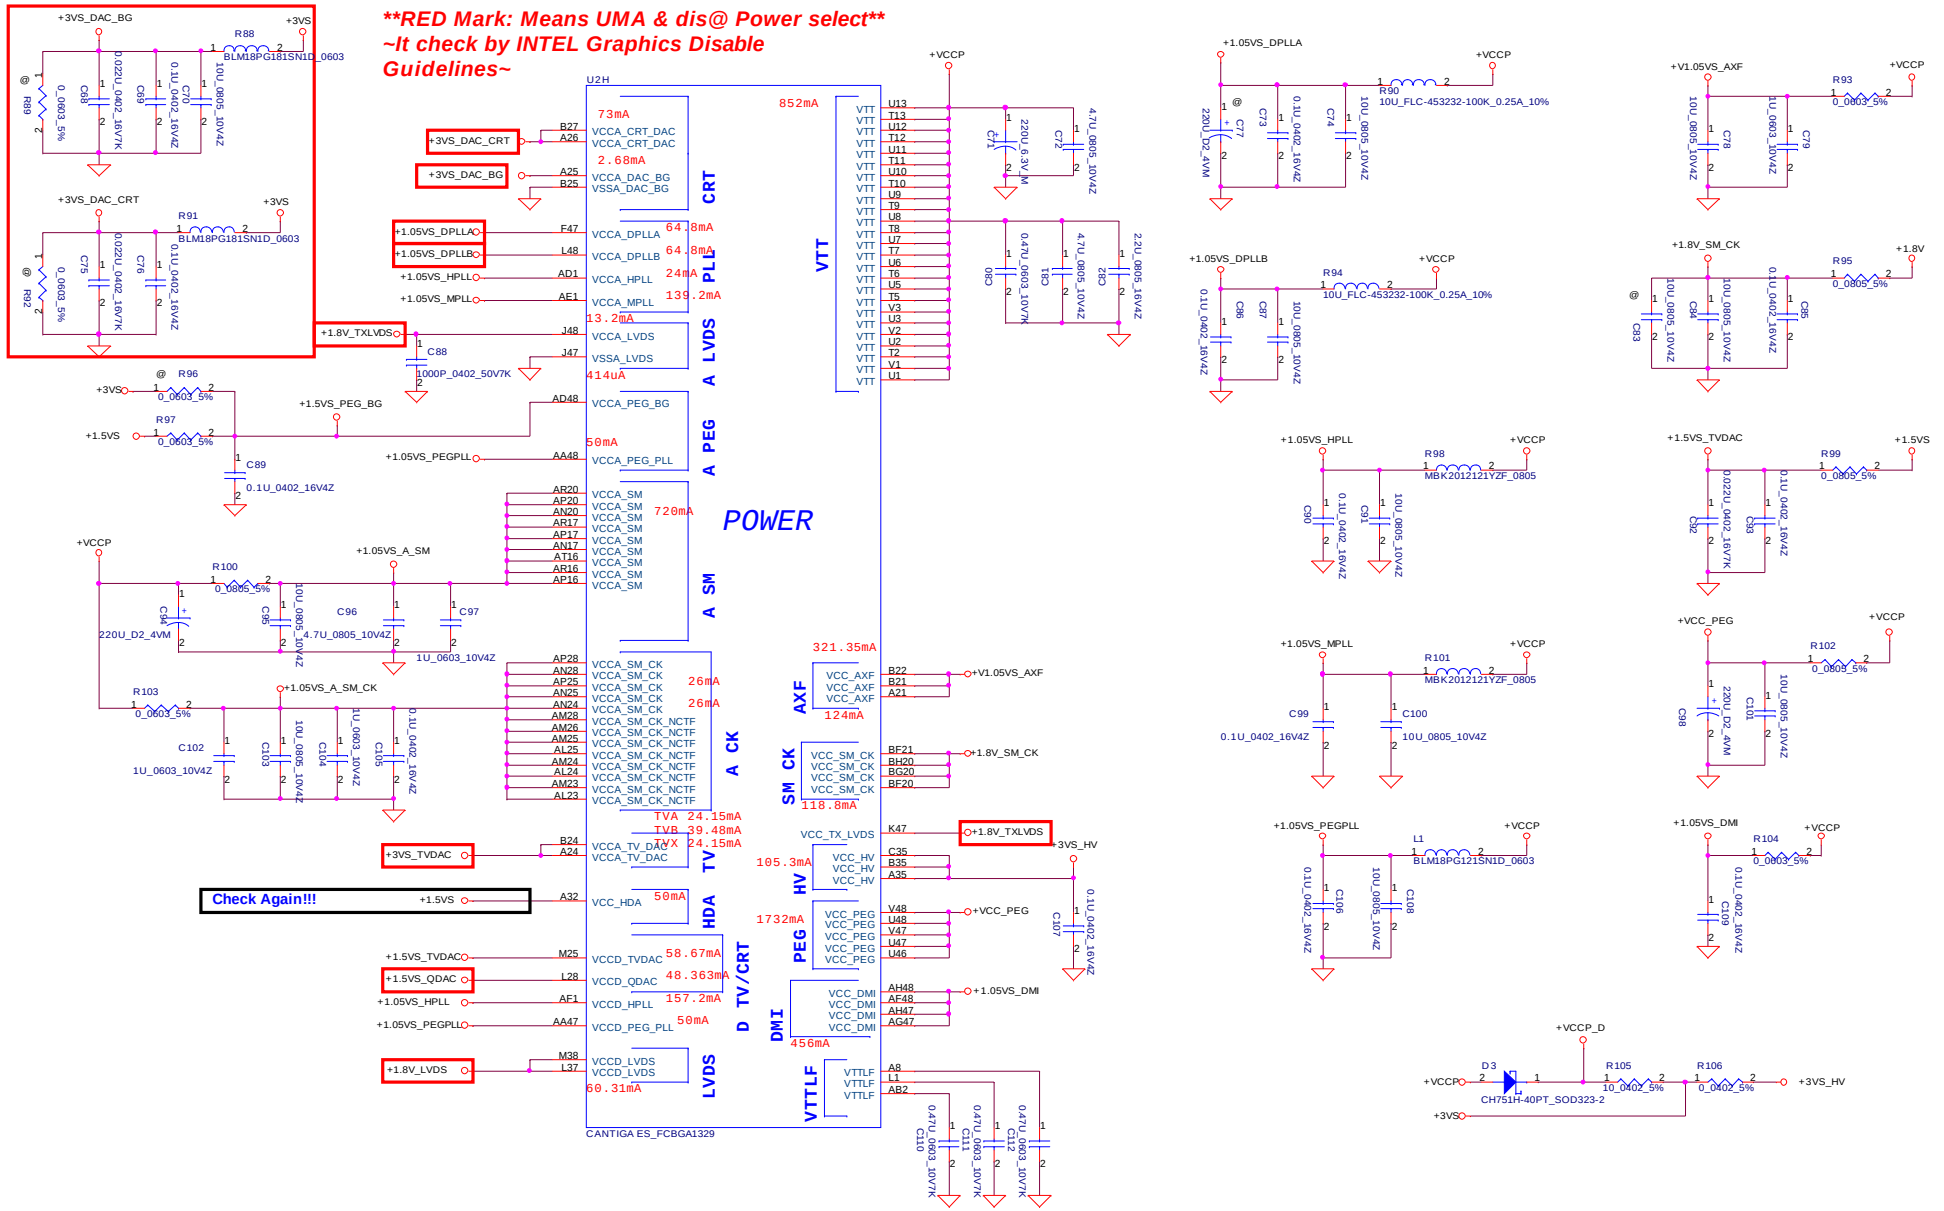

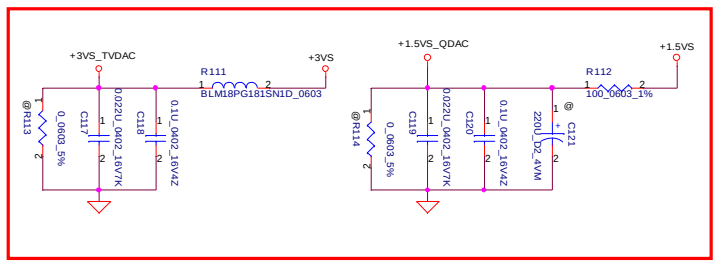

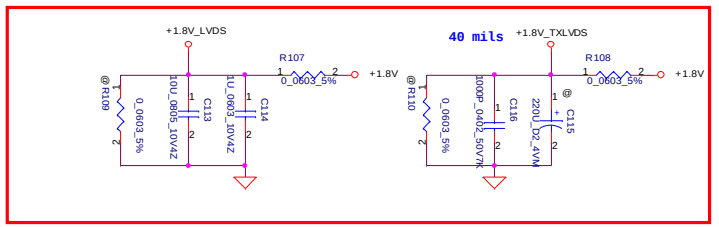

Security Classification	Compal Secret Data		
Issued Date	2007/08/28	Deciphered Date	2006/03/10

Title	Cantiga(4/6)-PWR
Size	Custom
Document Number	Montevina Blade UMA LA4101P
Rev	0.3
Date:	Saturday, January 05, 2008
Sheet	12 of 46

Compal Electronics, Inc.

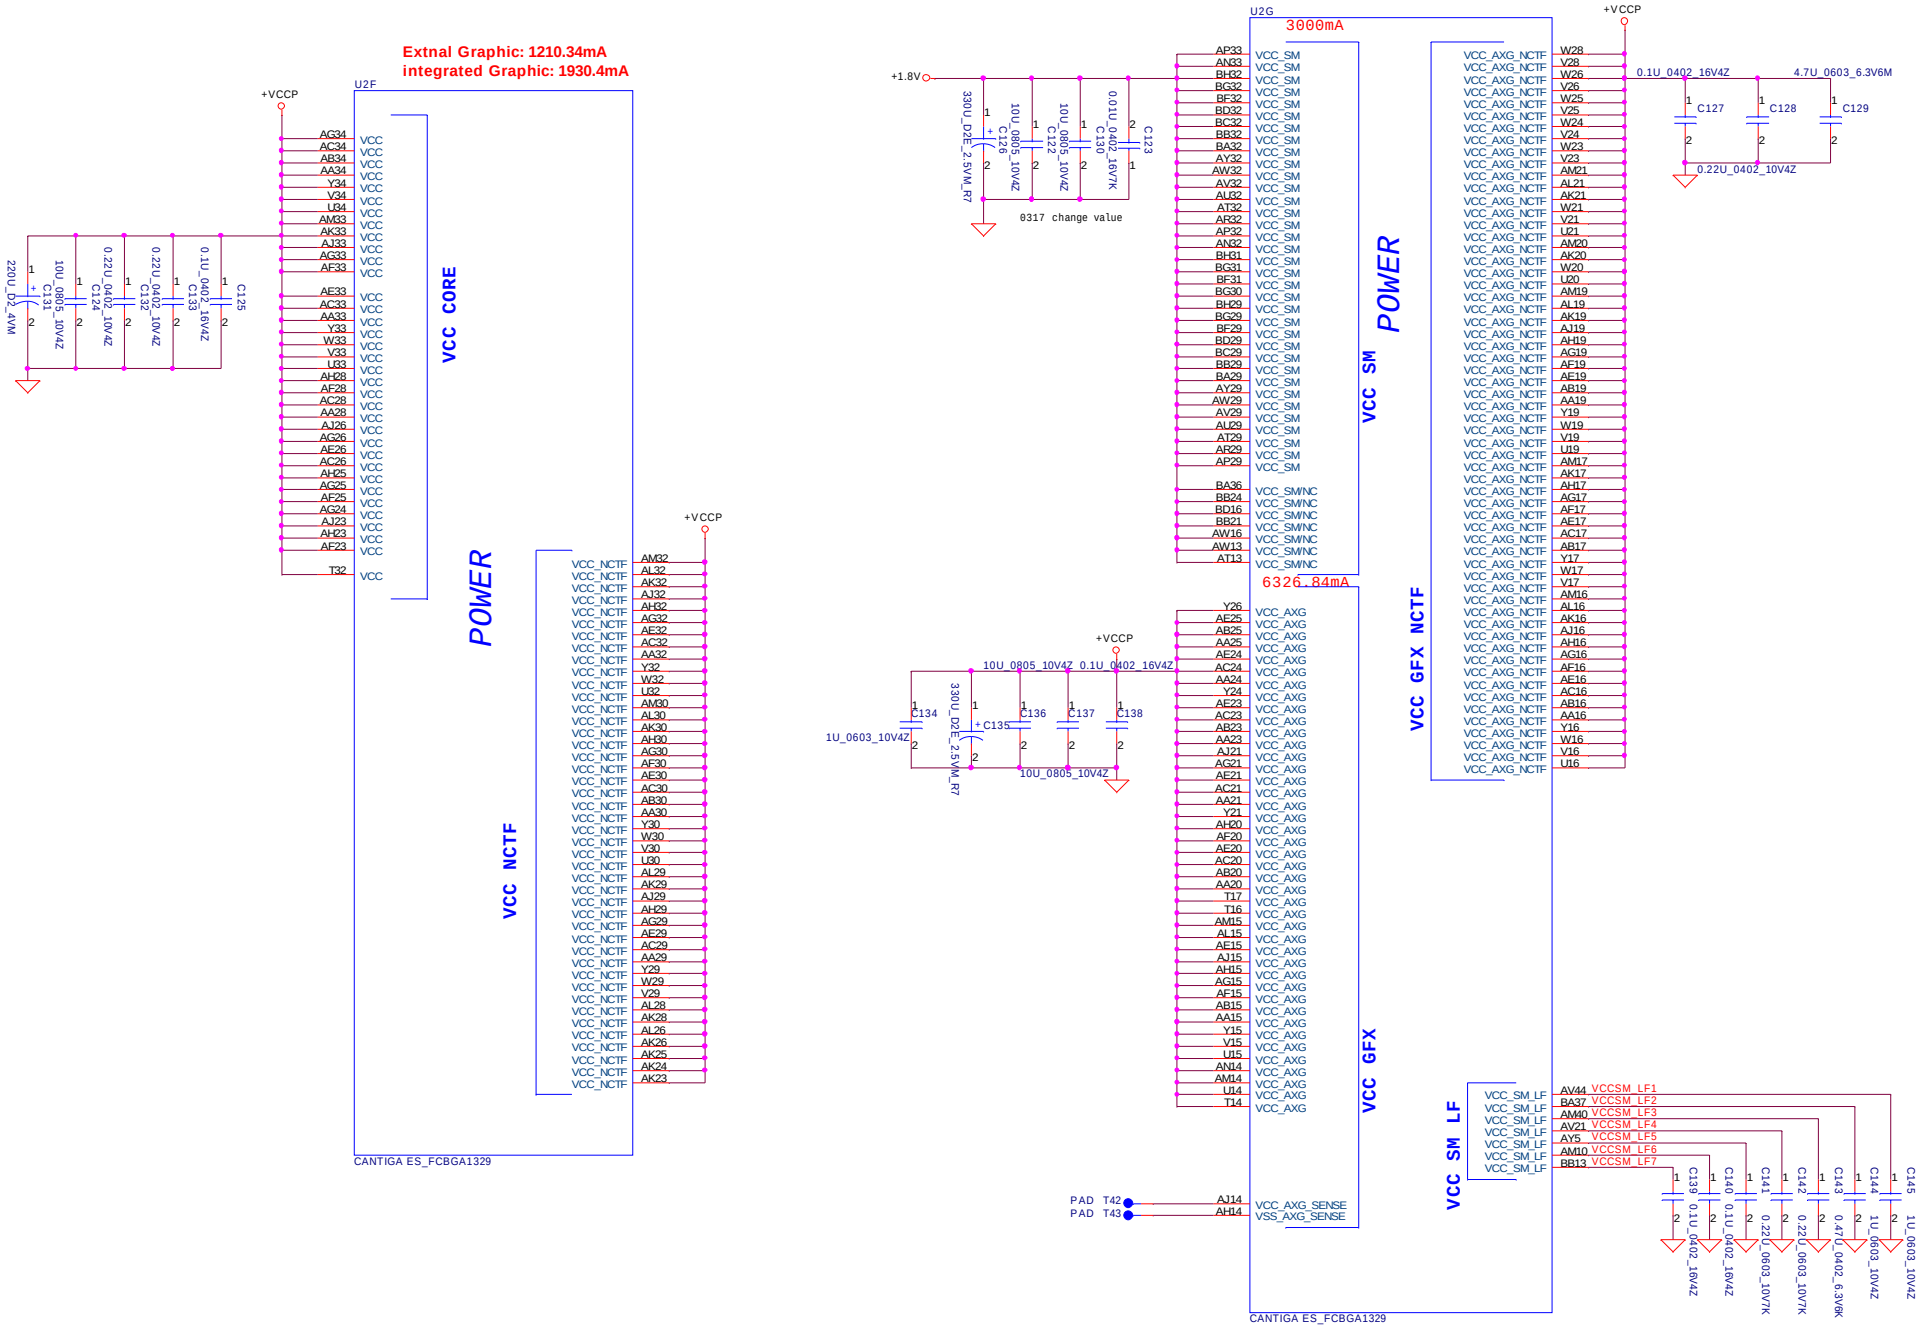

Security Classification	Compal Secret Data		
Issued Date	2007/08/28	Deciphered Date	2006/03/10

Compal Electronics, Inc.

Title: **Cantiga(5/6)-PWR/GND**

Size	Document Number	Rev
Custom	Montevina Blade UMA LA4101P	0.3

Date: Saturday, January 05, 2008 | Sheet 13 of 46

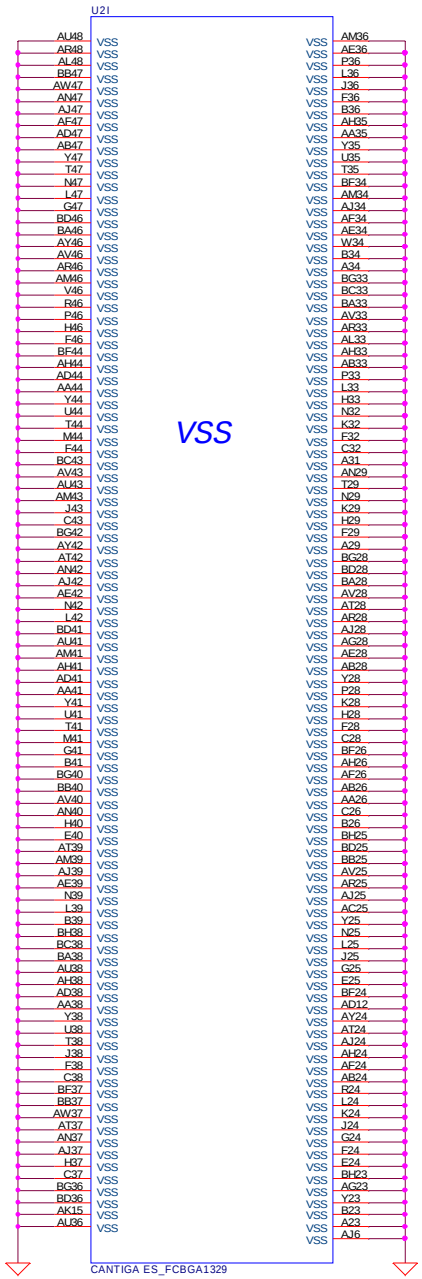

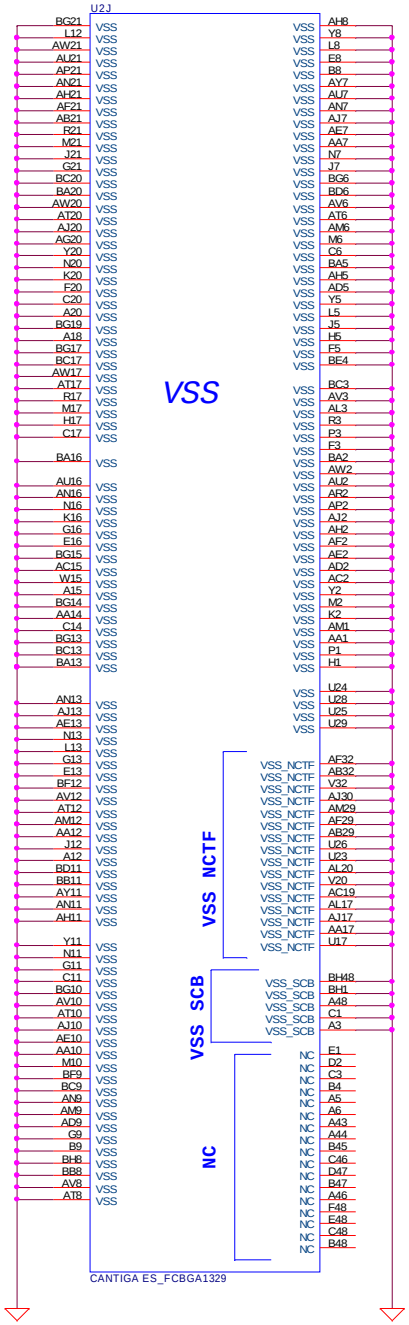

Security Classification	Compal Secret Data		
Issued Date	2007/08/28	Deciphered Date	2006/03/10

Compal Electronics, Inc.			
Title: Cantiga(6/6)-PWR/GND			
Size: Custom	Document Number: Montevina Blade UMA LA4101P		Rev: 0.3
Date: Saturday, January 05, 2008	Sheet 14 of 46		

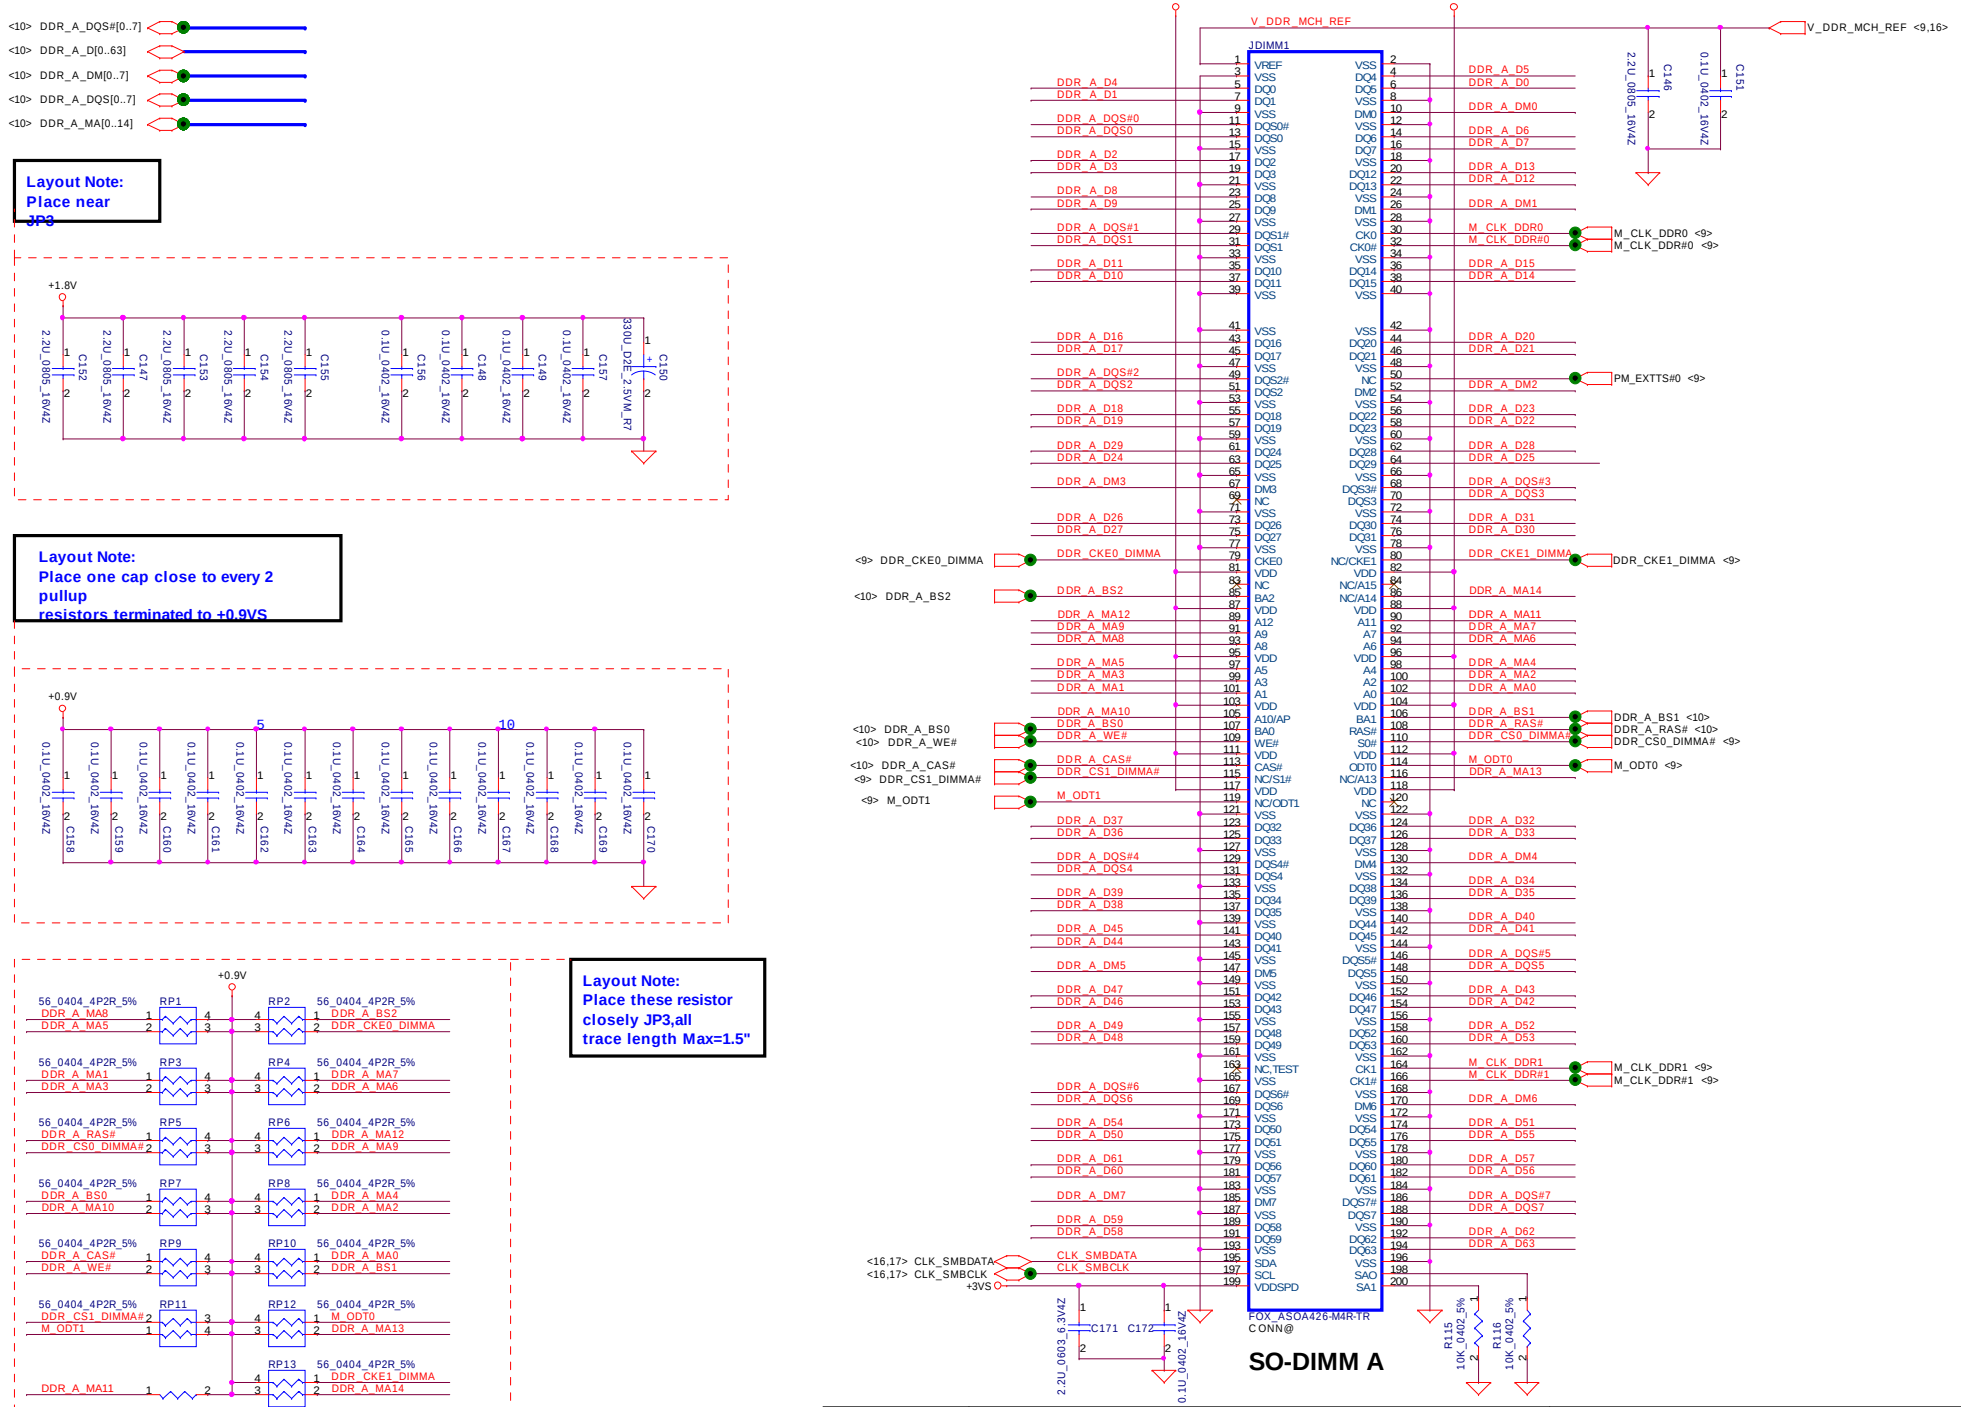

Security Classification	Compal Secret Data		
Issued Date	2006/02/13	Deciphered Date	2006/03/10

Compal Electronics, Inc.

Title: DDRII-SODIMM SLOT1

Size	Document Number	Rev
Custom	Montevina Blade UMA LA4101P	0.3

Date: Saturday, January 05, 2008 Sheet 15 of 46

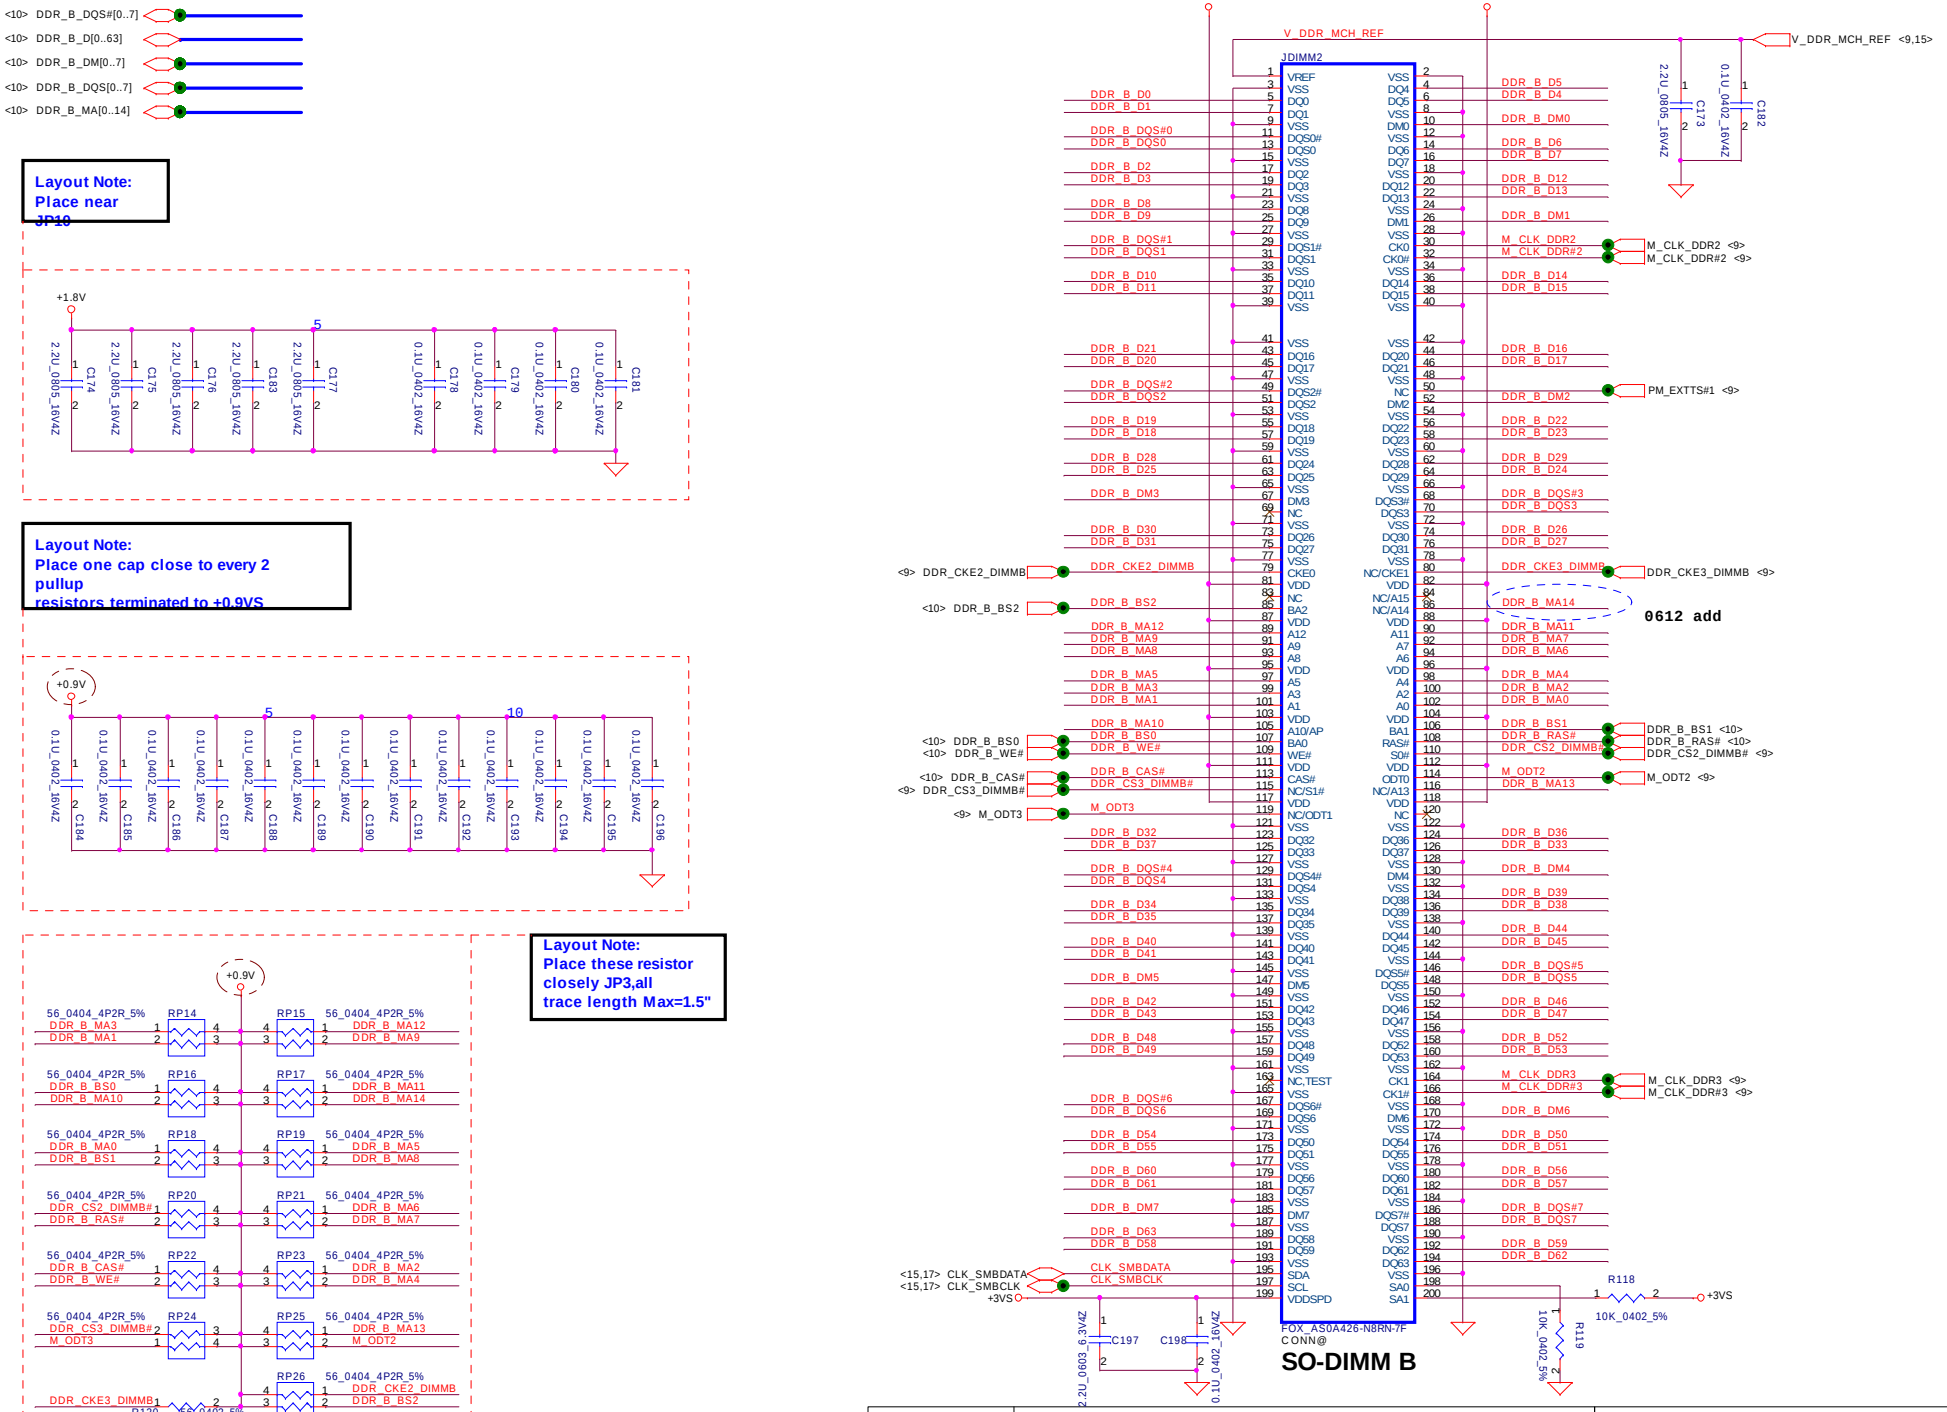

Security Classification	Compal Secret Data		
Issued Date	2006/02/13	Deciphered Date	2006/03/10

Compal Electronics, Inc.

Title: DDRII-SODIMM SLOT2

Size | Document Number: Montevina Blade UMA LA4101P | Rev: 0.3

Date: Saturday, January 05, 2008 | Sheet 16 of 46

FSC CLKSEL2	FSB CLKSEL1	FSA CLKSEL0	CPU MHz	SRC MHz	PCI MHz	REF MHz	DOT_96 MHz	USB MHz
0	0	0	266	100	33.3	14.318	96.0	48.0
0	0	1	133	100	33.3	14.318	96.0	48.0
0	1	0	200	100	33.3	14.318	96.0	48.0
0	1	1	166	100	33.3	14.318	96.0	48.0
1	0	0	333	100	33.3	14.318	96.0	48.0
1	0	1	100	100	33.3	14.318	96.0	48.0
1	1	0	400	100	33.3	14.318	96.0	48.0
1	1	1	Reserved					

Routing the trace at least 10mil

Place close to U51

Vendor suggests 22pF

Change 33M and 48M damping to 39M by EMI request

No Debug port anymore

ITP_EN	0 = SRC8/SRC8# 1 = ITP/ITP#
PCI_CLK3	0 = Enable DOT96 & SRC1(UMA) 1 = Enable SRC0 & 27MHz(DIS)

<BOM Structure>

Security Classification	Compal Secret Data		
Issued Date	2007/08/28	Deciphered Date	2006/03/10

Compal Electronics, Inc.

Title: Clock Generator CK505

Size | Document Number: Montevina Blade UMA LA4101P | Rev: 0.3

Date: Saturday, January 05, 2008 | Sheet 17 of 46

CRT Connector

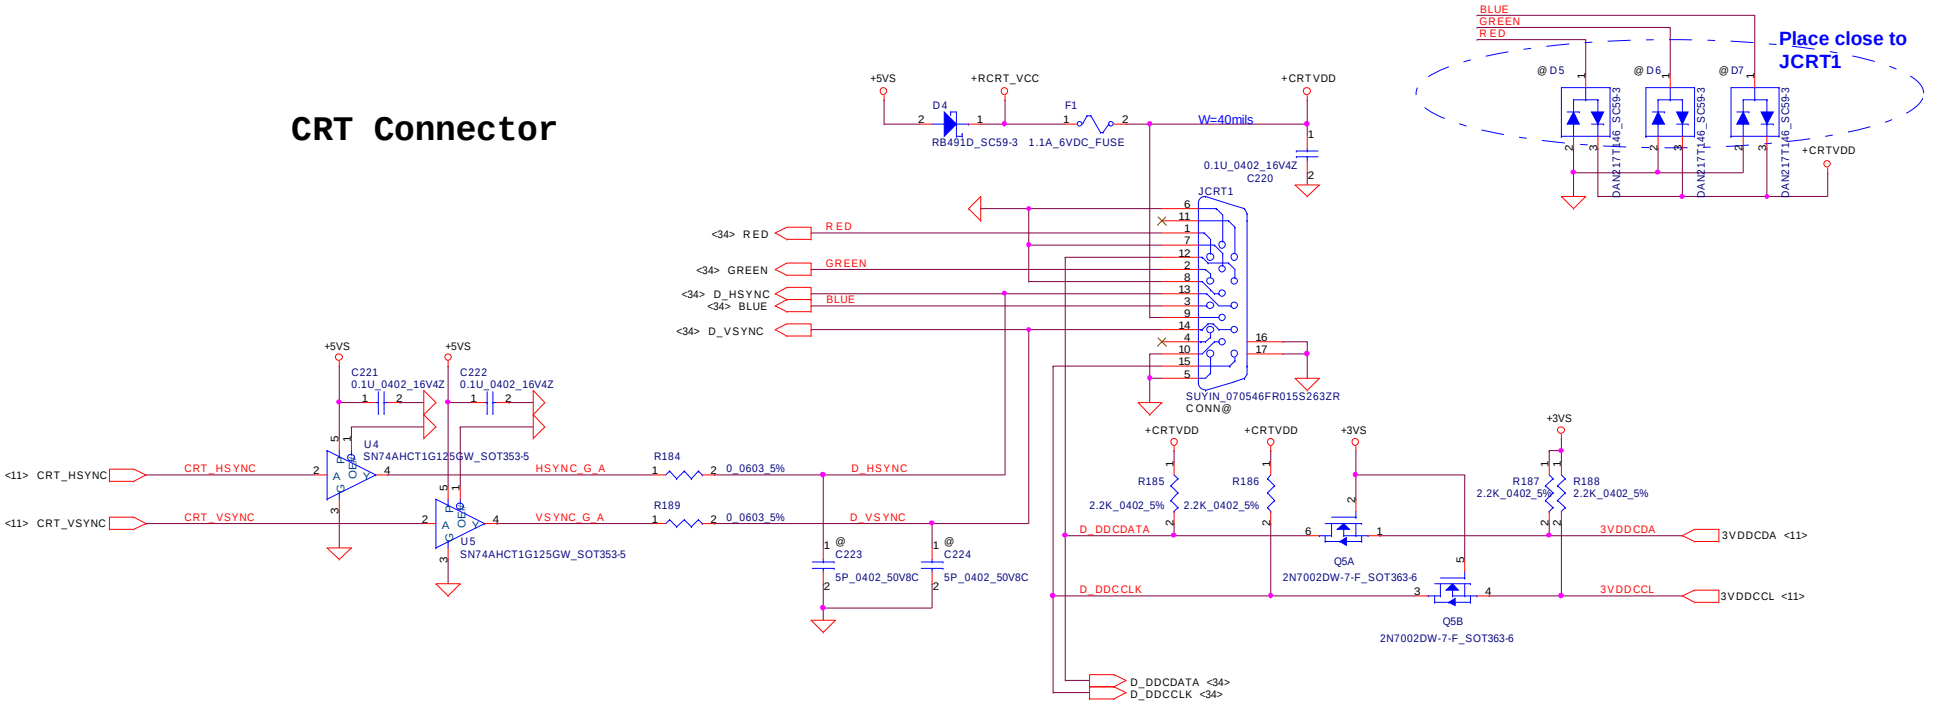

CRT Termination/EMI Filter

11/07 Change CRT lounting NB-->Docking-->CRT connector

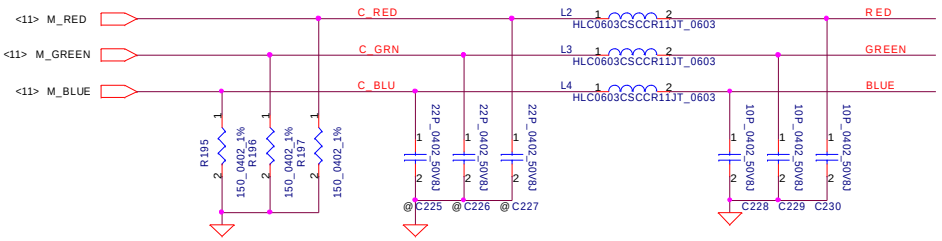

Security Classification	Compal Secret Data		
Issued Date	2007/08/28	Deciphered Date	2006/07/26

Compal Electronics, Inc.			
Title: CRT Connector			
Size	Document Number: Montevina Blade UMA LA4101P		Rev 0.3
Date: Saturday, January 05, 2008	Sheet 18 of 46		

LVDS CONN & USB Camera + Dig Mic

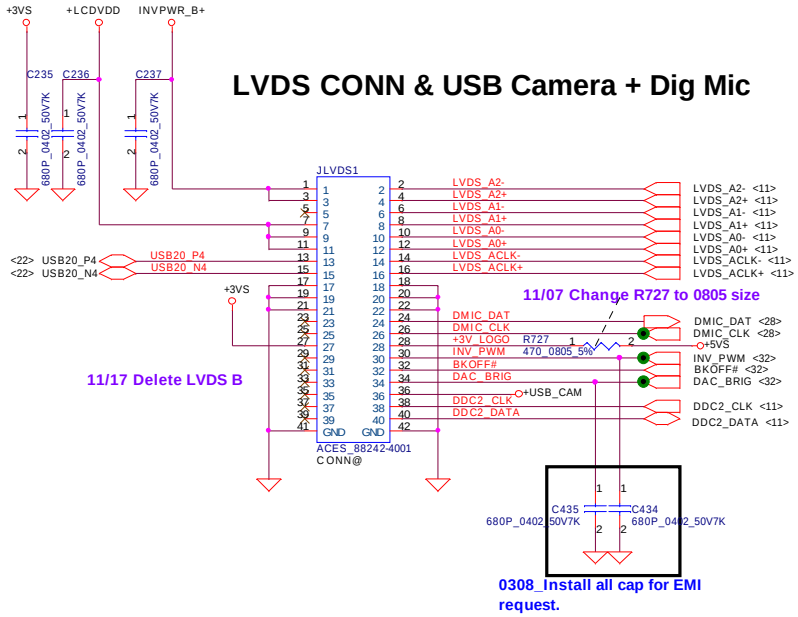

11/07 Change R727 to 0805 size

11/17 Delete LVDS B

0308_Install all cap for EMI request.

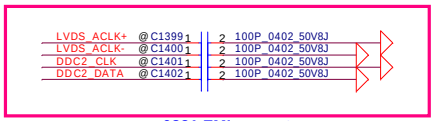

0831 EMI request

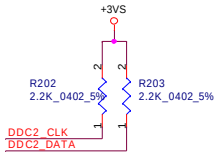

Must close JLVDS1pin 24、26

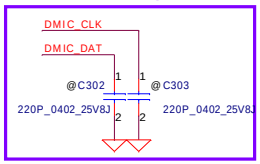

11/09 EMI reserver

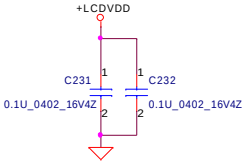

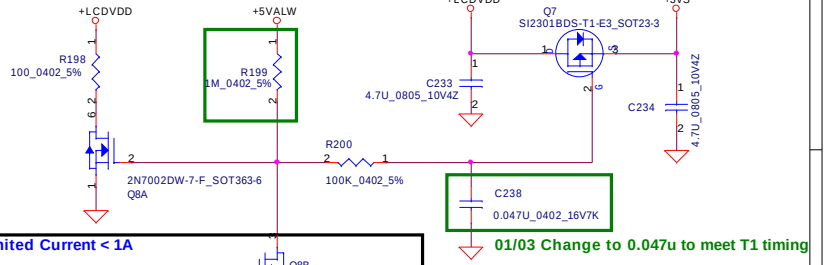

01/03 Change to 0.047u to meet T1 timing

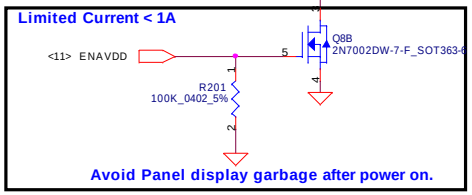

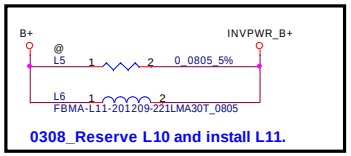

USB Camera

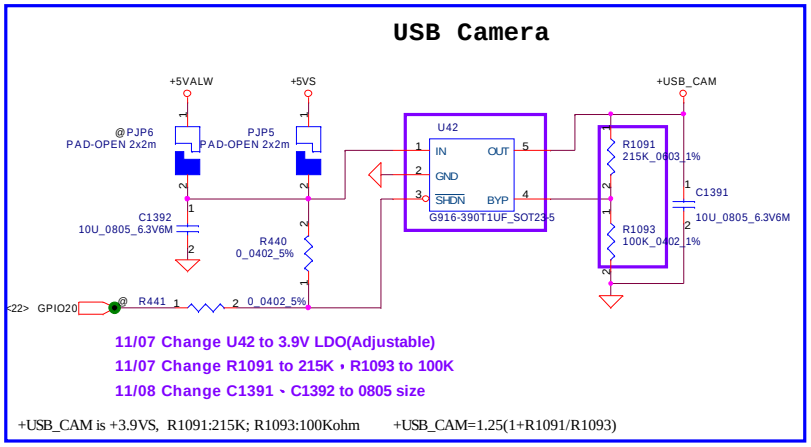

11/07 Change U42 to 3.9V LDO(Adjustable)

11/07 Change R1091 to 215K、R1093 to 100K

11/08 Change C1391、C1392 to 0805 size

+USB_CAM is +3.9VS, R1091:215K; R1093:100Kohm +USB_CAM=1.25(1+R1091/R1093)

Security Classification	Compal Secret Data		
Issued Date	2007/08/28	Deciphered Date	2006/07/26

Compal Electronics, Inc.

Title: LCD CONN.

Size | Document Number: Montevina Blade UMA LA4101P | Rev: 0.3

Date: Saturday, January 05, 2008 | Sheet 19 of 46

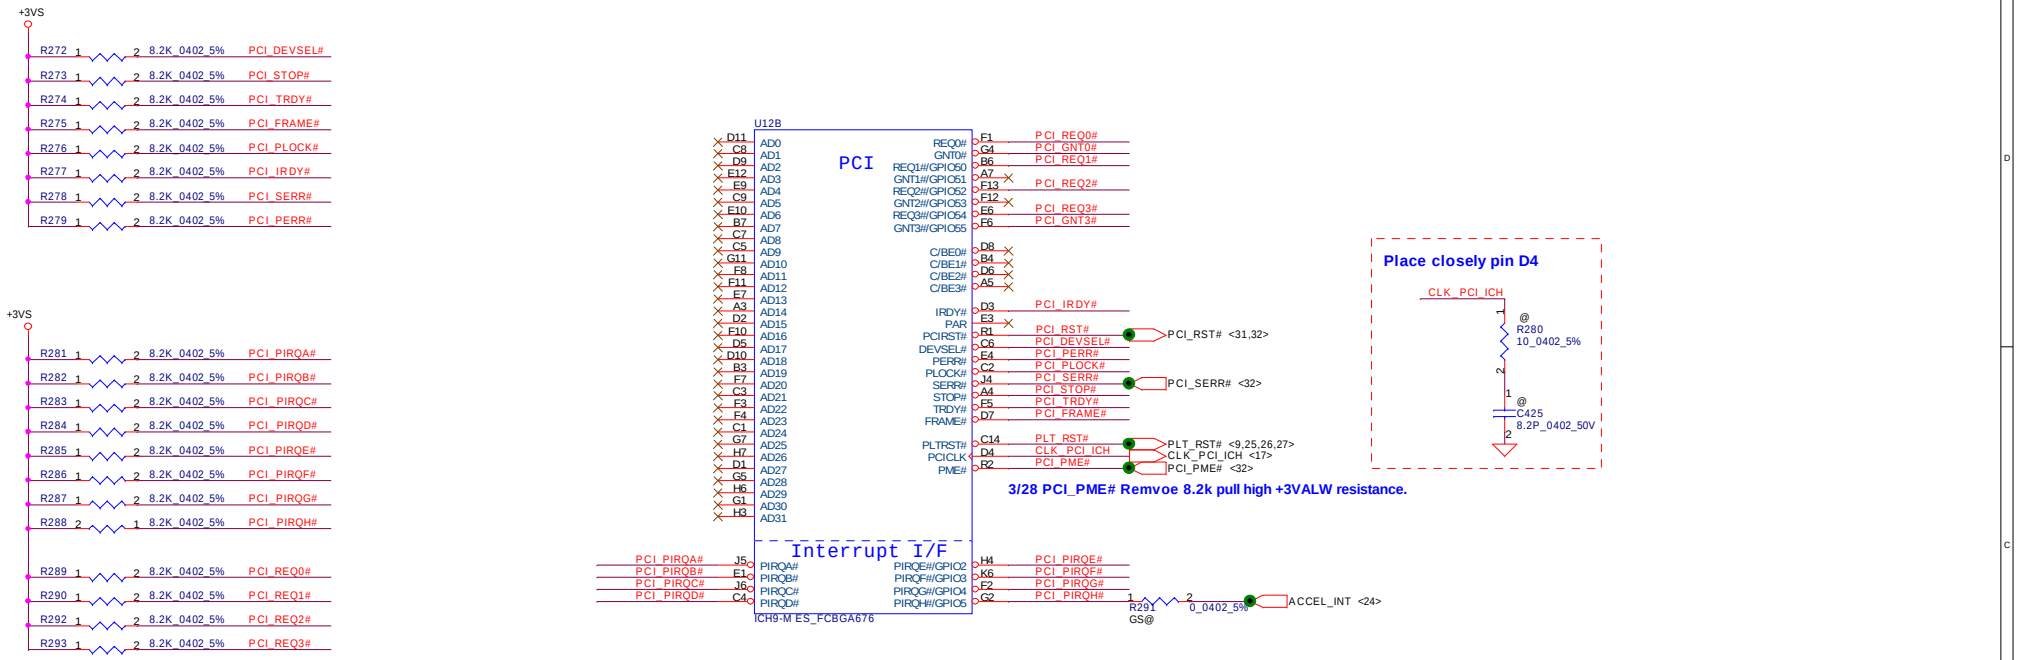

A16 swap override Strap

PCI_GNT3#	Low= A16 swap override Enble High= Default *



Boot BIOS Strap

PCI_GNT0#	SPI_CS#1	Boot BIOS Location
0	1	SPI
1	0	PCI
1	1	LPC *

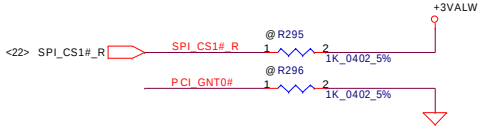

Security Classification	Compal Secret Data		
Issued Date	2007/08/28	Deciphered Date	2006/03/10

Compal Electronics, Inc.	
Title	ICH9(1/4)-PCI/INT
Size	Document Number: Montevina Blade UMA LA4101P
Rev	0.3
Date: Saturday, January 05, 2008	Sheet 20 of 46

ICH8M Internal VR Enable Strap
(Internal VR for VccSus1.05, VccSus1.5, VccCL1.5)

ICH_INTVRMEN	Low = Internal VR Disabled High = Internal VR Enabled(Default)

ICH8M LAN100 SLP Strap
(Internal VR for VccLAN1.05 and VccCL1.05)

ICH_LAN100_SLP	Low = Internal VR Disabled High = Internal VR Enabled(Default)

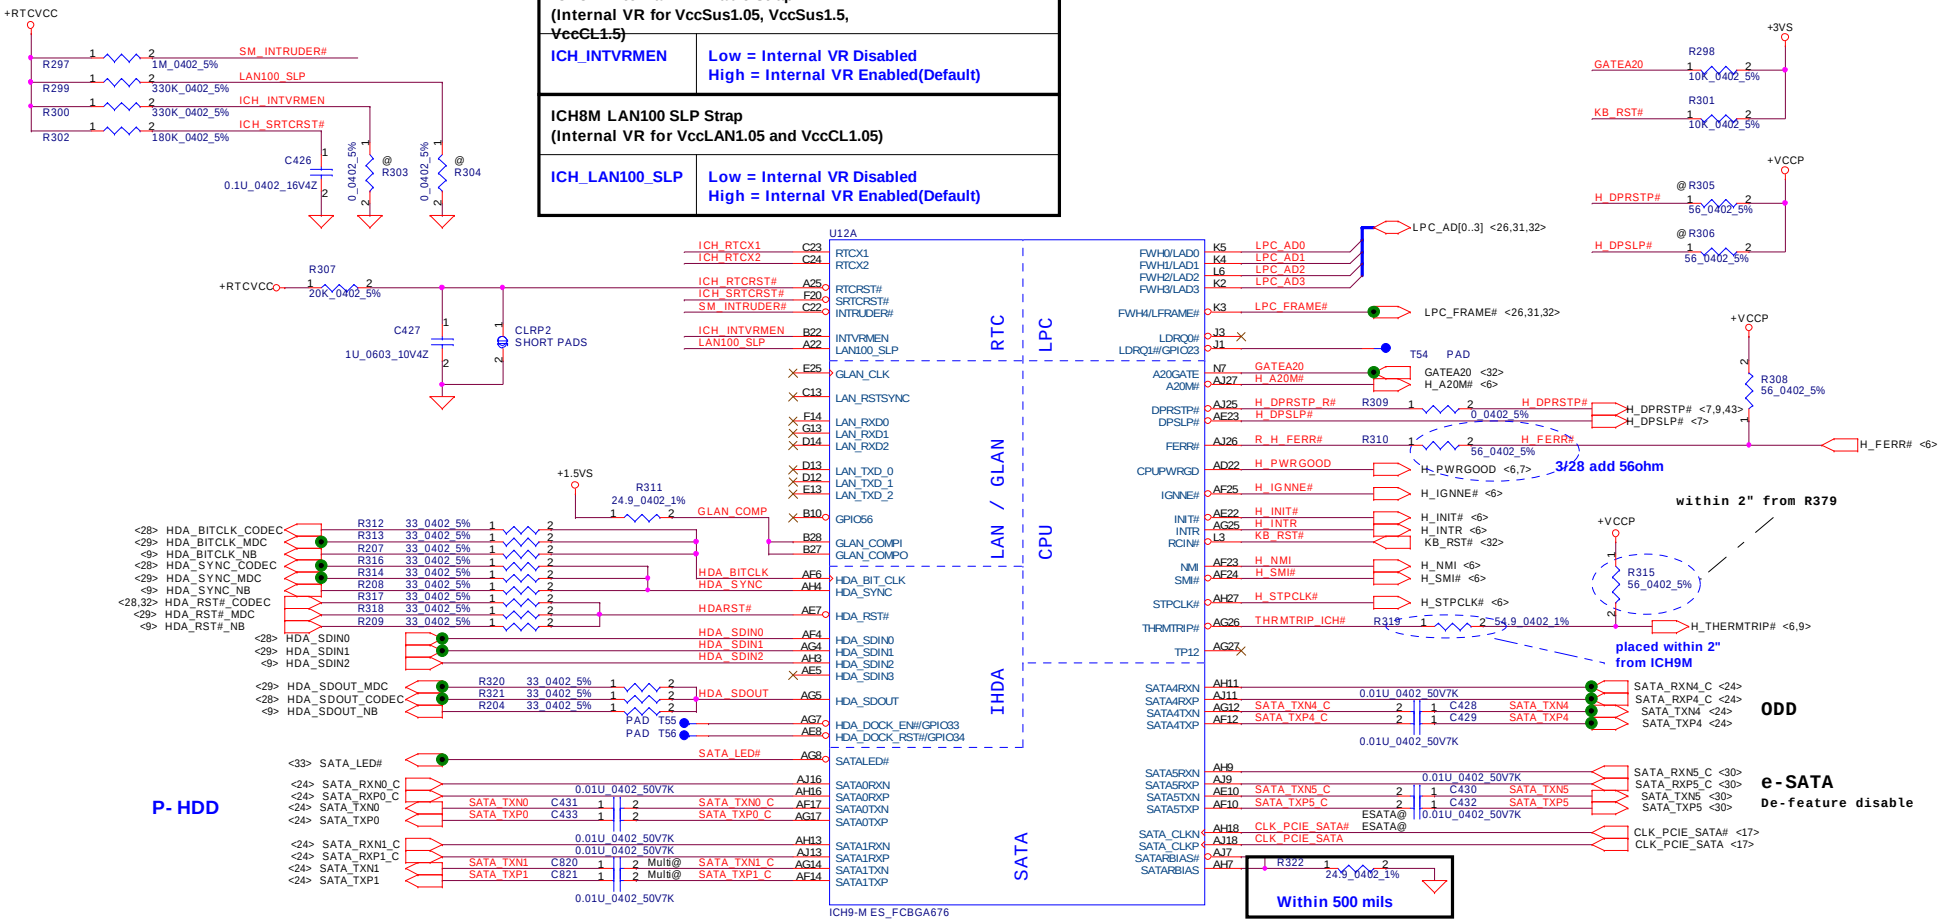

XOR CHAIN ENTRANCE STRAP:RSVD

ICH_RSVD	HDA_SDOUT_CODEC	
0	0	
0	1	
1	0	
1	1	

Security Classification	Compal Secret Data		
Issued Date	2007/08/28	Deciphered Date	2006/03/10

Title	Compal Electronics, Inc.		
	ICH9(2/4)_LAN,HD,IDE,LPC		
Size: Custom	Document Number: Montevina Blade UMA LA4101P		Rev: 0.3
Date: Saturday, January 05, 2008	Sheet 21 of 46		

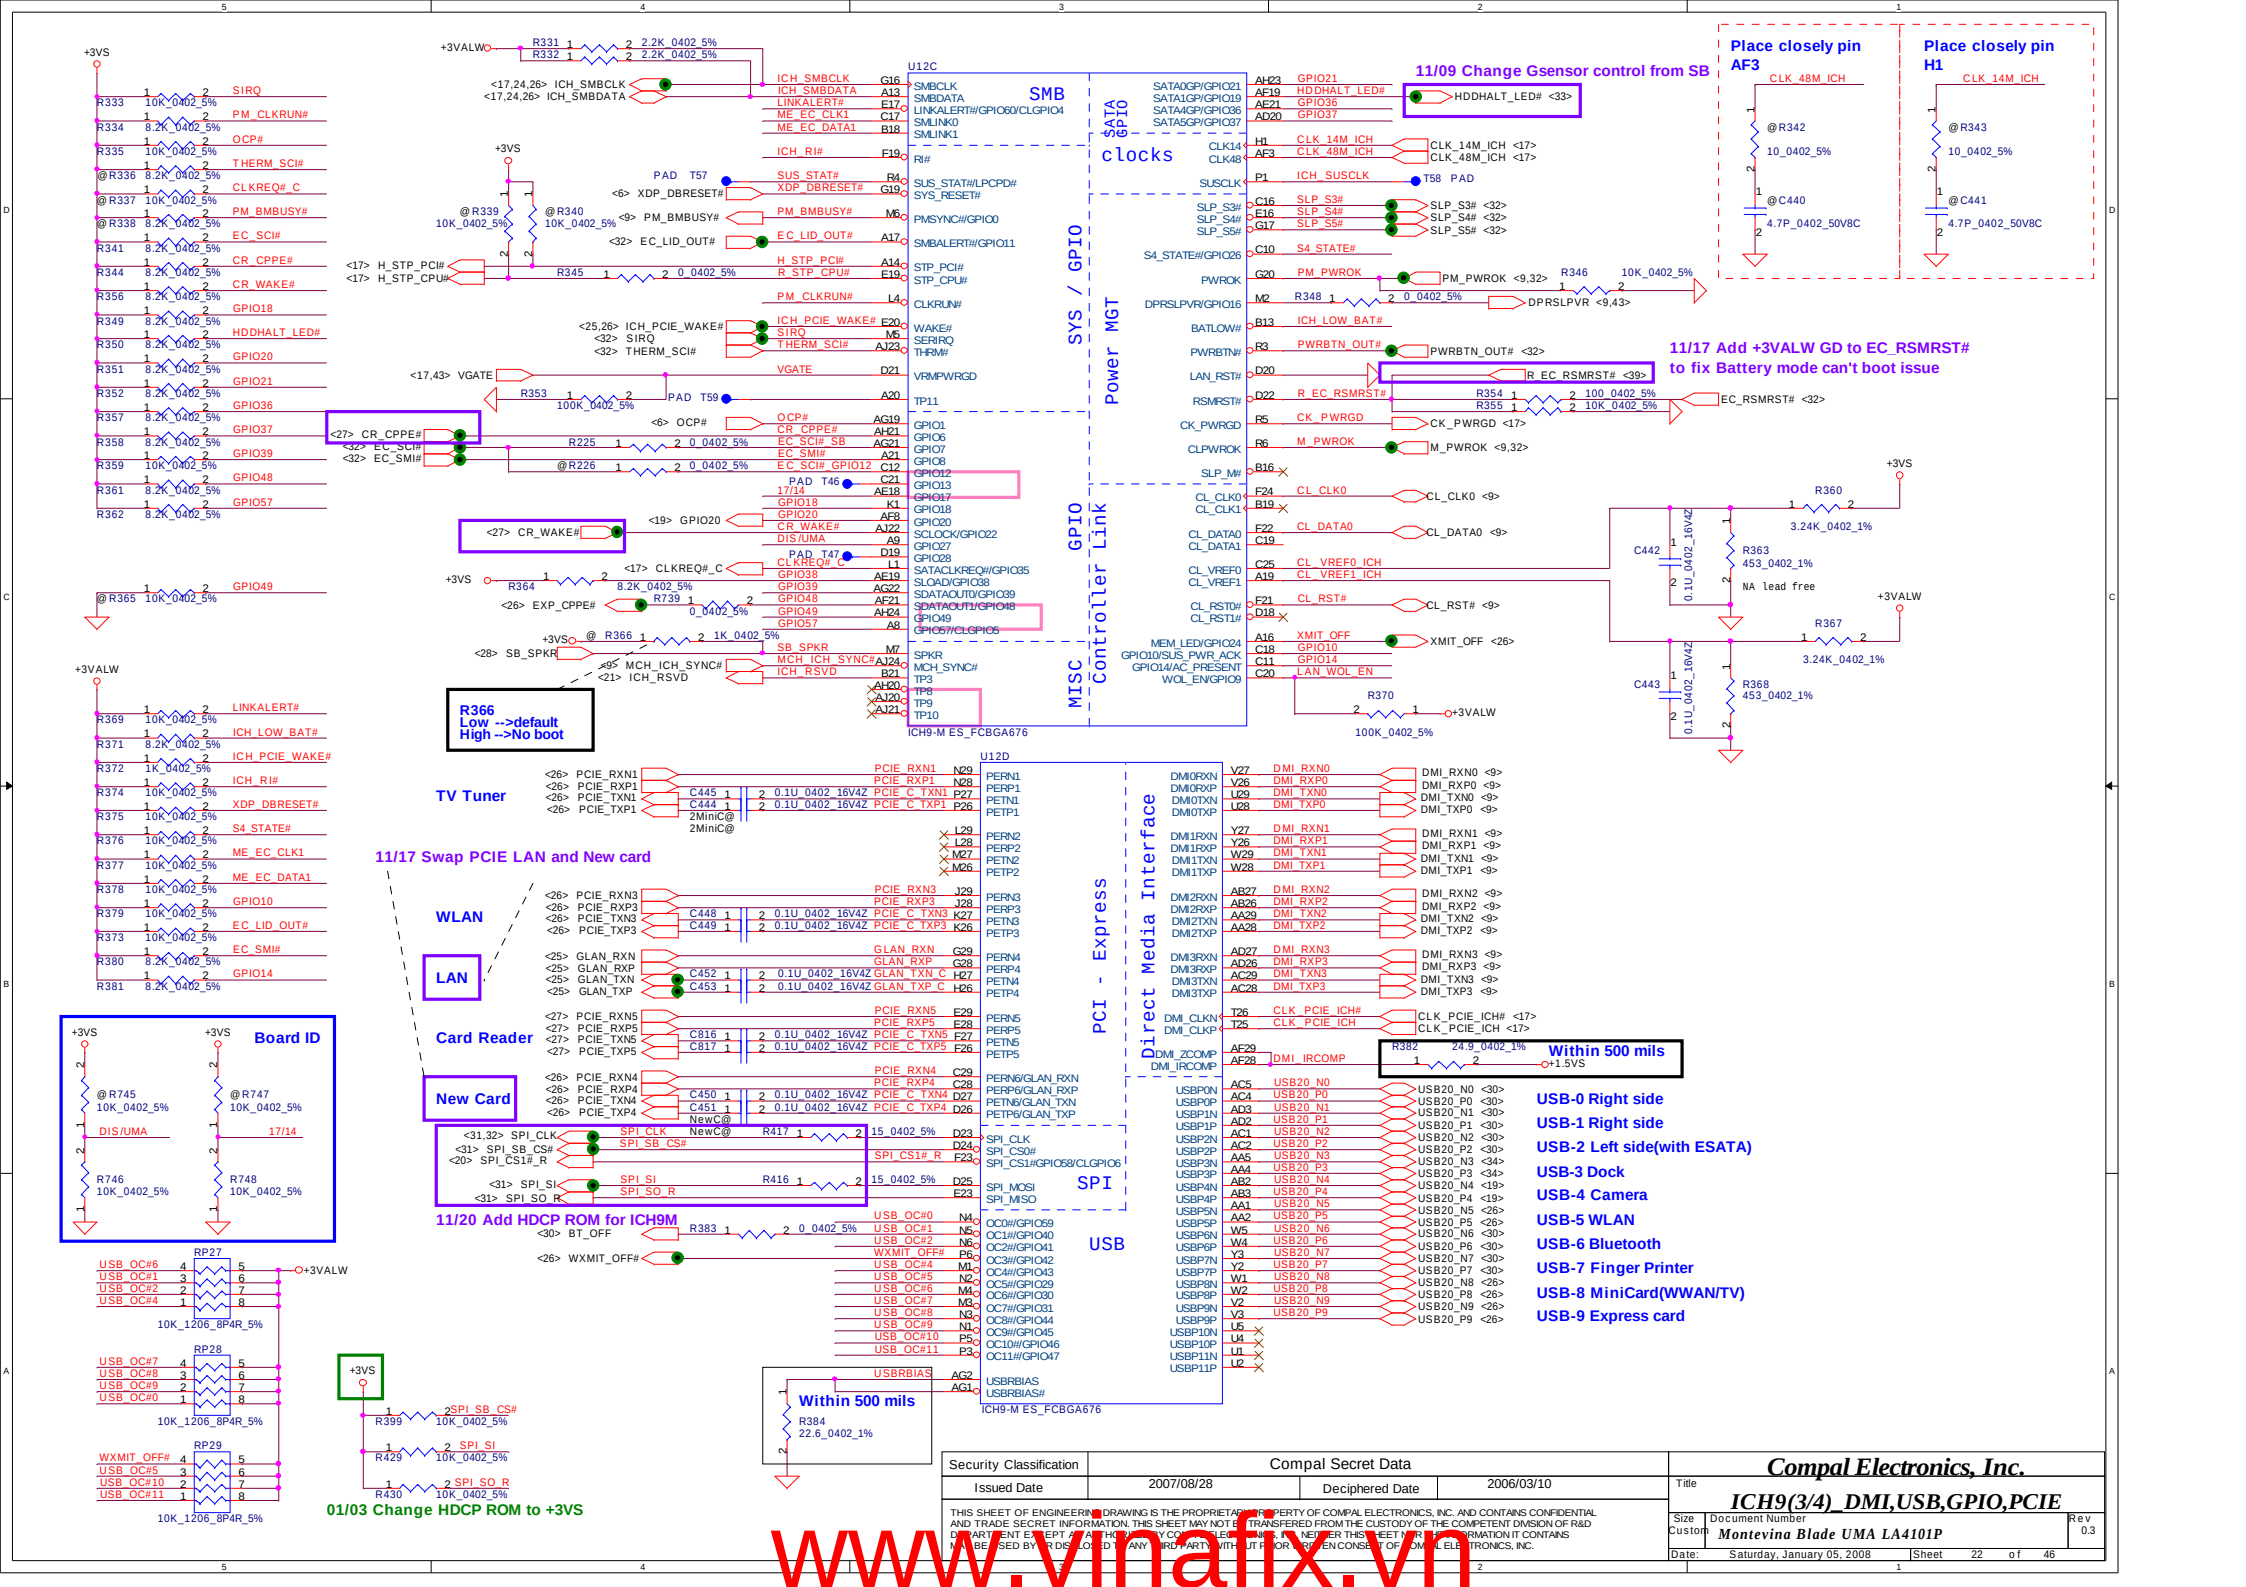

Security Classification	Compal Secret Data		
Issued Date	2007/08/28	Deciphered Date	2006/03/10

Compal Electronics, Inc.

Title: ICH9(3/4)_DMI,USB,GPIO,PCIE

Size	Document Number	Rev
Custom	Montevina Blade UMA LA4101P	0.3

Date: Saturday, January 05, 2008 Sheet 22 of 46

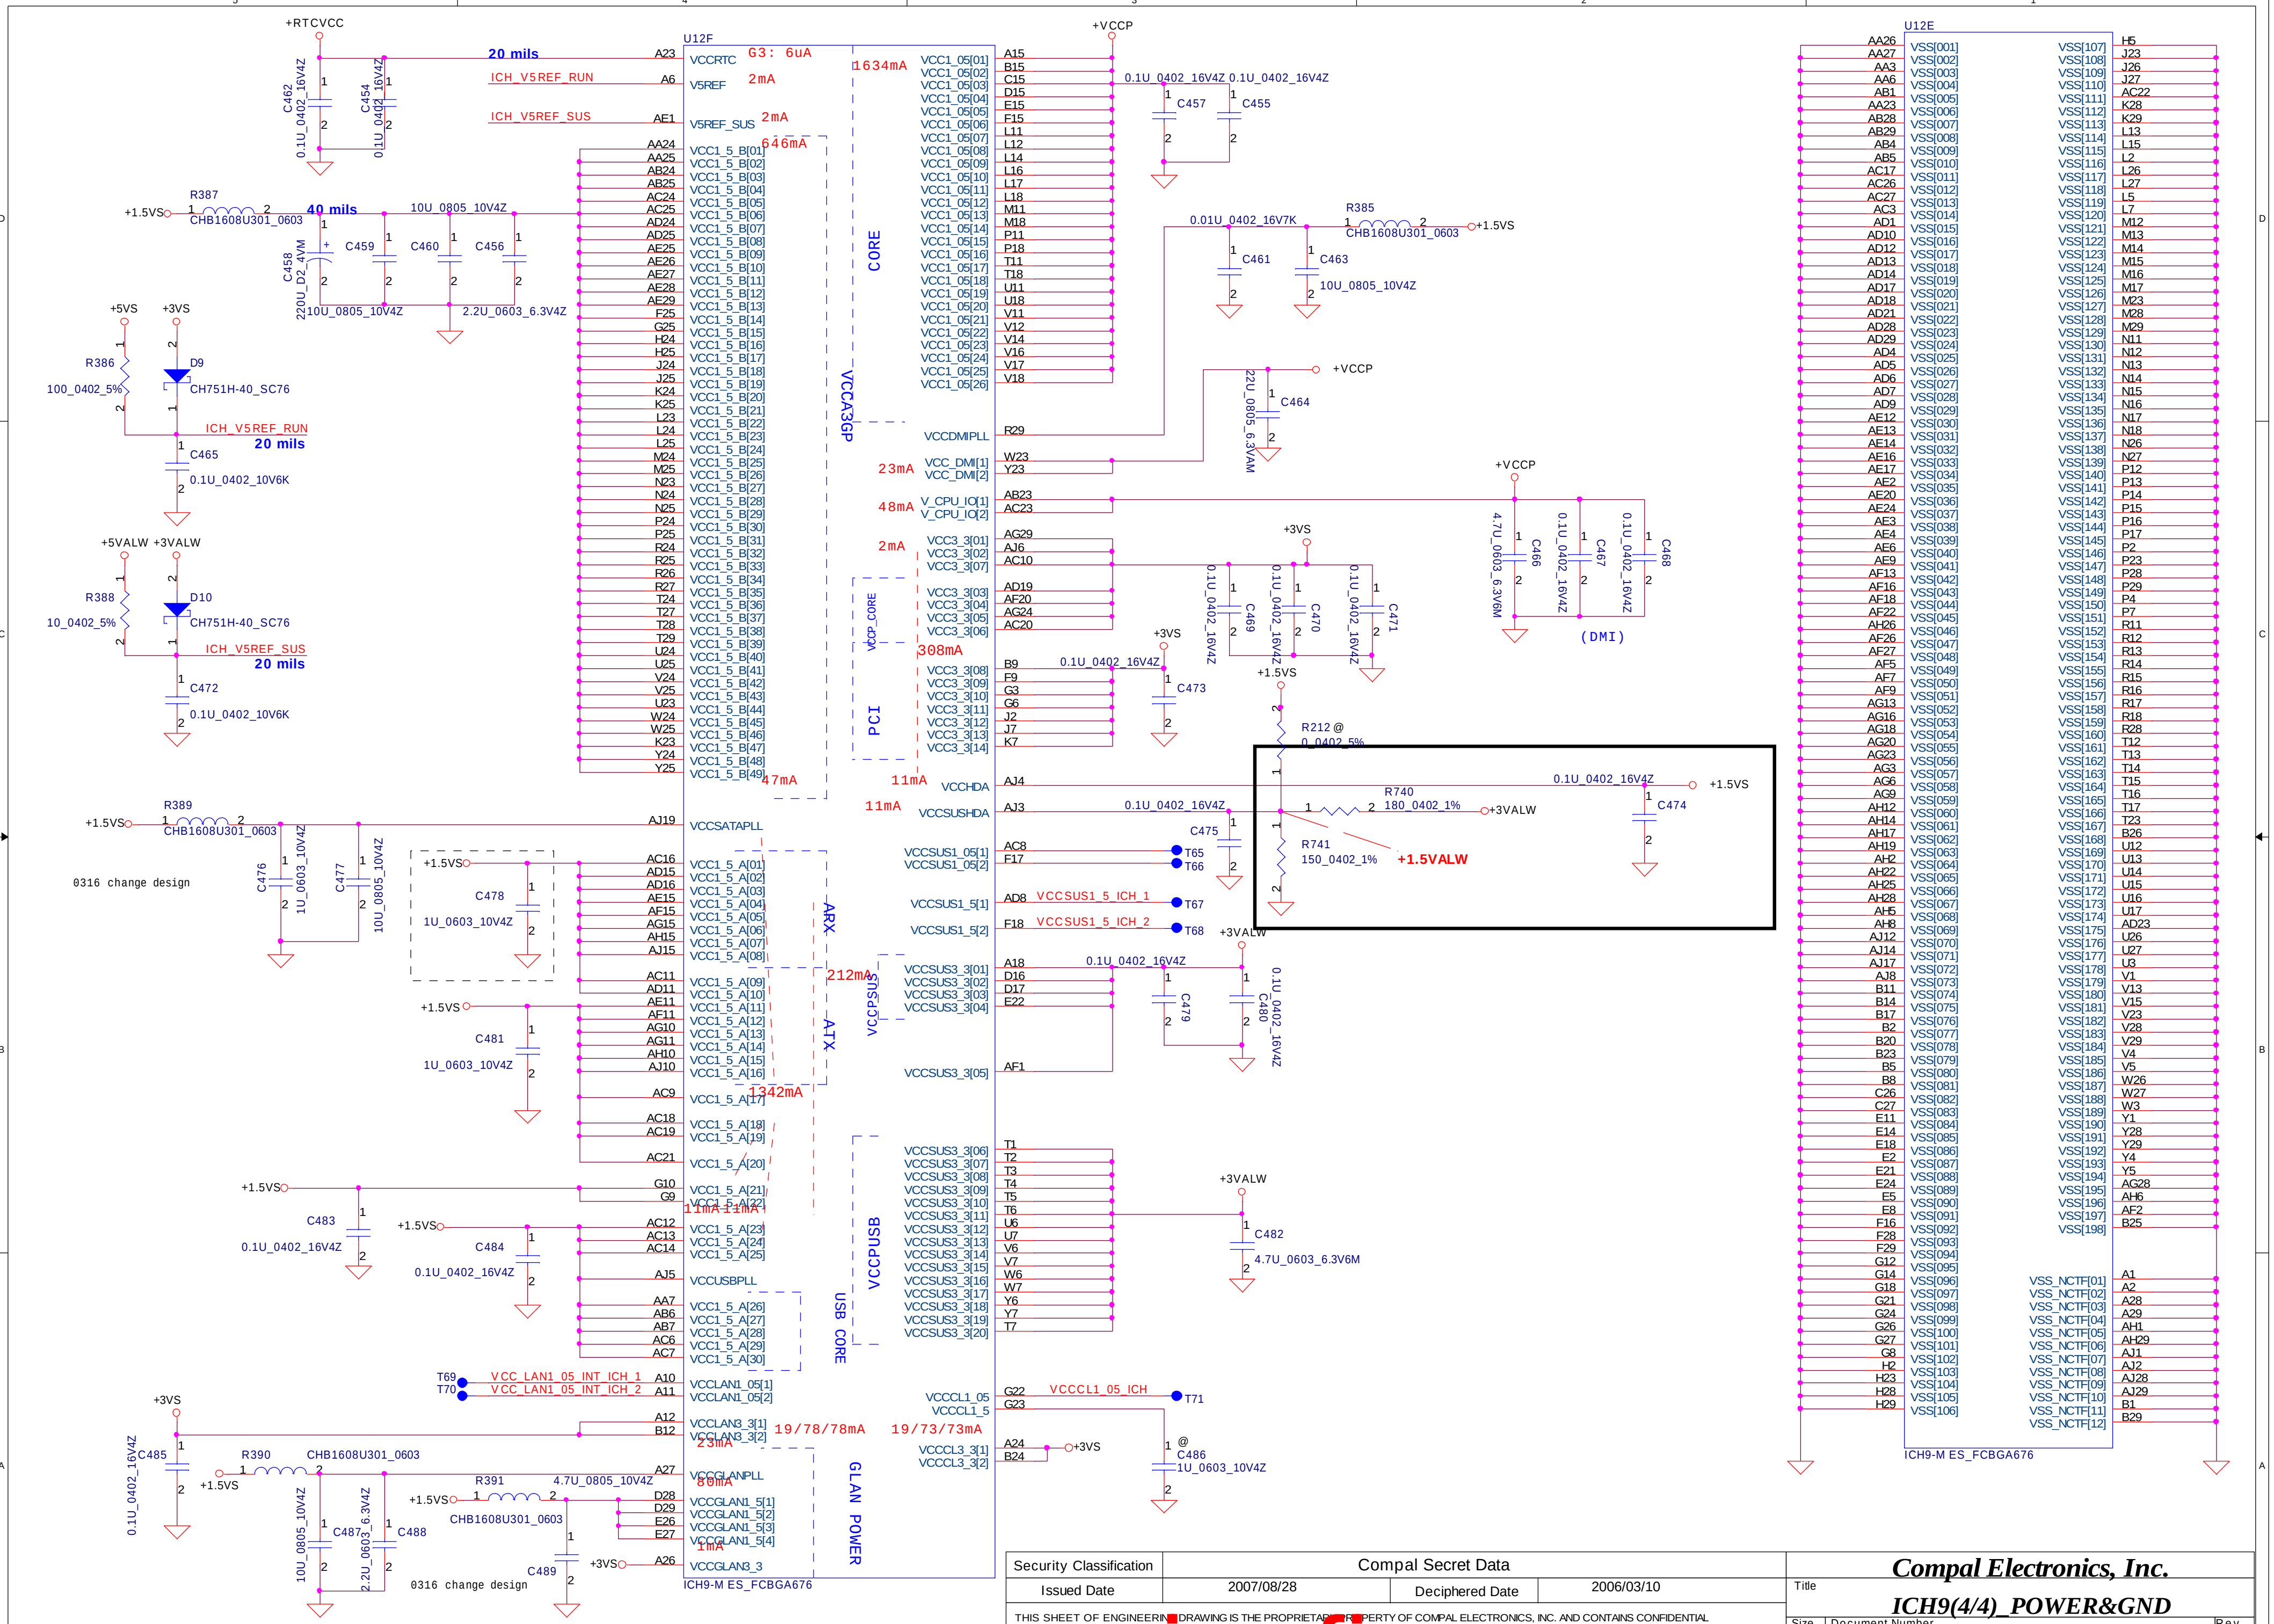
U12F
VCCRTC G3: 6uA
V5REF 2mA
V5REF_SUS 2mA
+RTCVCC
20 mils
ICH_V5REF_RUN
ICH_V5REF_SUS
C462 0.1U_0402_16V4Z
C454 0.1U_0402_16V4Z
R387 CHB1608U301_0603
+1.5VS
40 mils
C458 220U_D2_4VM
C459 10U_0805_10V4Z
C460 10U_0805_10V4Z
C456 2.2U_0603_6.3V4Z
+5VS +3VS
R386 100_0402_5%
D9 CH751H-40_SC76
C465 0.1U_0402_10V6K
+5VALW +3VALW
R388 10_0402_5%
D10 CH751H-40_SC76
C472 0.1U_0402_10V6K
646mA
VCC1_5_B[01] … VCC1_5_B[49]
47mA
VCCA3GP
1634mA
VCC1_05[01] … VCC1_05[26]
CORE
+VCCP
C457 0.1U_0402_16V4Z
C455 0.1U_0402_16V4Z
R385 CHB1608U301_0603
C461 0.01U_0402_16V7K
C463 10U_0805_10V4Z
VCCDMIPLL
C464 22U_0805_6.3VAM
23mA VCC_DMI[1] VCC_DMI[2]
48mA V_CPU_IO[1] V_CPU_IO[2]
C466 4.7U_0603_6.3V6M
C467 0.1U_0402_16V4Z
C468 0.1U_0402_16V4Z
(DMI)
2mA VCC3_3[01] VCC3_3[02] VCC3_3[07]
VCCP_CORE
VCC3_3[03] … VCC3_3[06]
C469 C470 C471 0.1U_0402_16V4Z
308mA
PCI
VCC3_3[08] … VCC3_3[14]
C473 0.1U_0402_16V4Z
11mA VCCHDA
11mA VCCSUSHDA
R212 @ 0_0402_5%
R740 180_0402_1%
R741 150_0402_1%
+1.5VALW
C474 0.1U_0402_16V4Z
C475 0.1U_0402_16V4Z
R389 CHB1608U301_0603
VCCSATAPLL
C476 1U_0603_10V4Z
C477 10U_0805_10V4Z
0316 change design
C478 1U_0603_10V4Z
C481 1U_0603_10V4Z
VCC1_5_A[01] … VCC1_5_A[30]
ARX
ATX
212mA
1342mA
C483 0.1U_0402_16V4Z
C484 0.1U_0402_16V4Z
11mA 11mA
VCCUSBPLL
USB CORE
VCCSUS1_05[1] VCCSUS1_05[2] T65 T66
VCCSUS1_5[1] VCCSUS1_5_ICH_1 T67
VCCSUS1_5[2] VCCSUS1_5_ICH_2 T68
VCCSUS3_3[01] … VCCSUS3_3[20]
VCCPSUS
C479 C480 0.1U_0402_16V4Z
VCCPUSB
C482 4.7U_0603_6.3V6M
T69 T70 VCC_LAN1_05_INT_ICH_1 VCC_LAN1_05_INT_ICH_2
VCCLAN1_05[1] VCCLAN1_05[2]
VCCLAN3_3[1] VCCLAN3_3[2] 19/78/78mA 23mA
VCCCL1_05 VCCCL1_5 VCCCL1_05_ICH T71 19/73/73mA
VCCCL3_3[1] VCCCL3_3[2]
C486 @ 1U_0603_10V4Z
C485 0.1U_0402_16V4Z
R390 CHB1608U301_0603
C487 10U_0805_10V4Z
C488 2.2U_0603_6.3V4Z
R391 CHB1608U301_0603 4.7U_0805_10V4Z
C489
VCCGLANPLL 80mA
VCCGLAN1_5[1] … VCCGLAN1_5[4] 1mA
VCCGLAN3_3
GLAN POWER
ICH9-M ES_FCBGA676
U12E
VSS[001] … VSS[198]
VSS_NCTF[01] … VSS_NCTF[12]
ICH9-M ES_FCBGA676

Security Classification	Compal Secret Data		
Issued Date	2007/08/28	Deciphered Date	2006/03/10

Compal Electronics, Inc.

Title: **ICH9(4/4)_POWER&GND**

Size: Custom | Document Number: Montevina Blade UMA LA4101P | Rev 0.3

Date: Saturday, January 05, 2008 | Sheet 23 of 46

HDD Connector

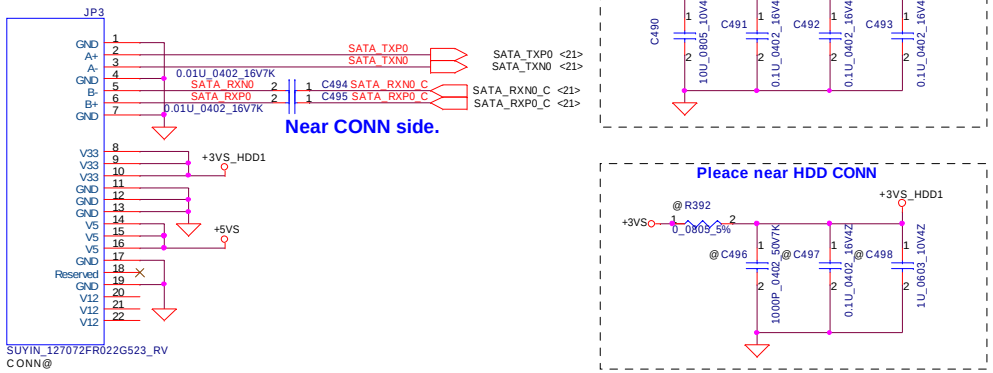

CD-ROM Connector

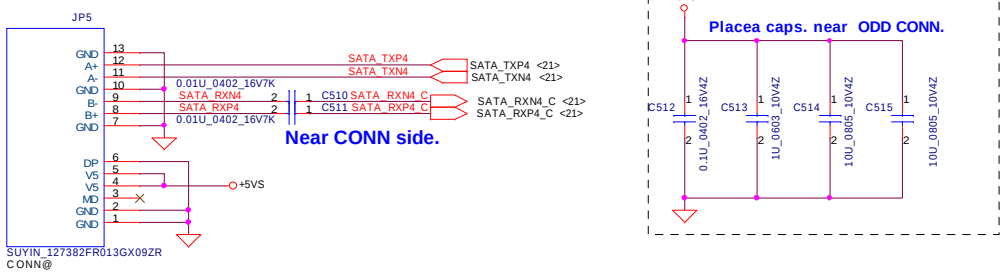

Multi Bay

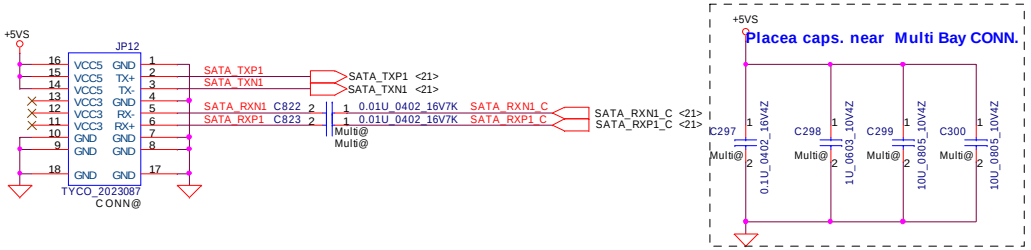

ACCELEROMETER (ST)

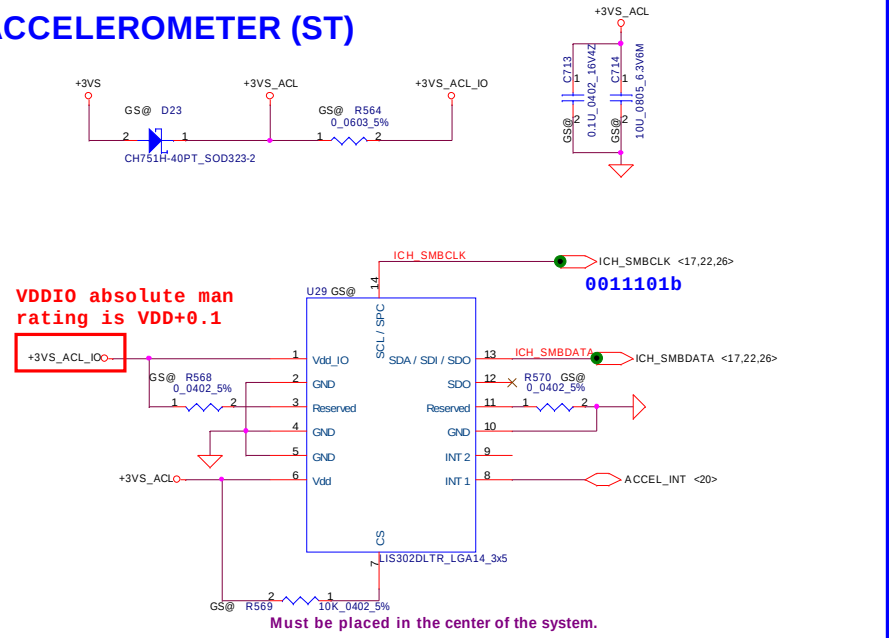

ACCELEROMETER (Bosch)

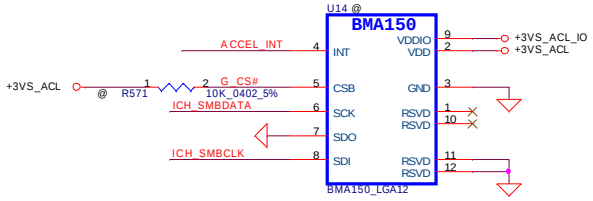

Security Classification	Compal Secret Data		
Issued Date	2007/08/28	Deciphered Date	2006/03/10

ZZZ2
PCI-E/B

Compal Electronics, Inc.

Title: HDD & CDROM

Size: Custom | Document Number: Montevina Blade UMA LA4101P | Rev: 0.3

Date: Saturday, January 05, 2008 | Sheet 24 of 46

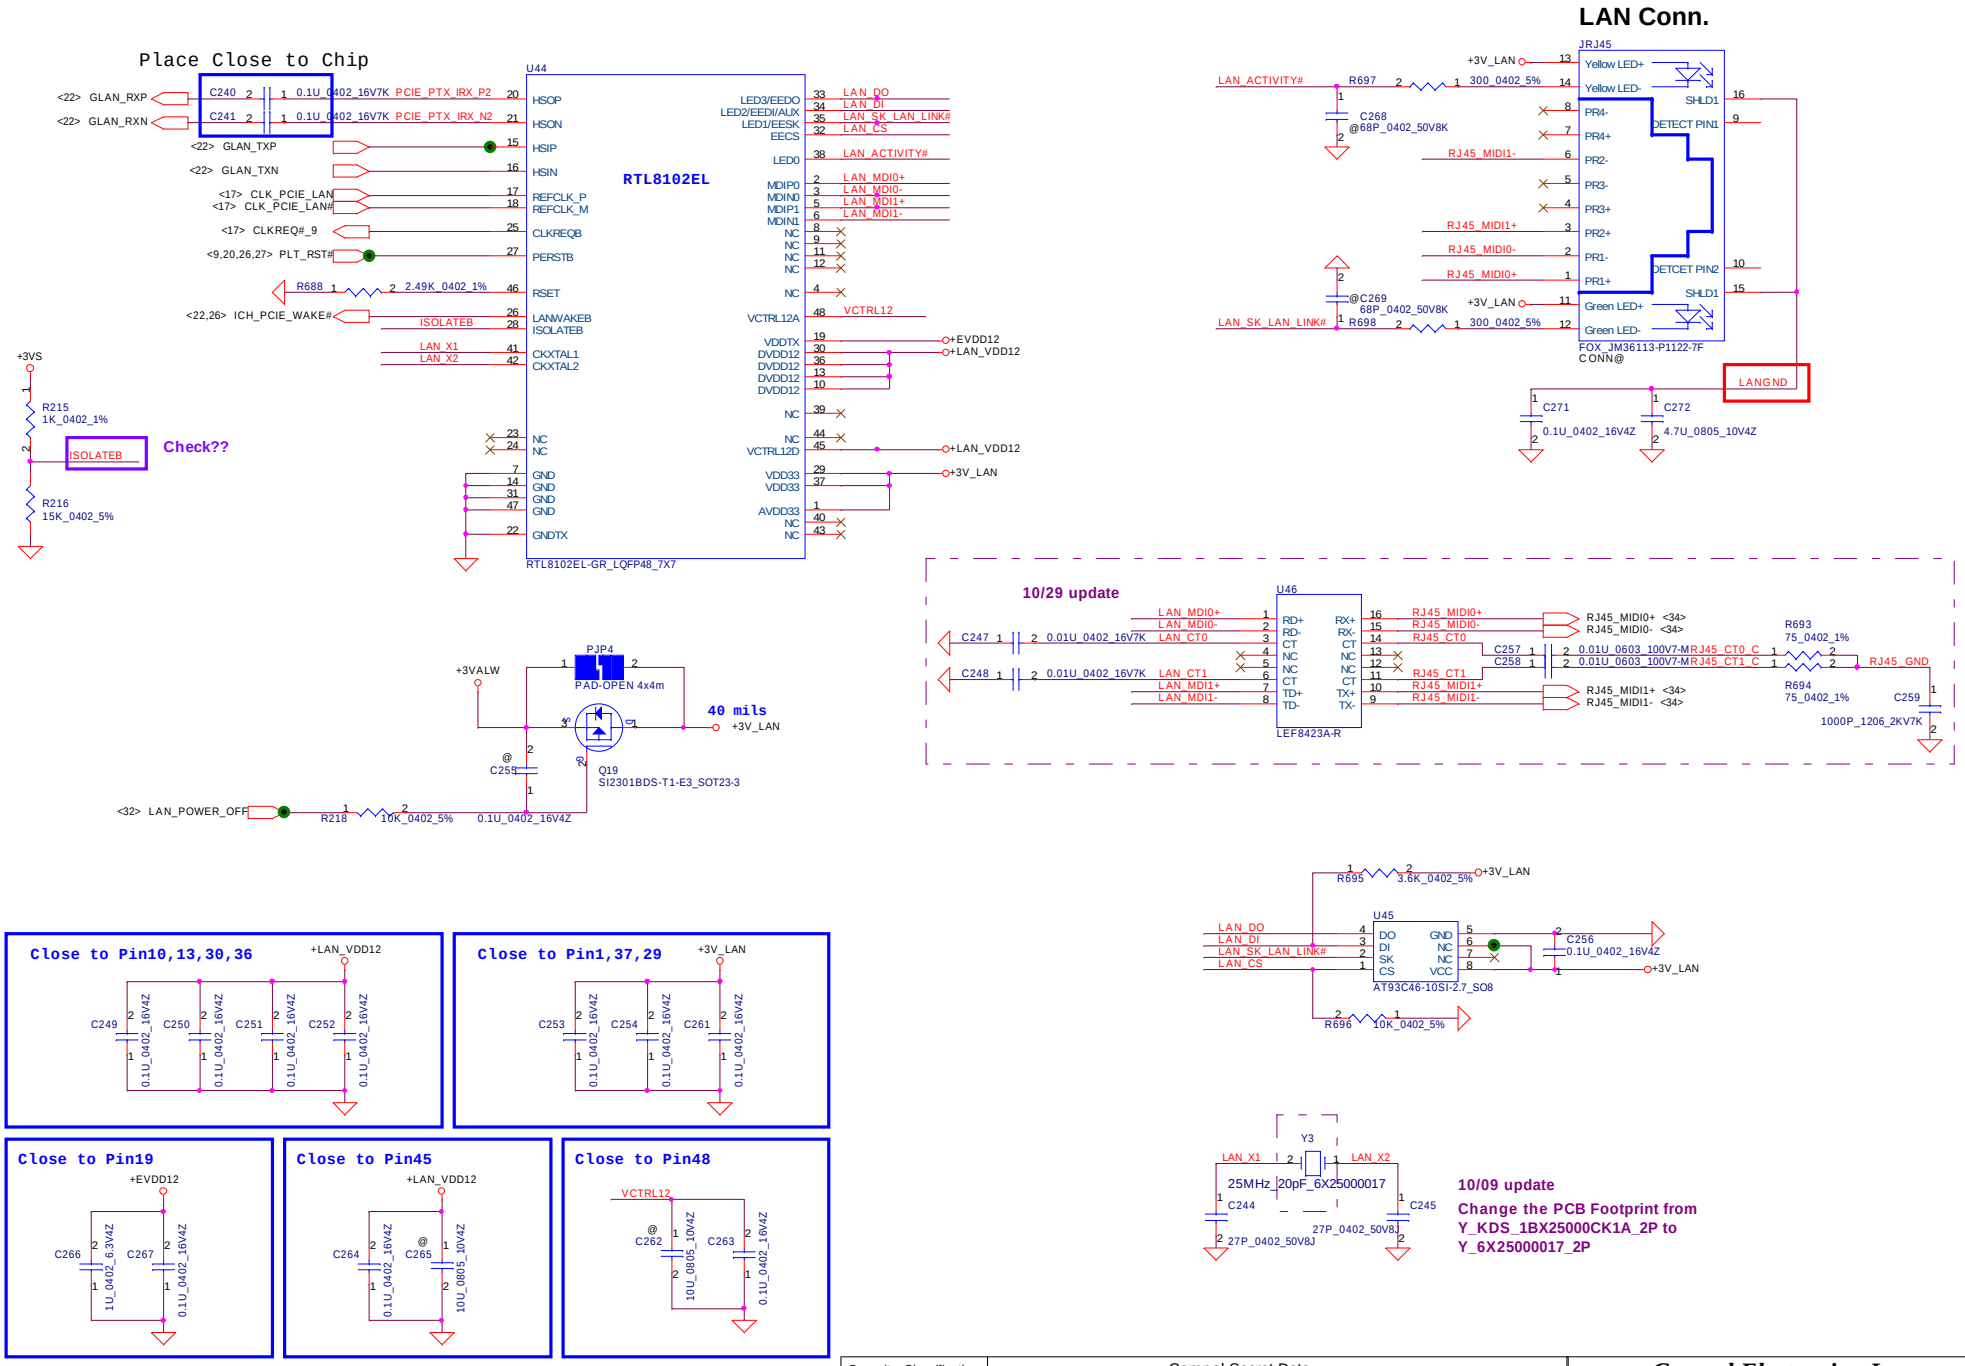

Mini Card 0--TV tuner/WWAN/Robson

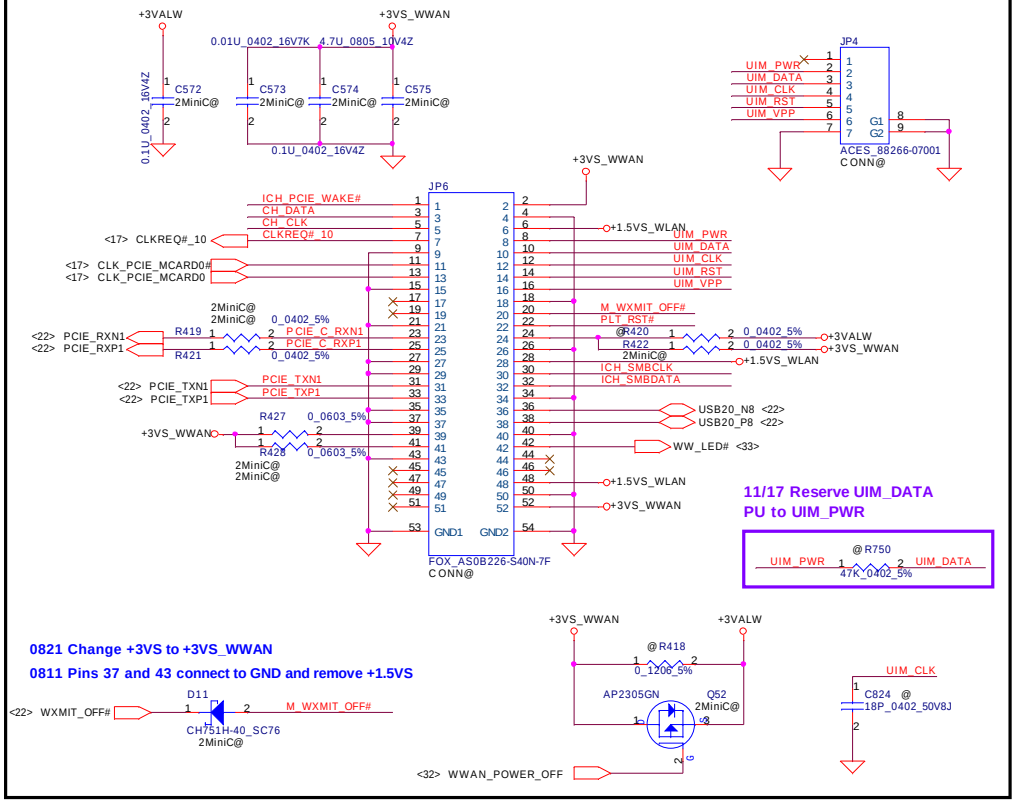

Mini Card 2---WLAN

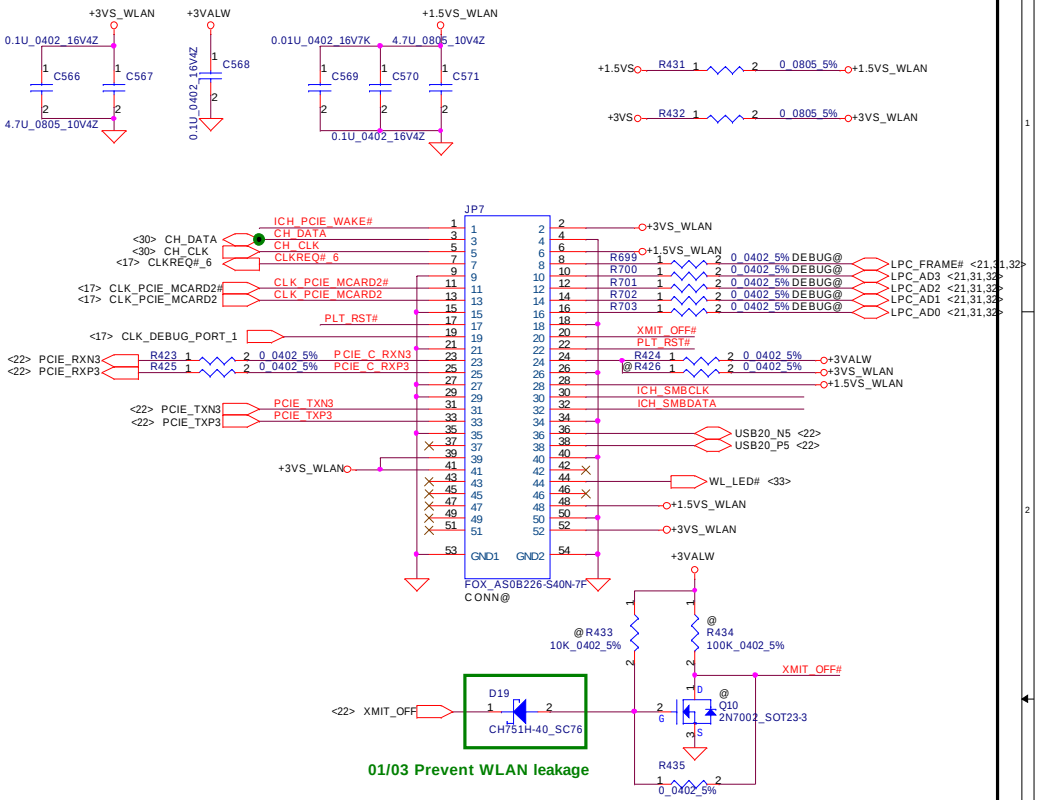

New Card

Express Card Power Switch

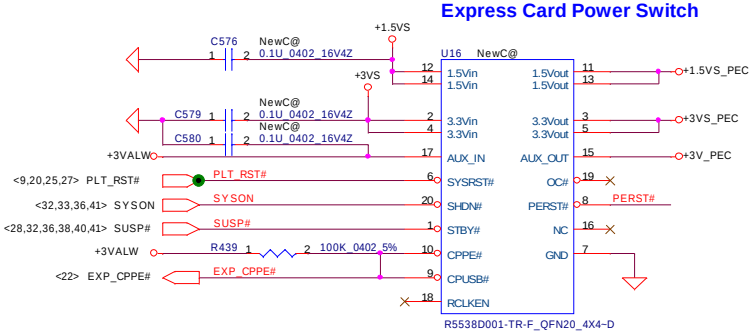

internal pull high to 3.3Vaux-in
EC need setting at Hi-Z & output Low

Close to JEXP

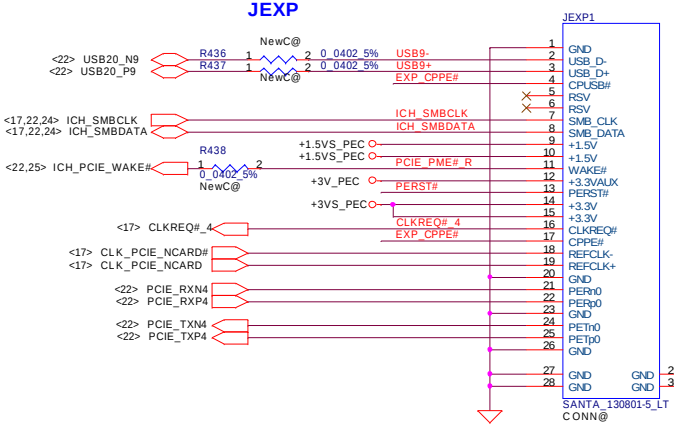

Near to Express Card slot.

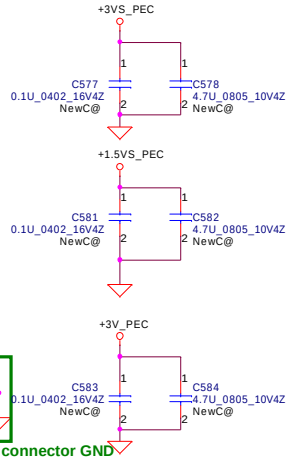

01/03 New card PTH connector GND

Security Classification	Compal Secret Data		
Issued Date	2007/08/28	Deciphered Date	2006/07/26

Compal Electronics, Inc.

Title: WLAN, WWAN, New Card

Size | Document Number: Montevina Blade UMA LA4101P | Rev: 0.3

Date: Saturday, January 05, 2008 | Sheet 26 of 46

09/26 (JMicron)recommend C1328/1000pF close to U36 pin5
09/26 (JMicron)recommend place C1329/0.1uF near by C1328
09/26 (JMicron)recommend (APVDD, 20 mil width, less than 120mil long)

09/26 (JMicron)recommend width/length: 12mil / <250mil for PREXT signal (pin 7)

11/07 Change to 10K(vender)

01/03 Change Cardreader LED control

09/26 (JMicron)recommend add a test point for pin 13、14

11/07 Change to 8.2K(vender)

11/09 Add D18 for cardreader wake up

use for PWR_EN#

8mA sink current

JMB385

JMB385-LGEZ0A_LQFP48_7X7

11/07 Stuff for JMB385 internal LDO

Use 0603 type and over 20 mils trace width on both side

09/26 (JMicron)recommend change to 0805 Size

09/26 (JMicron)recommend +VCC_OUT >30mil

reserved power circuit

11/07 Change U37 correct PCBFootprint SOT23

11/07 BOM delete for JMB385 internal LDO

09/26 Must change P mos FET

11/07 Don't stuff for JMB385 internal LDO

White LED: VF=3V, IF = 5mA, Res = 56ohm

11/09 don't support DIM function

01/03 Change Cardreader LED control

Card Reader Connector

7 IN 1 CONN

TAITW_R015-B10-LM

CONN@

11/17 Update CIS library

Security Classification	Compal Secret Data		
Issued Date	2007/08/28	Deciphered Date	2006/10/06

Compal Electronics, Inc.

Title: USB CardReader&CONN

Size: Custom | Document Number: Montevina Blade UMA LA4101P | Rev: 0.3

Date: Saturday, January 05, 2008 | Sheet 27 of 46

CODEC POWER

(4.75V(4.56~4.94V))
300mA

+1.5VS_HDA → R1051 BLM18BD601SN1D_0603 → +1.5VS
C1342 0.1U_0402_16V4Z

+3VS → R1052 BLM18BD601SN1D_0603 → +3VDD_CODEC
C1337 1U_0603_10V4Z
C1338 0.1U_0402_16V4Z

+VDDA_CODEC_R → R1053 0_0805_5% → +VDDA_CODEC
C1339 0.1U_0402_16V4Z
C1340 1U_0603_10V4Z

W=40Mil
+5VALW → C1341 0.1U_0402_16V4Z → U39 IN
<26,32,36,38,40,41> SUSP# → U39 SHDN
U39 GND
U39 OUT → +VDDA_CODEC
U39 BYP → C1344 0.1U_0402_16V4Z
C1343 2.2U_0805_16V4Z
U39: G9191-475T1U_SOT23-5

11/07 Change to 4.75V LDO

U38 92HD71B7X5NLGXA1X8_QFN48_7X7

Pin	Signal	Net
9	DVDD_CORE*	+3VDD_CODEC
1	DVDD_CORE	
25	AVDD1*	+VDDA_CODEC_R
38	AVDD2**	
3	DVDD_IO	+1.5VS_HDA
32	MONO_OUT	
6	BITCLK	<21> HDA_BITCLK_CODEC
5	SDO	<21> HDA_SDOUT_CODEC
8	SDI_CODEC	<21> HDA_SDIN0 via R1055 2 HDA_SDIN0_CODEC 33_0402_5%
10	SYNC	<21> HDA_SYNC_CODEC
11	RESET#	<21,32> HDA_RST#_CODEC
46	DMIC_CLK	<19> DMIC_CLK via R1058 22_0402_5%
33	CAP2	C1347 1U_0603_10V4Z
12	PCBEEP	MONO_INR via C1348 0.1U_0402_16V4Z
40	NC / OTP	
34	SENSE_B / NC	<34> SENSE_B# via R1062 5.1K_0402_1% + R1063 39.2K_0402_1%
37	NC	
18	NC	
19	NC	
20	NC	
27	VREFFILT	C1355 10U_0805_10V4Z, VC_REFA
26	AVSS1*	
42	AVSS2**	
7	DVSS**	
47	EAPD/ SPDIF OUT 0 or 1 / GPIO 0	EAPD_CODEC → EAPD_CODEC <32>
2	VOL_UP/DMIC_0/GPIO 1	DMIC_DAT <19>
4	VOL_DN/DMIC_1/GPIO 2	
30	GPIO 3	
31	VREFOUT-E / GPIO 4	
43	GPIO 5	
44	GPIO 6	
45	SPDIF OUT1 / GPIO 7	SPDIF_OUT → SPDIF_OUT <34>
48	SPDIF OUT0	
28	VREFOUT_B	VREFOUT_B <29>
29	VREFOUT-C	
13	SENSE_A	SENSE
41	PORTA_R	HP_OUTR <29>
39	PORTA_L	HP_OUTL <29>
22	PORTB_R	MIC_EXTR via C1350 1U_0603_10V6K → MIC_EXT_R <29>
21	PORTB_L	MIC_EXTL via C1351 1U_0603_10V6K → MIC_EXT_L <29>
24	PORTC_R	MIC_INR
23	PORTC_L	MIC_INL
36	PORTD_R	LINE_OUT_R <29>
35	PORTD_L	LINE_OUT_L <29>
15	PORTE_R	DOCK_MICR via C1356 1U_0603_10V6K → DOCK_MICR_C → R733 10K_0402_5% → DOCK_MIC_R <34>
14	PORTE_L	DOCK_MICL via C1357 1U_0603_10V6K → DOCK_MICL_C → R734 10K_0402_5% → DOCK_MIC_L <34>
17	PORTF_R	
16	PORTF_L	

SENSE → R1056 5.1K_0402_1% + R1057 20K_0402_1% + R1059 39.2K_0402_1% + R683 10K_0402_1% + C1346 0.1U_0402_16V4Z
+VDDA_CODEC_R
EXTMIC_DET# <29>
JACK_DET# <29,34>
INTMIC_DET# <29>

11/07 Change R1059 39.2K

HP Jack & Dock

Jack MIC

MIC_IN_R <29> via C1352 0.022U_0402_16V7K
MIC_IN_L <29> via C1354 0.022U_0402_16V7K
@R1064 0_0603_5%

11/08 Change C1352、C1354 (recommend)

Internal MIC

Internal SPKR.

DOCK MIC

R735 1.21K_0402_1%
R736 1.21K_0402_1%
1/10*Vin need close to Codec

HDA_BITCLK_CODEC
@R1054 47_0402_5%
@C1345 33P_0402_50V8K

11/09 reserve EC_BEEP

<32> EC_BEEP → EC_BEEP → @R445 47K_0402_5%

<19> DMIC_CLK
<22> SB_SPKR
R1060 47K_0402_5%
R1061 10K_0402_5%
C1349 0.1U_0402_16V4Z

+VDDA_CODEC_R
<34> SENSE_B#
R1062 5.1K_0402_1%
R1063 39.2K_0402_1%
C1353 0.1U_0402_16V4Z

@C1358 0.1U_0402_16V4Z
@C1359 0.1U_0402_16V4Z
@C1360 0.1U_0402_16V4Z
@C1361 0.1U_0402_16V4Z
C1362 0_0402_5%
R1065 0_1206_5%
R596 0_1206_5%
GNDA <29,34>

GND GNDA

11/07 Stuff 0 Ohm for AGND and GND

SENSE A		SENSE B	
Port	Resistor	Port	Resistor
A	39.2K	E	39.2K
B	20K	F	20K
C	10K	G	10K
D	5.11K	H	5.11K

Security Classification	Compal Secret Data		
Issued Date	2007/08/28	Deciphered Date	2006/07/26

Title: Codec_IDT9271B7
Size: Custom
Document Number: Montevina Blade UMA LA4101P
Rev: 0.3
Date: Saturday, January 05, 2008
Sheet 28 of 46

GAIN0	GAIN1	Av(inv)
0	0	6dB
0	1	10dB
1	0	15.6dB
1	1	21.6dB

11/17 Change to15.6 dB

15.6 dB

SPEAKER

11/07Change JP60 PCB Footprint from ACES_85204-04001_4P to ACES_88231-04001_4P

8/31EMI request

Keep 10 mil width

12/18 Shut down pop noise

TPA6017A2_TSSOP20

11/07 Add 10K PU

Audio/B & CIR

HP OUT

HP OUT For Docking

11/07 Add Capacitor avoid DC lever to Docking audio

HP OUT For M/B

EXTMIC IN

INTMIC IN

MDC 1.5 Conn.

MDC Standoff

Connector for MDC Rev1.5

Security Classification	Compal Secret Data		
Issued Date	2007/08/28	Deciphered Date	2006/07/26

Title: AMP & Audio Jack

Size: Custom | Document Number: Montevina Blade UMA LA4101P | Rev: 0.3

Date: Saturday, January 05, 2008 | Sheet 29 of 46

Left side USB Connector

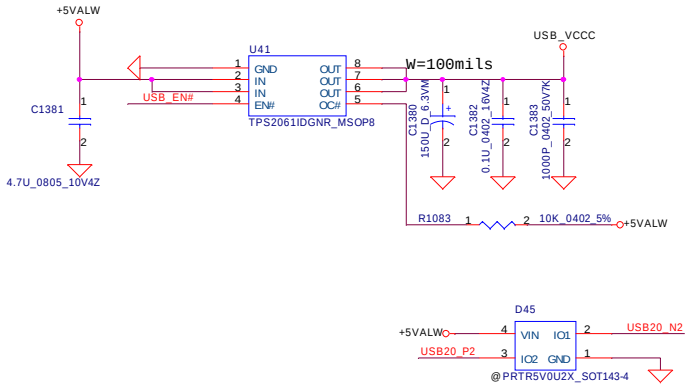

Left side ESATA/USB combination Connector

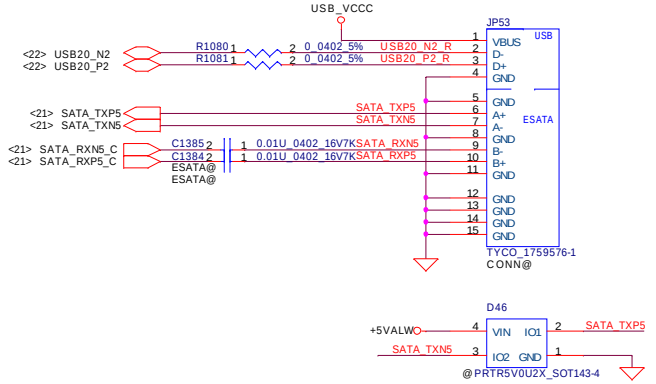

Finger printer

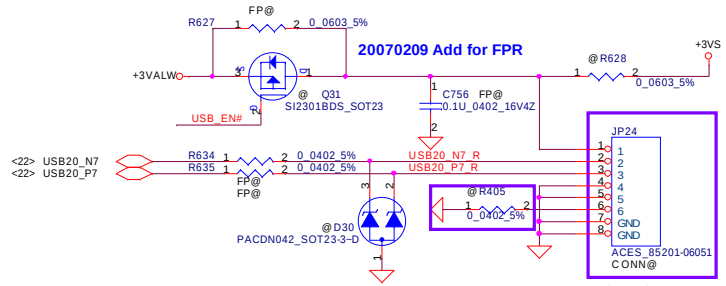

BT Connector

Need change to New version

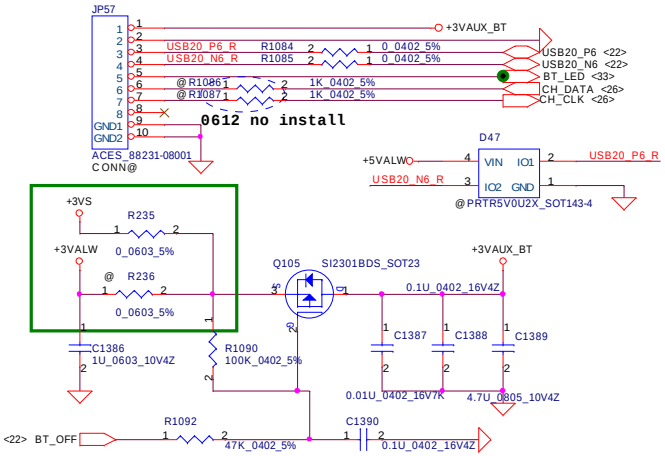

01/03 Change BT power to +3VS

USB cable connector for Right side

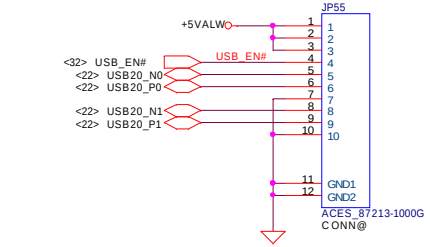

Security Classification	Compal Secret Data		
Issued Date	2007/08/28	Deciphered Date	2006/07/26

Compal Electronics, Inc.

Title: USB, BT, eSATA

Size | Document Number: Montevina Blade UMA LA4101P | Rev: 0.3

Date: Saturday, January 05, 2008 | Sheet 30 of 46

SPI ROM

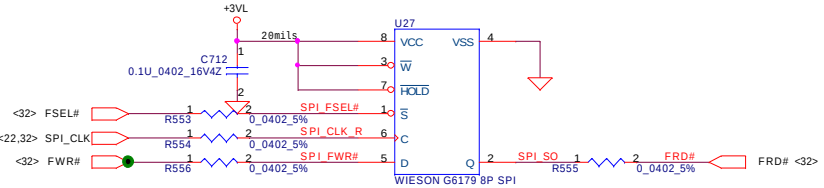

SP07000F500 S SOCKET WIESON G6179-100000 8P SPIFLASH
WIESO_G6179-100000_8P

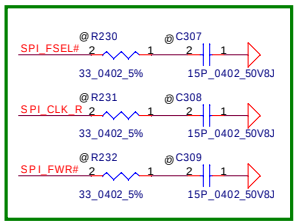

12/27EMI request

11/16 Change TO +3VALW

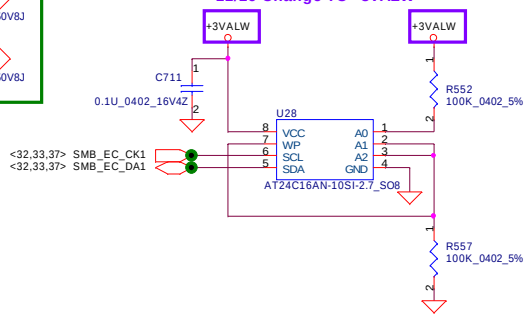

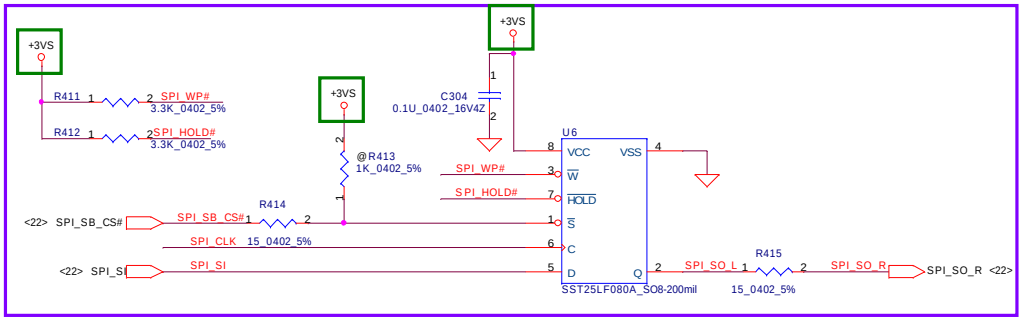

11/17 Add SB HDCP ROM

01/03 Change HDCP ROM to +3VS

LPC Debug Port

Change from +3VL to +3VS. 6/9
Removed +3VS. 6/13

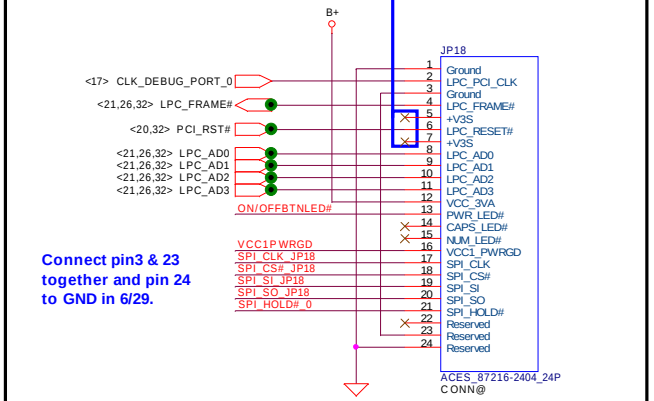

Connect pin3 & 23 together and pin 24 to GND in 6/29.

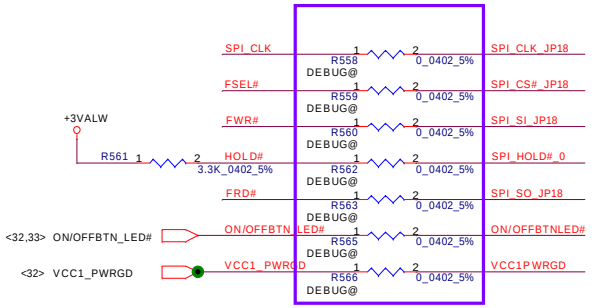

11/07 Add 0 Ohm for debug port

Security Classification	Compal Secret Data		
Issued Date	2007/08/28	Deciphered Date	2006/07/26

THIS SHEET OF ENGINEERING DRAWING IS THE PROPRIETARY PROPERTY OF COMPAL ELECTRONICS, INC. AND CONTAINS CONFIDENTIAL AND TRADE SECRET INFORMATION. THIS SHEET MAY NOT BE TRANSFERED FROM THE CUSTODY OF THE COMPETENT DIVISION OF R&D DEPARTMENT EXCEPT AS AUTHORIZED BY COMPAL ELECTRONICS, INC. NEITHER THIS SHEET NOR THE INFORMATION IT CONTAINS MAY BE USED BY OR DISCLOSED TO ANY THIRD PARTY WITHOUT PRIOR WRITTEN CONSENT OF COMPAL ELECTRONICS, INC.

Compal Electronics, Inc.

Title: BIOS ROM

Size | Document Number: Montevina Blade UMA LA4101P | Rev: 0.3

Date: Saturday, January 05, 2008 | Sheet 31 of 46

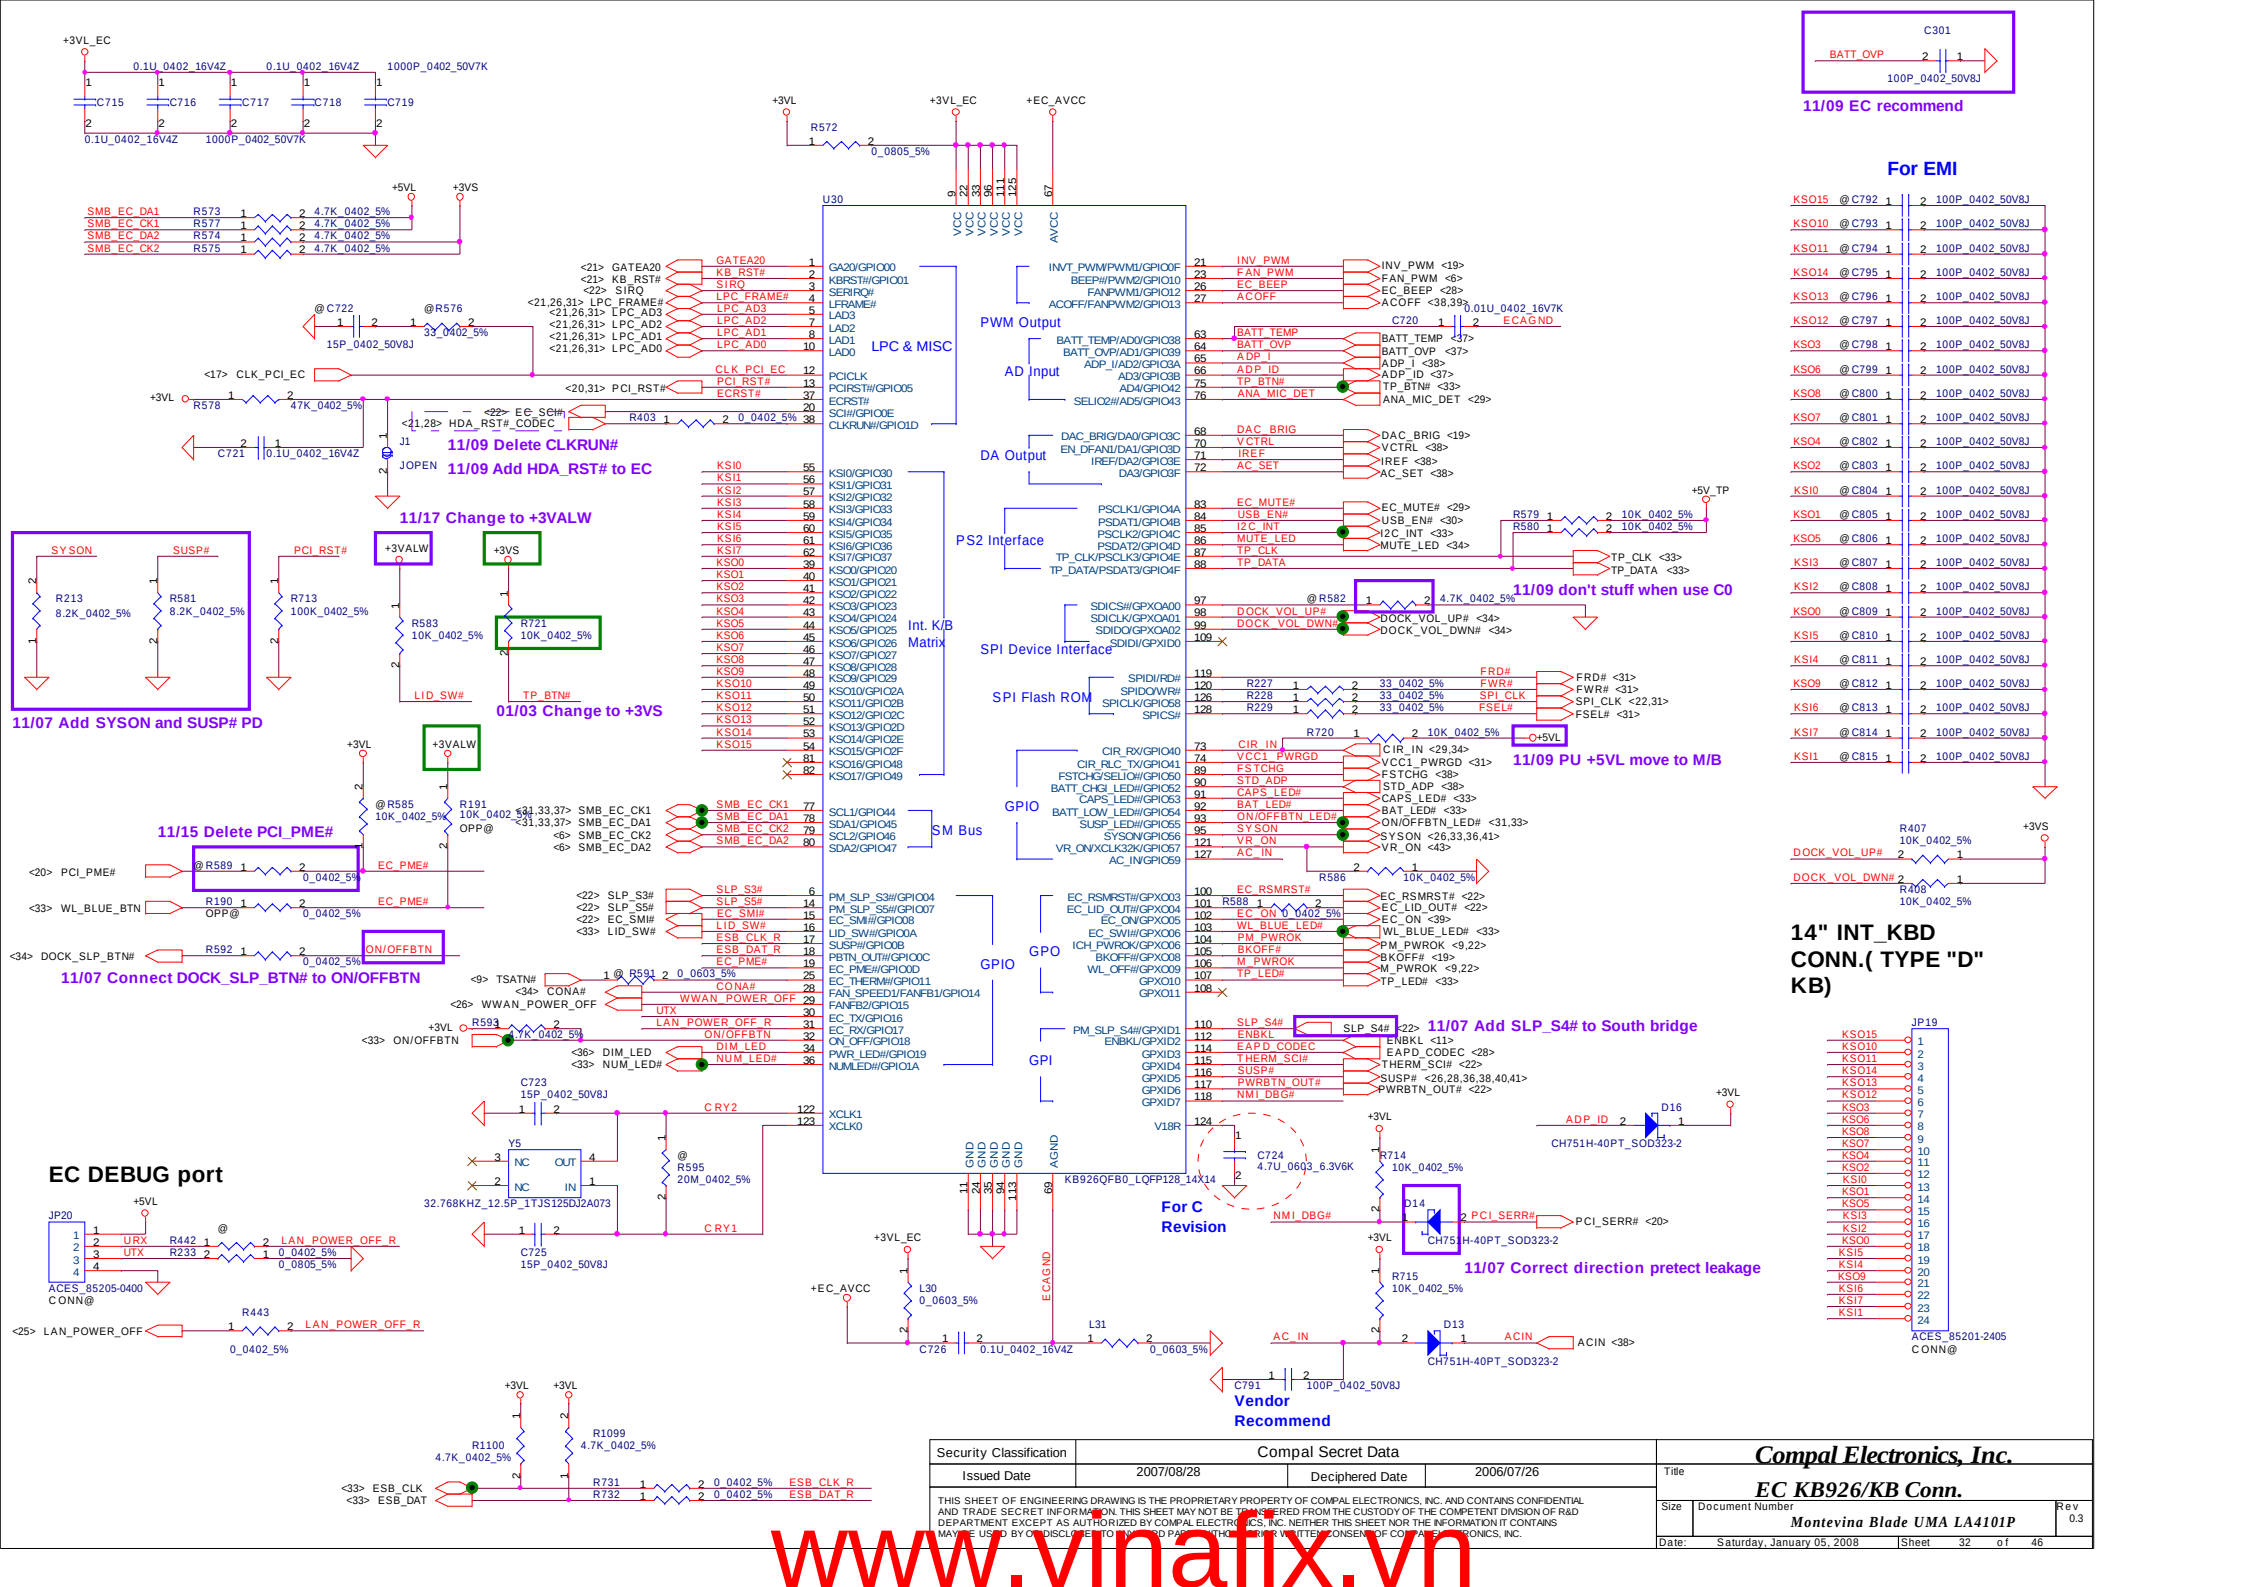

System LED

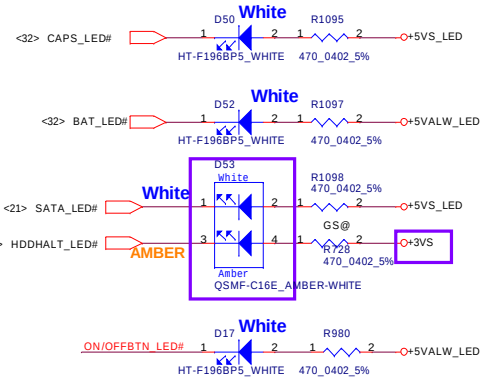

T/P Board (Inculde T/P_ON/OFF)

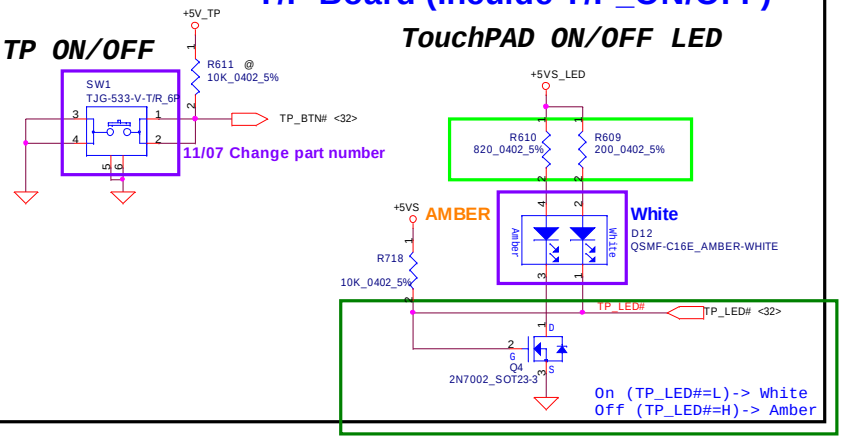

Capacitor Sensor Conn

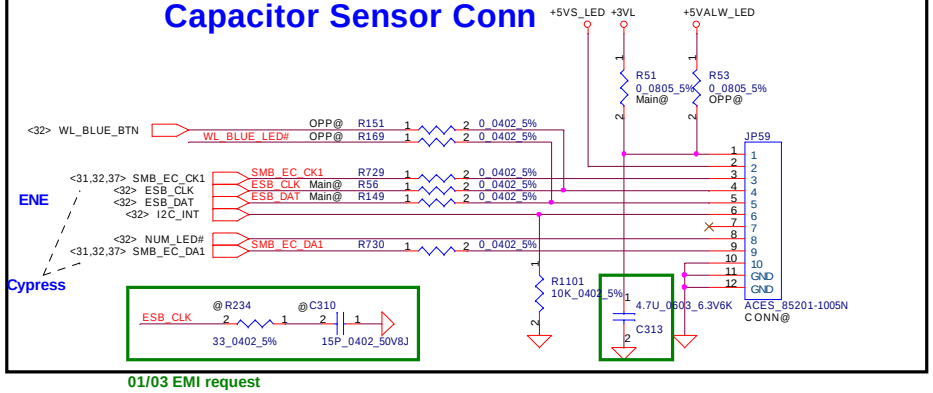

01/03 EMI request

T/P Board Conn

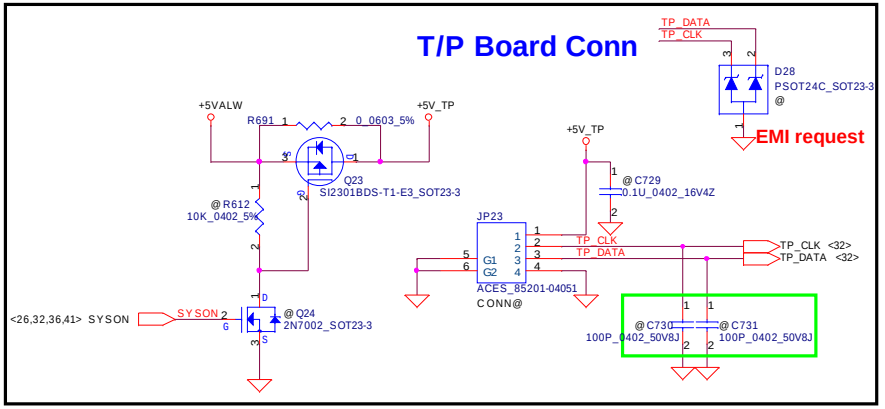

ON/OFF Button Connector

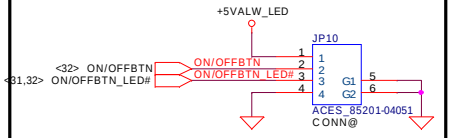

Keyboard backlight Conn



01/03 Keyboard backlight reserve a 0805 size resistor

Mini card LED

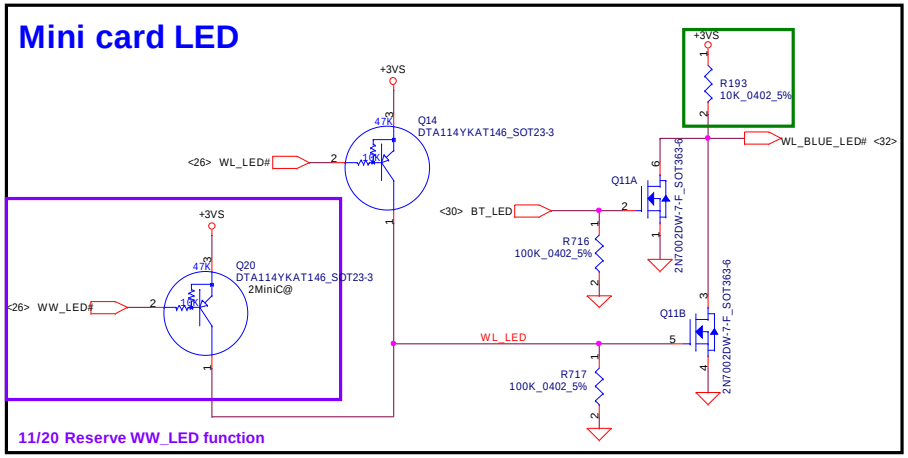

Lid Switch Connector

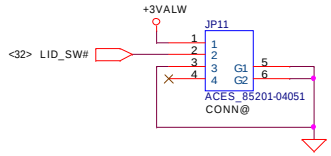

01/03 Change Lid switch connector type

Security Classification	Compal Secret Data		
Issued Date	2007/08/28	Deciphered Date	2006/07/26

Compal Electronics, Inc.			
Title	KBD, ON/OFF, SW, CIR		
Size	Document Number	Montevina Blade UMA LA4101P	Rev 0.3
Date: Saturday, January 05, 2008	Sheet 33 of 46		

Atlas/ Saturn Dock

DOCK_PWR_ON Spec
0V = Notebook S4/S5, Dock off
2.5V = Notebook S3, Dock on
4V = Notebook S0, Dock on

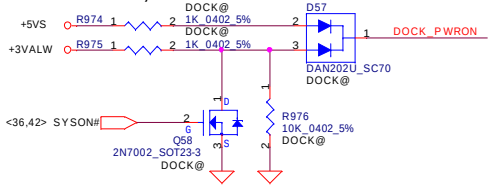

Dock PRESENT

11/12 Change to +3VL

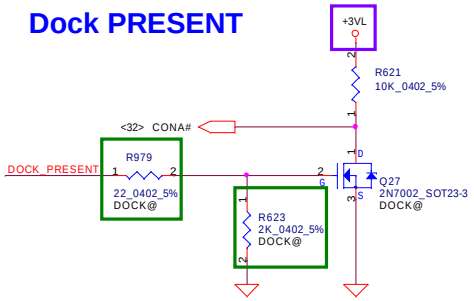

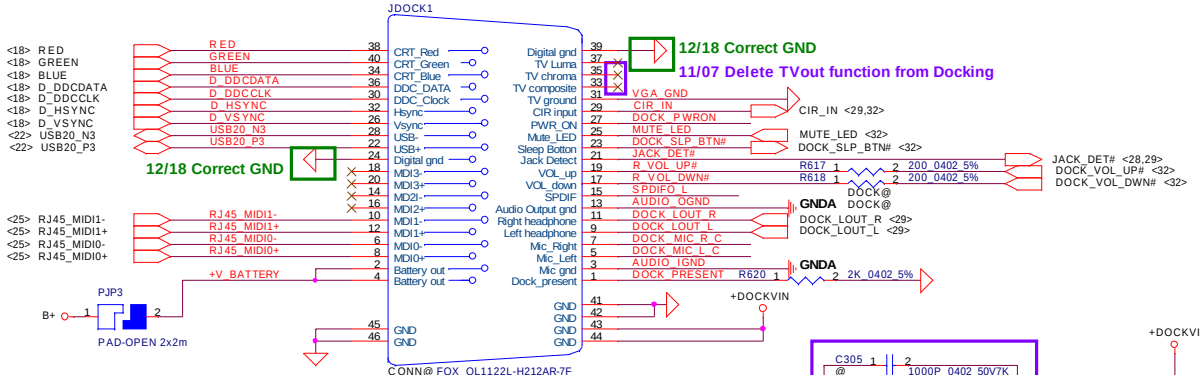

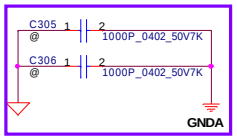

11/17 Reserve

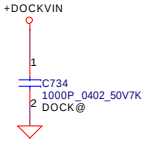

MIC_Dock

Need 600 Ohm 500 mA

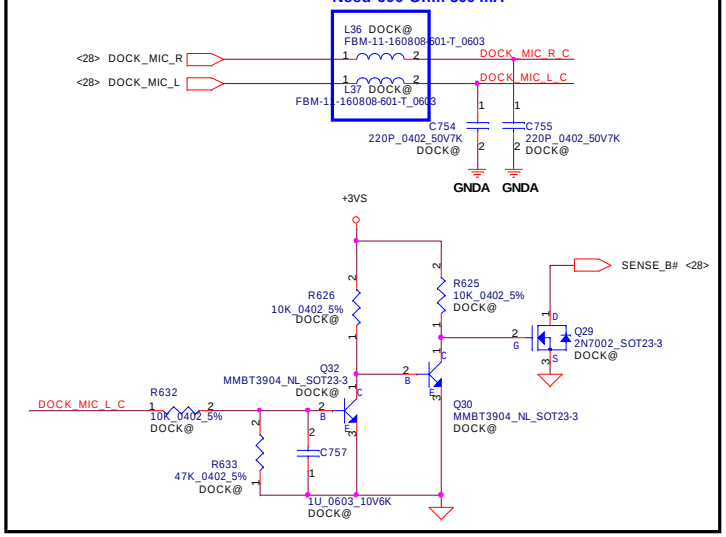

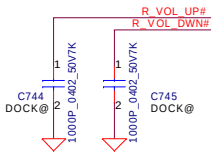

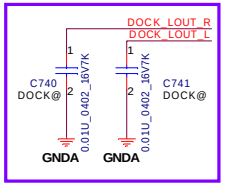

11/17 Recommend

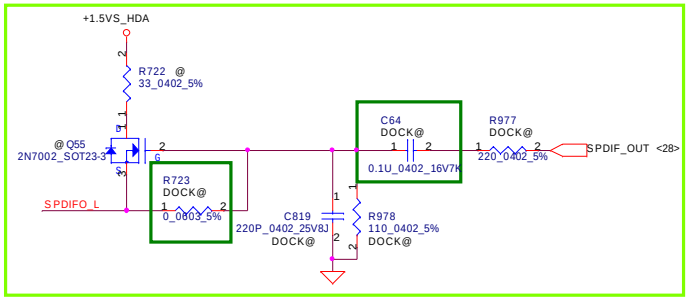

Security Classification	Compal Secret Data		
Issued Date	2007/08/28	Deciphered Date	2006/03/10

Compal Electronics, Inc.

Title: **DOCK CONN.**

Size	Document Number	Rev
Custom	Montevina Blade UMA LA4101P	0.3

Date: Saturday, January 05, 2008 Sheet 34 of 46

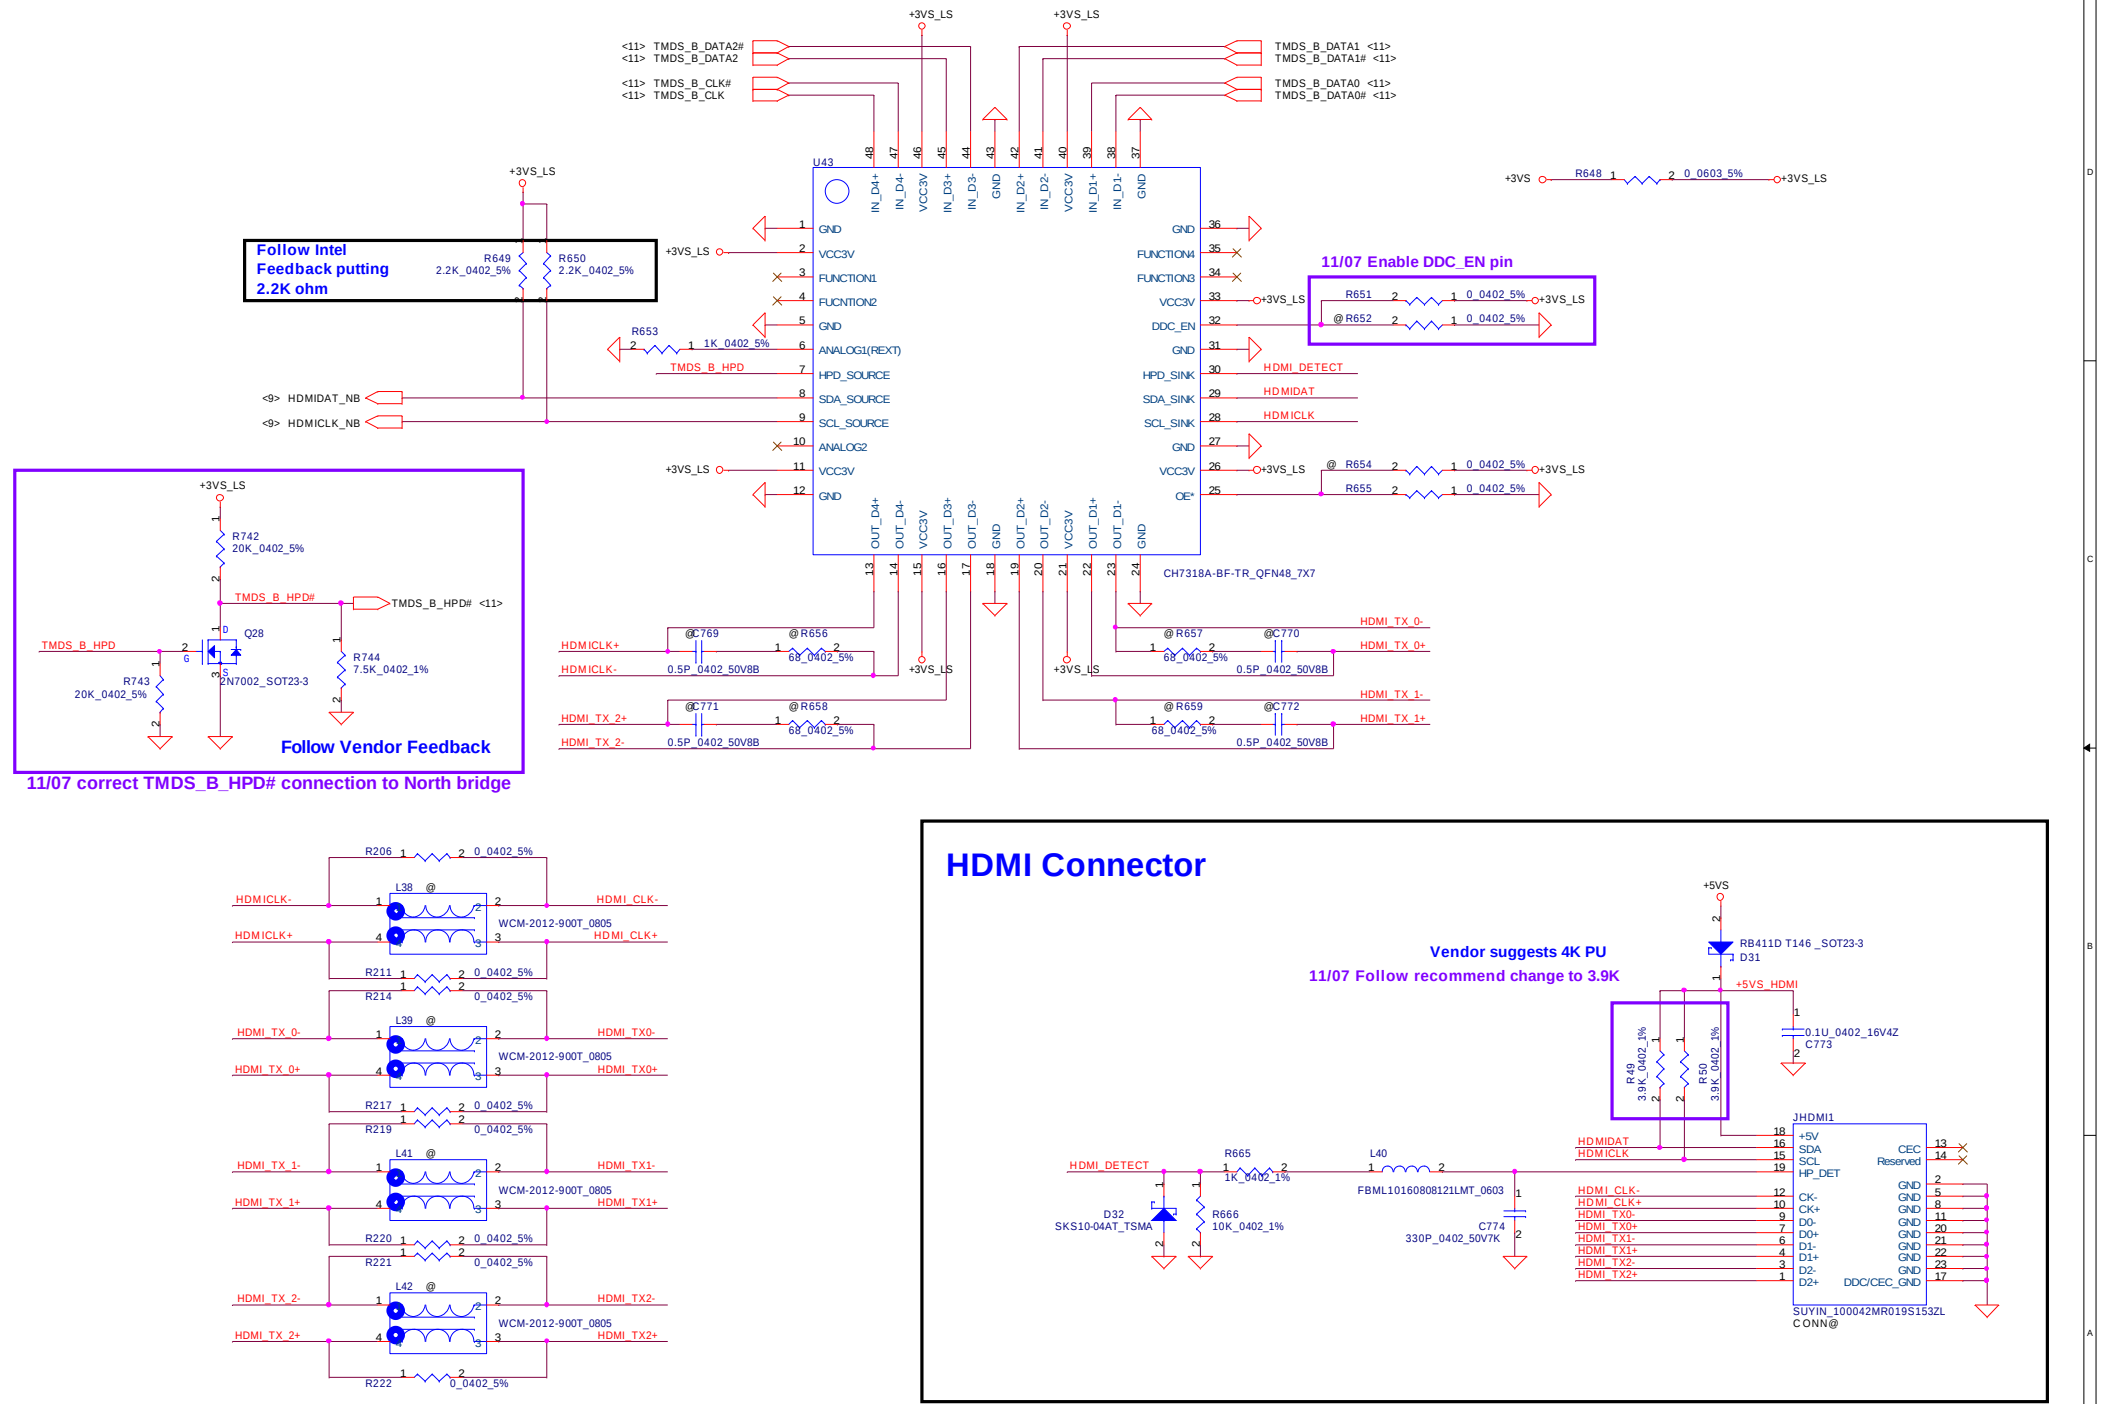

Security Classification	Compal Secret Data		
Issued Date	2007/08/28	Deciphered Date	2006/03/10

Compal Electronics, Inc.

Title: HDMI LS & Conn.

Size	Document Number	Rev
Custom	Montevina Blade UMA LA4101P	0.3

Date: Saturday, January 05, 2008 | Sheet 35 of 46

+5VALW to +5VS Transfer

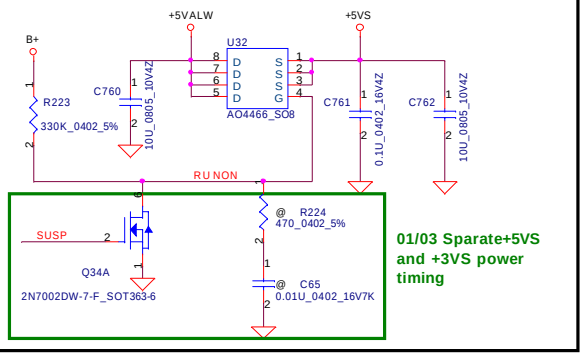

01/03 Sparate+5VS and +3VS power timing

+3VALW to +3VS Transfer

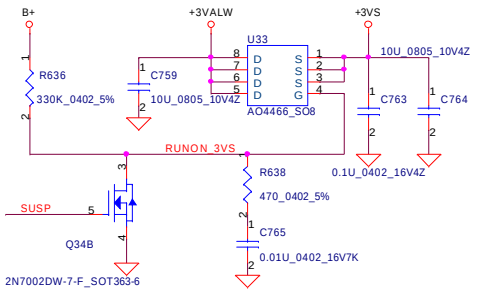

DIM LED

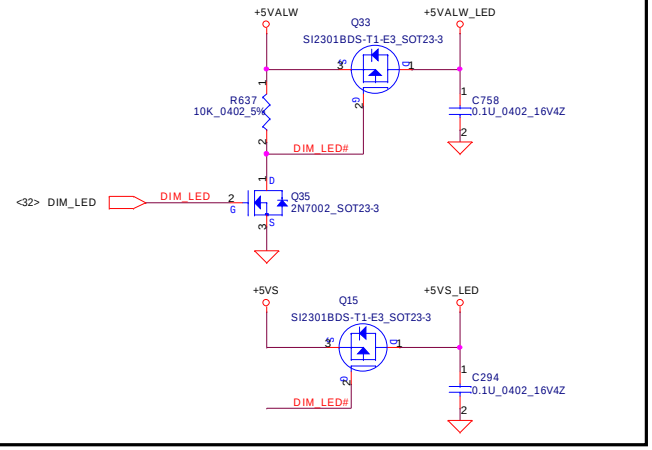

+1.8V to +1.8VS Transfer

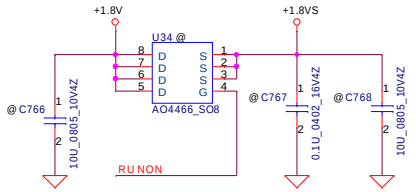

11/07 BOM Delete +1.8VS for Cardreader internal LDO

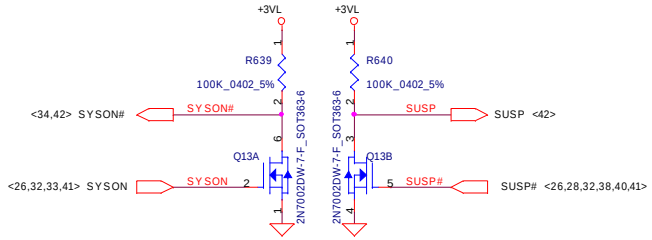

Discharge circuit

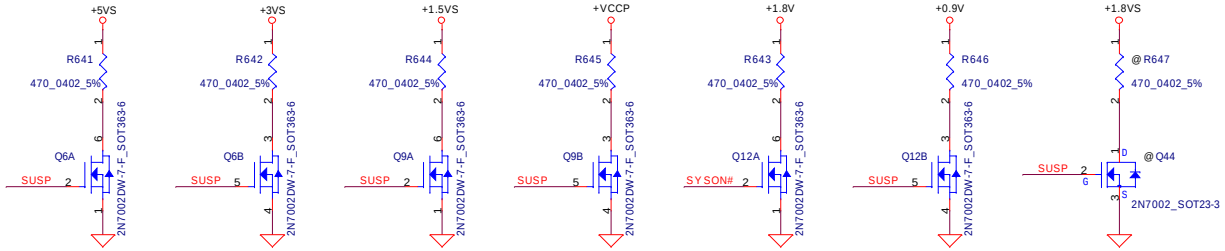

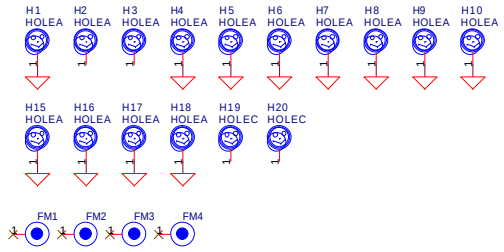

Security Classification	Compal Secret Data		
Issued Date	2007/08/28	Deciphered Date	2006/07/26

Compal Electronics, Inc.			
Title: DC/DC Interface			
Size	Document Number: Montevina Blade UMA LA4101P		Rev 0.3
Date: Saturday, January 05, 2008	Sheet 36 of 46		

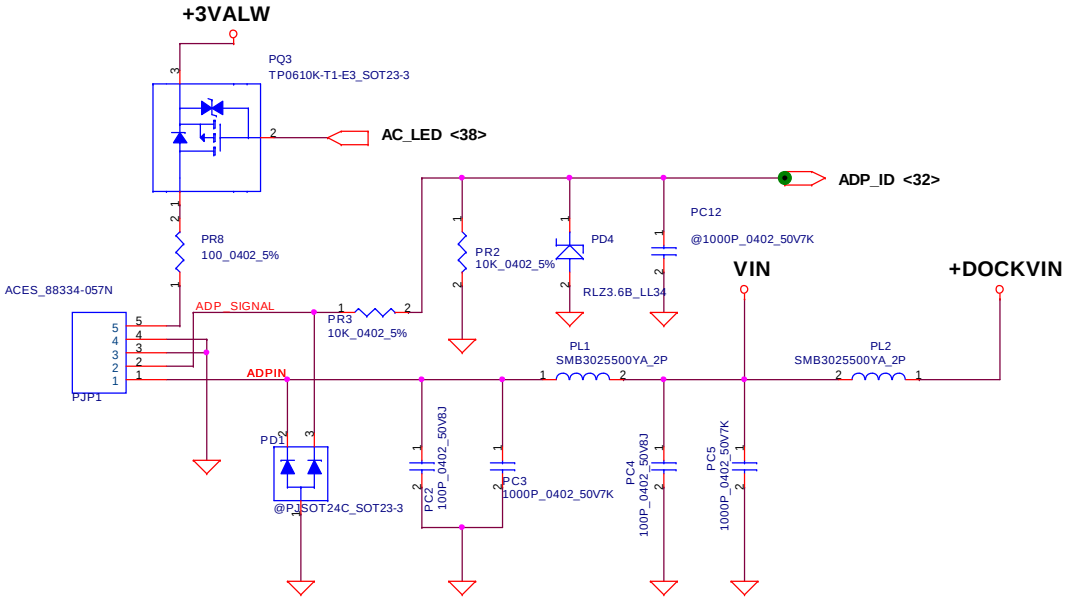

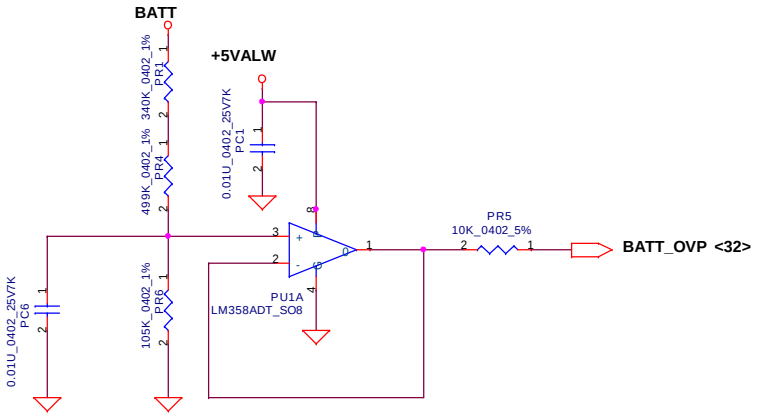

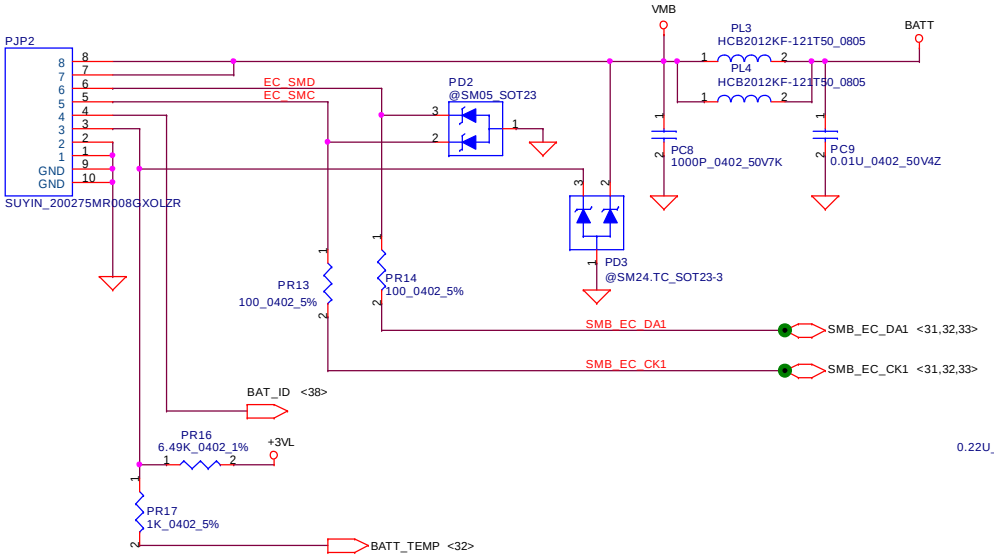

PH1 under CPU botten side :
CPU thermal protection at 90 +-3 degree C
Recovery at 47 +-3 degree C

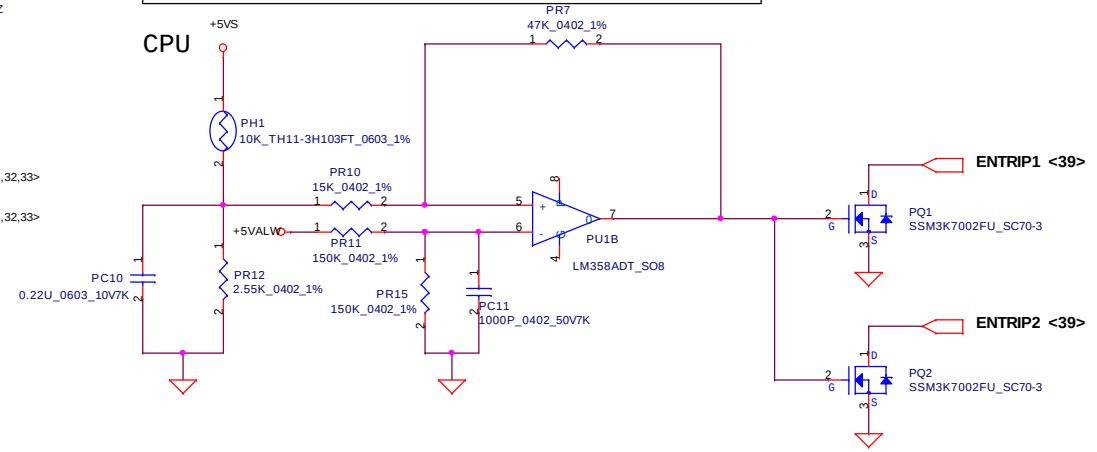

Security Classification	Compal Secret Data		
Issued Date	2007/05/29	Deciphered Date	2008/05/29

Compal Electronics, Inc.

Title: DC Connector/CPU_OTP

Size | Document Number: Montevina Blade UMA LA4101P | Rev: 0.3

Date: Saturday, January 05, 2008 | Sheet 37 of 46

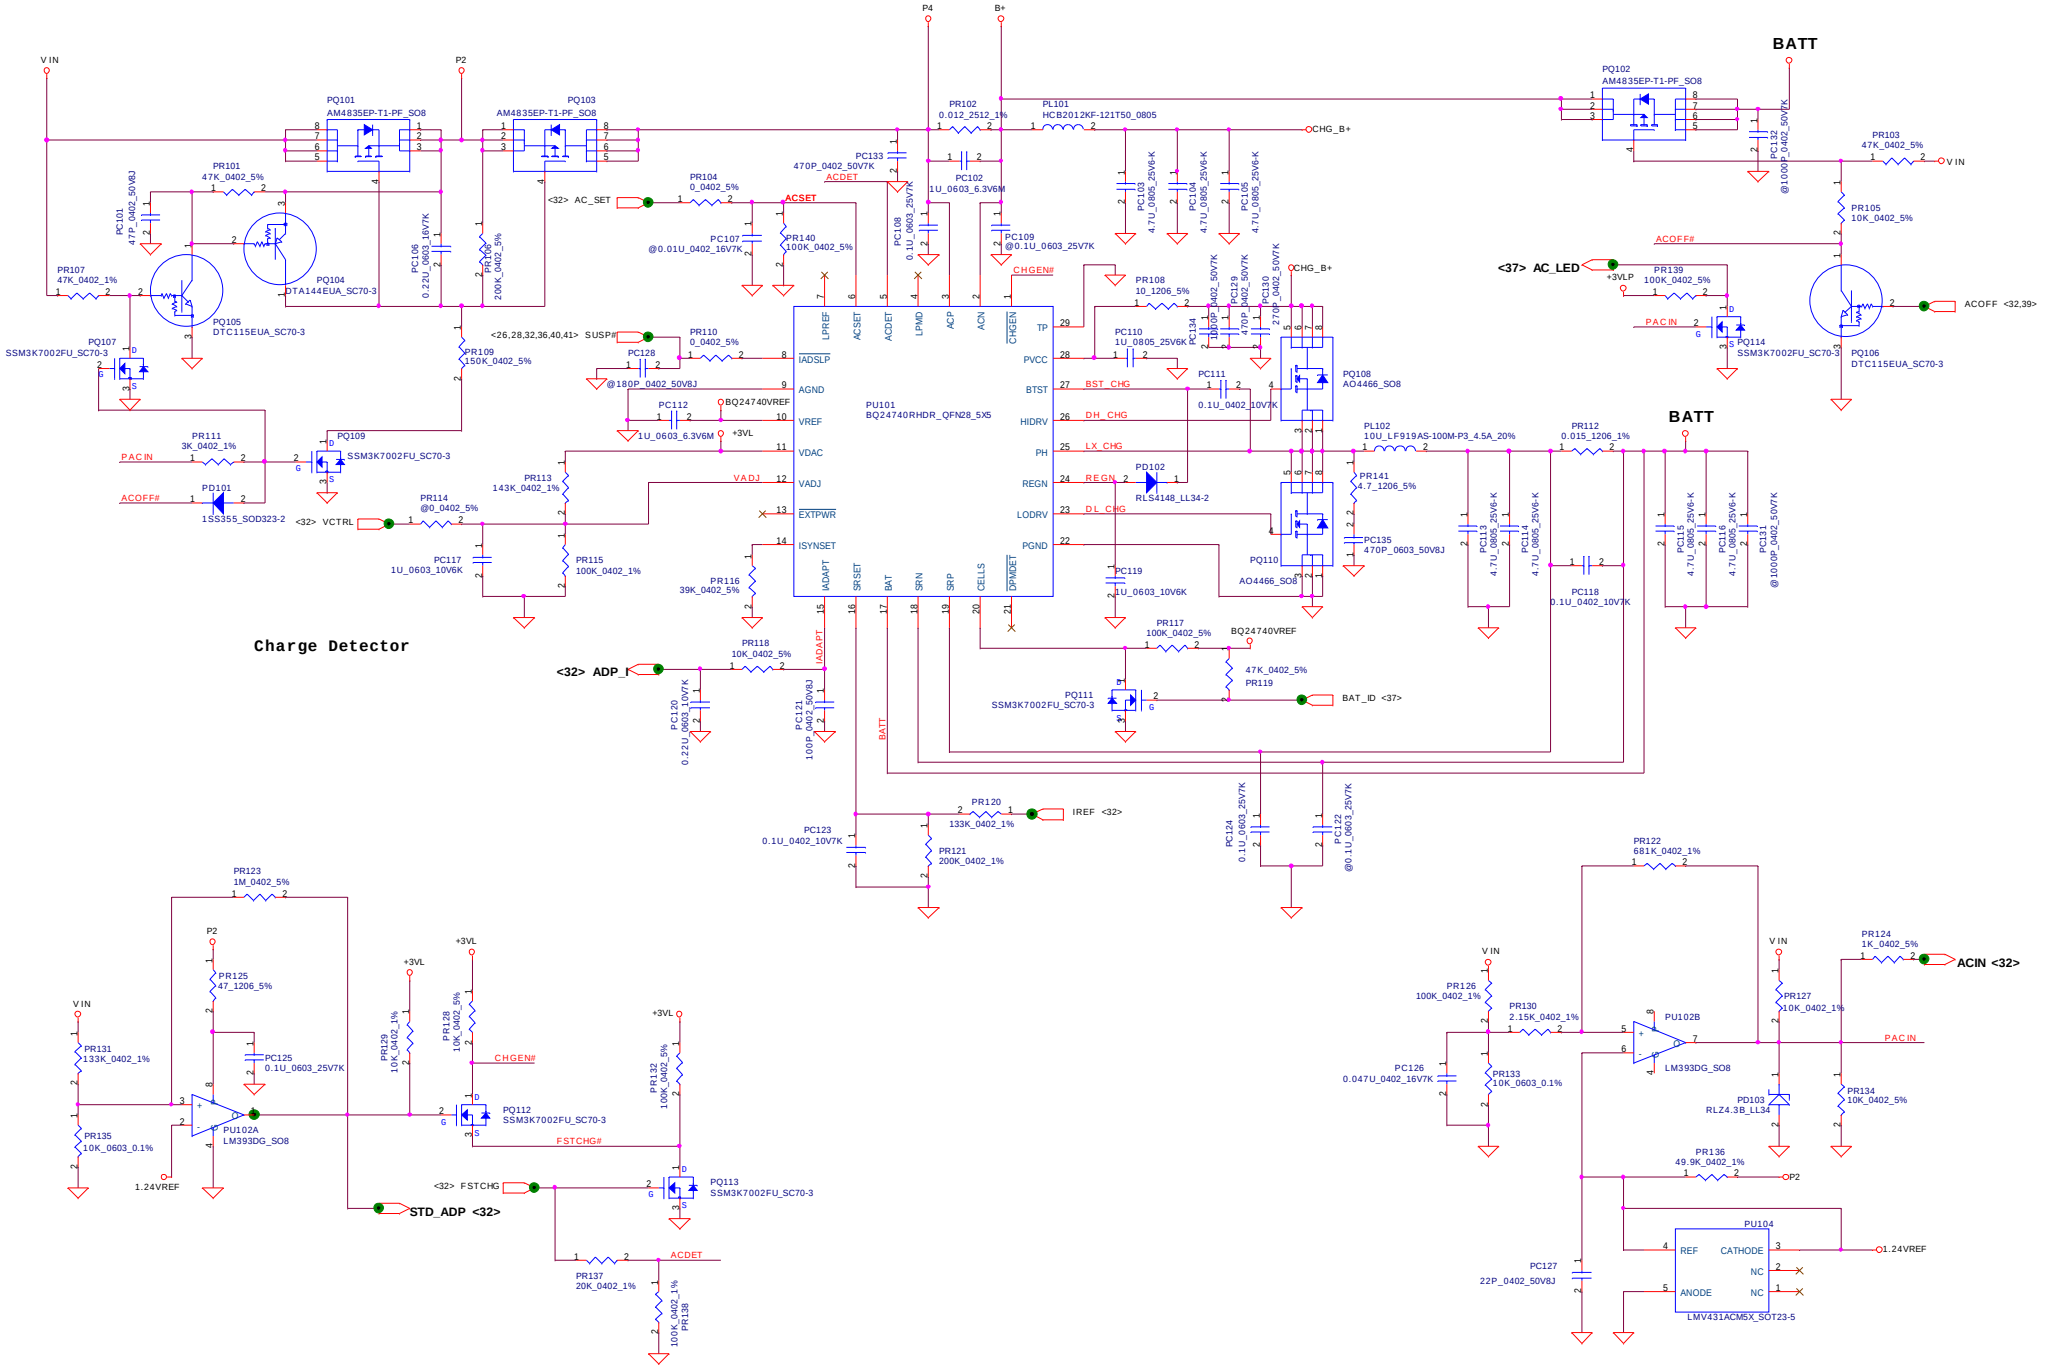

Security Classification	Compal Secret Data		
Issued Date	2007/05/29	Deciphered Date	2008/05/29

Compal Electronics, Inc.

Title: Charger

Size: | Document Number: Montevina Blade UMA LA4101P | Rev: 0.3

Date: Saturday, January 05, 2008 | Sheet 38 of 46

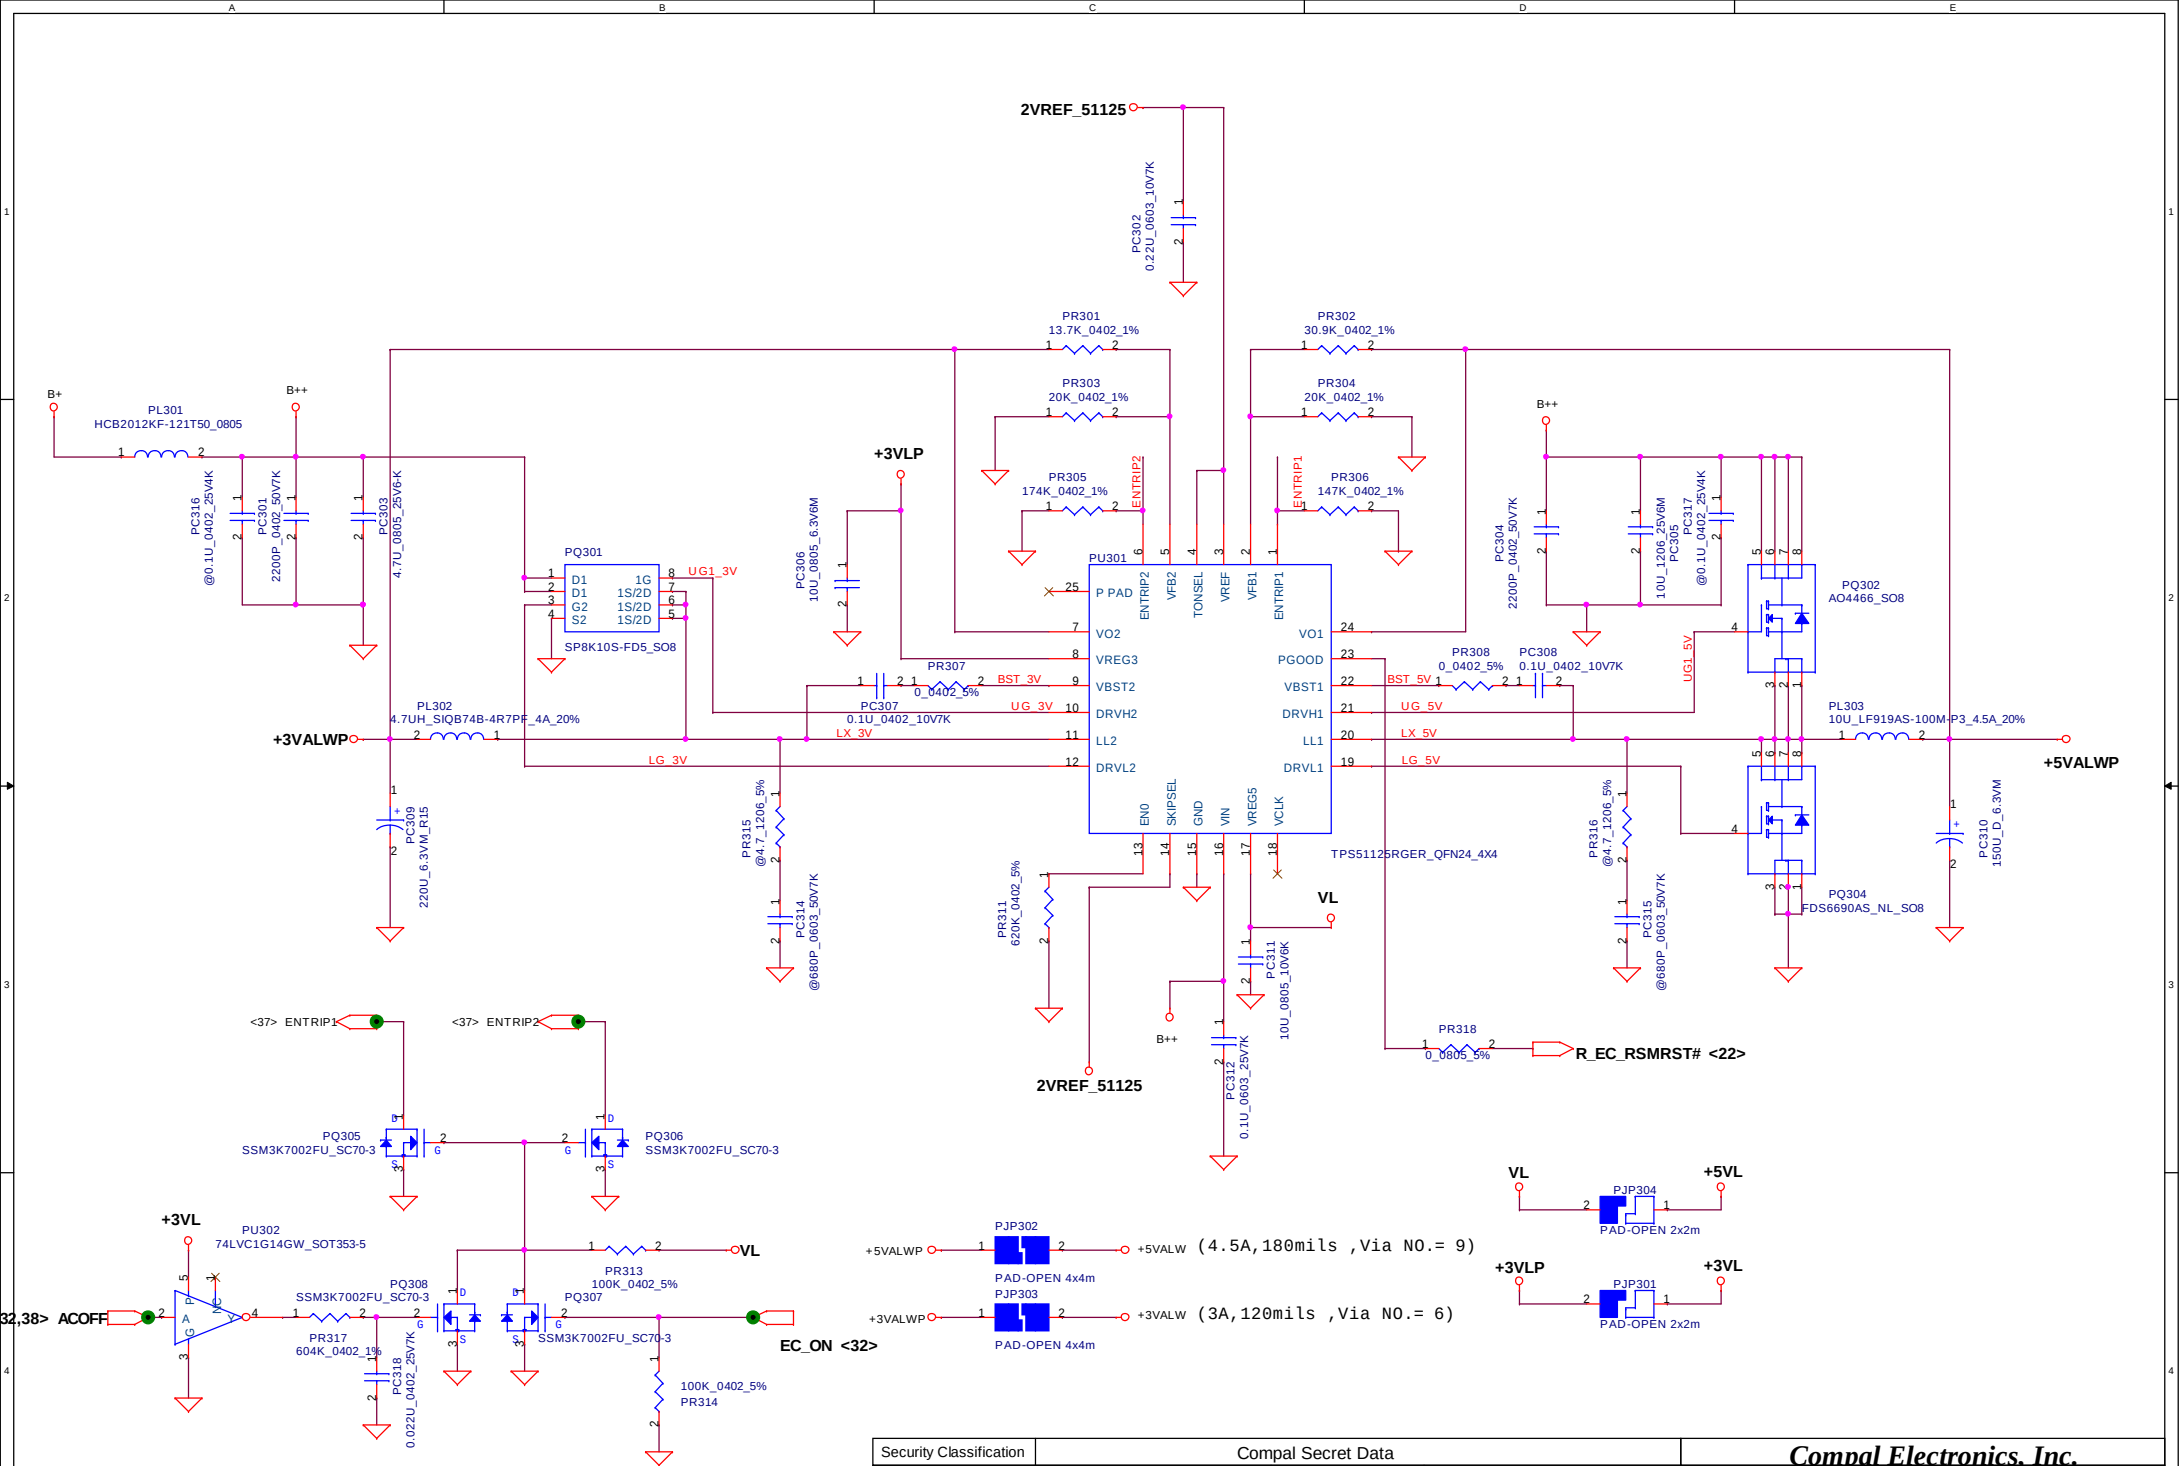

Security Classification	Compal Secret Data		
Issued Date	2007/05/29	Deciphered Date	2008/05/29

Compal Electronics, Inc.

Title: **3.3VALWP/5VALWP**

Size	Document Number	Rev
	Montevina Blade UMA LA4101P	0.3

Date: Saturday, January 05, 2008 Sheet 39 of 46

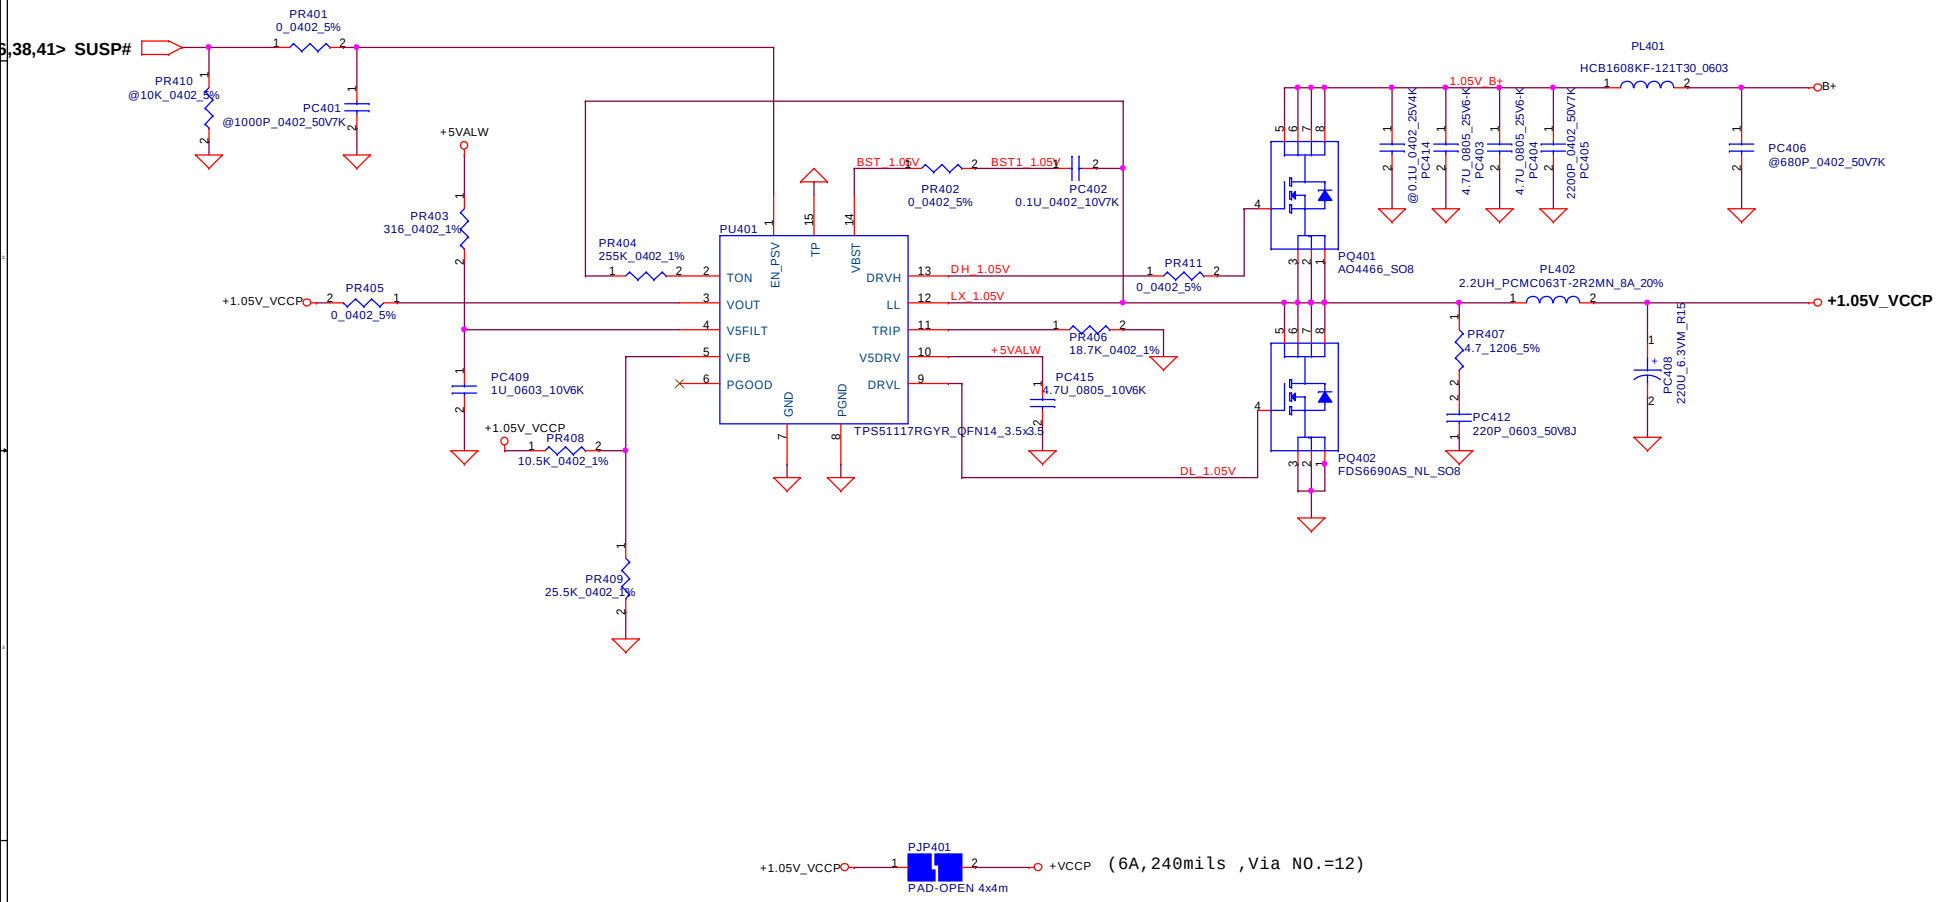

+1.05V_VCCP — PJP401 — +VCCP (6A,240mils ,Via NO.=12)

PAD-OPEN 4x4m

Security Classification	Compal Secret Data		
Issued Date	2007/05/29	Deciphered Date	2008/05/29

Compal Electronics, Inc.

Title: 1.05V_VCCP

Size | Document Number: Montevina Blade UMA LA4101P | Rev: 0.3

Date: Saturday, January 05, 2008 | Sheet 40 of 46

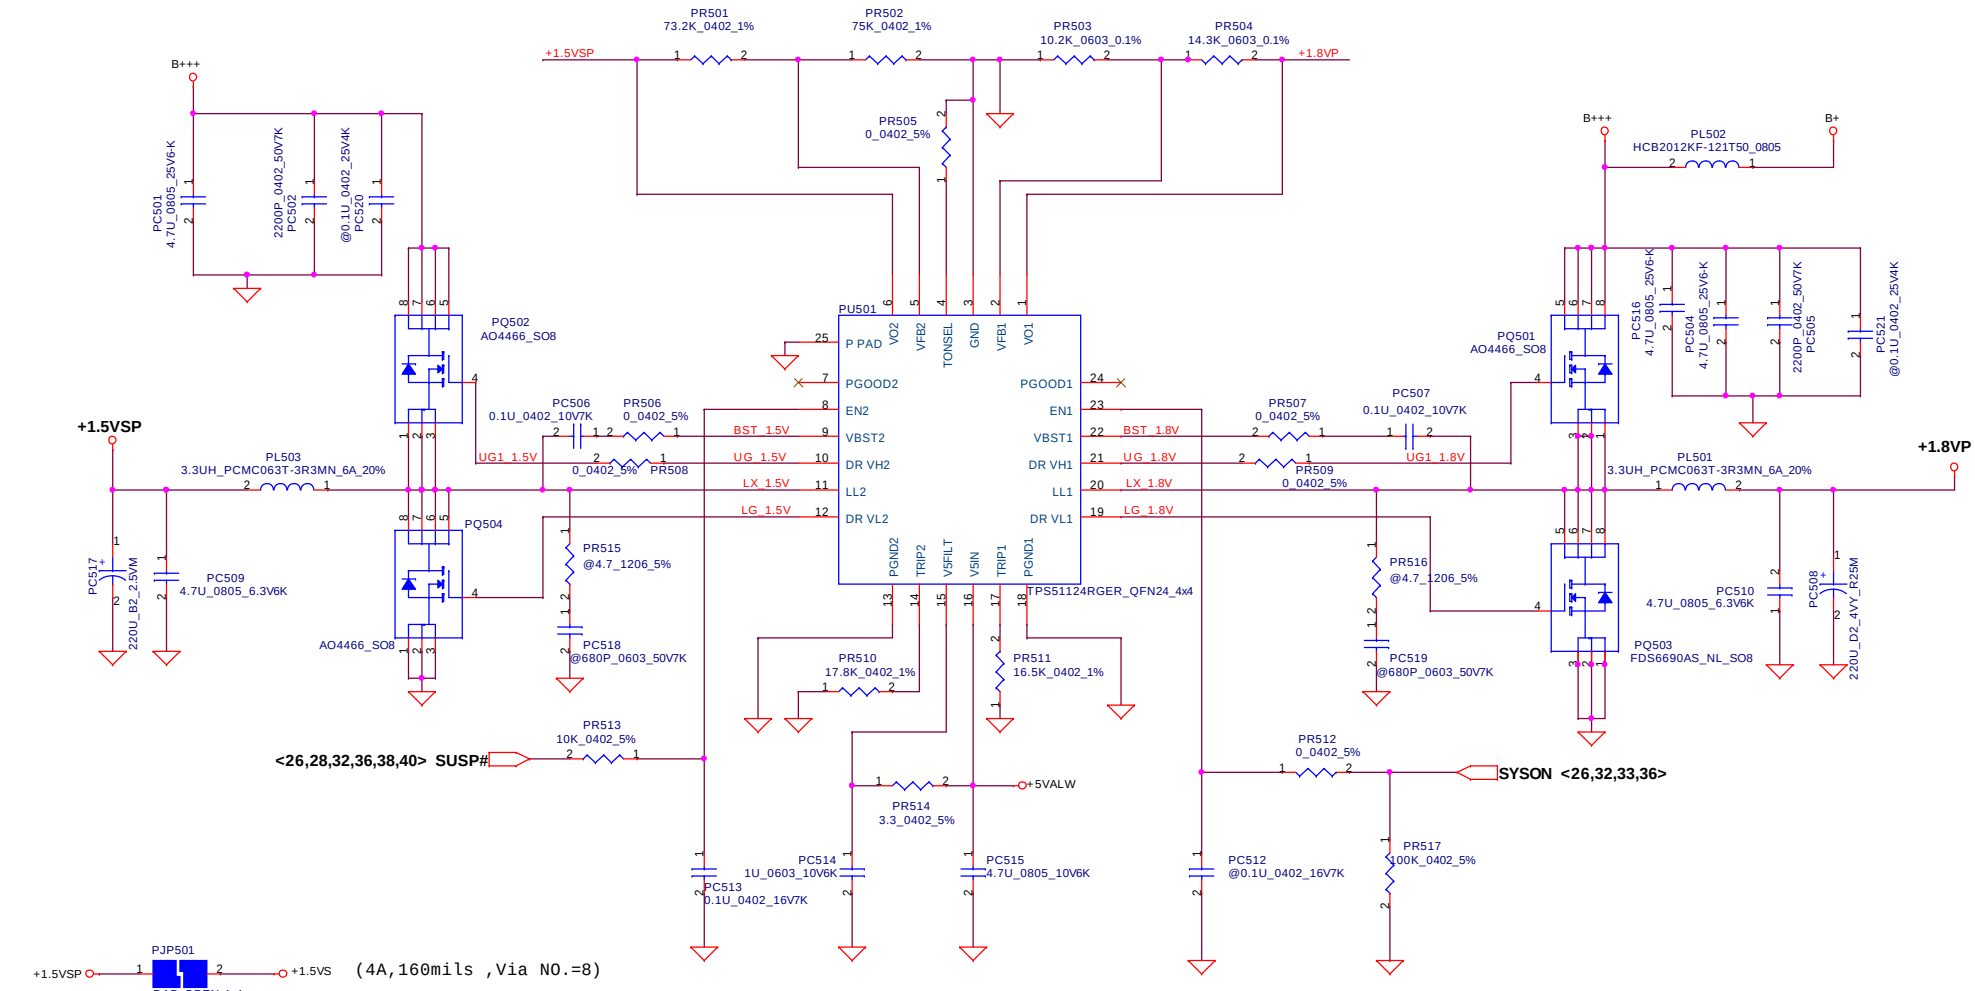

Security Classification	Compal Secret Data		
Issued Date	2007/05/29	Deciphered Date	2008/05/29

Compal Electronics, Inc.

Title: **1.5VSP/1.8VP**

Size	Document Number	Rev
	Montevina Blade UMA LA4101P	0.3

Date: Saturday, January 05, 2008 Sheet 41 of 46

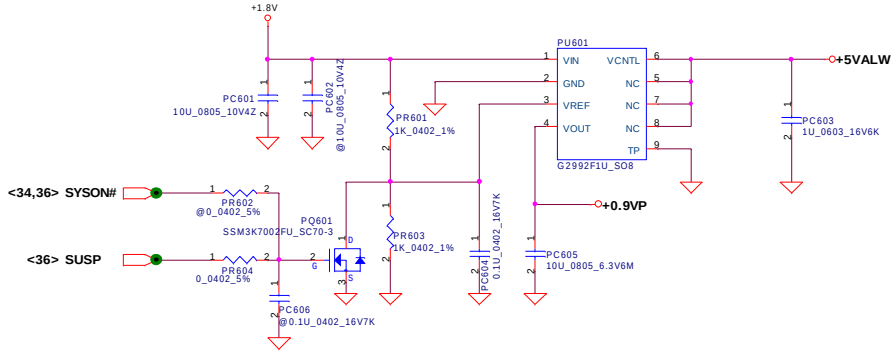



(2A,80mils ,Via NO.= 4)

Security Classification	Compal Secret Data		
Issued Date	2006/11/23	Deciphered Date	2007/11/23

Compal Electronics, Inc.

Title: **0.9VP/1.1V_PCIE**

Size | Document Number: **Montevina Blade UMA LA4101P** | Rev: 0.3

Date: Saturday, January 05, 2008 | Sheet 42 of 46

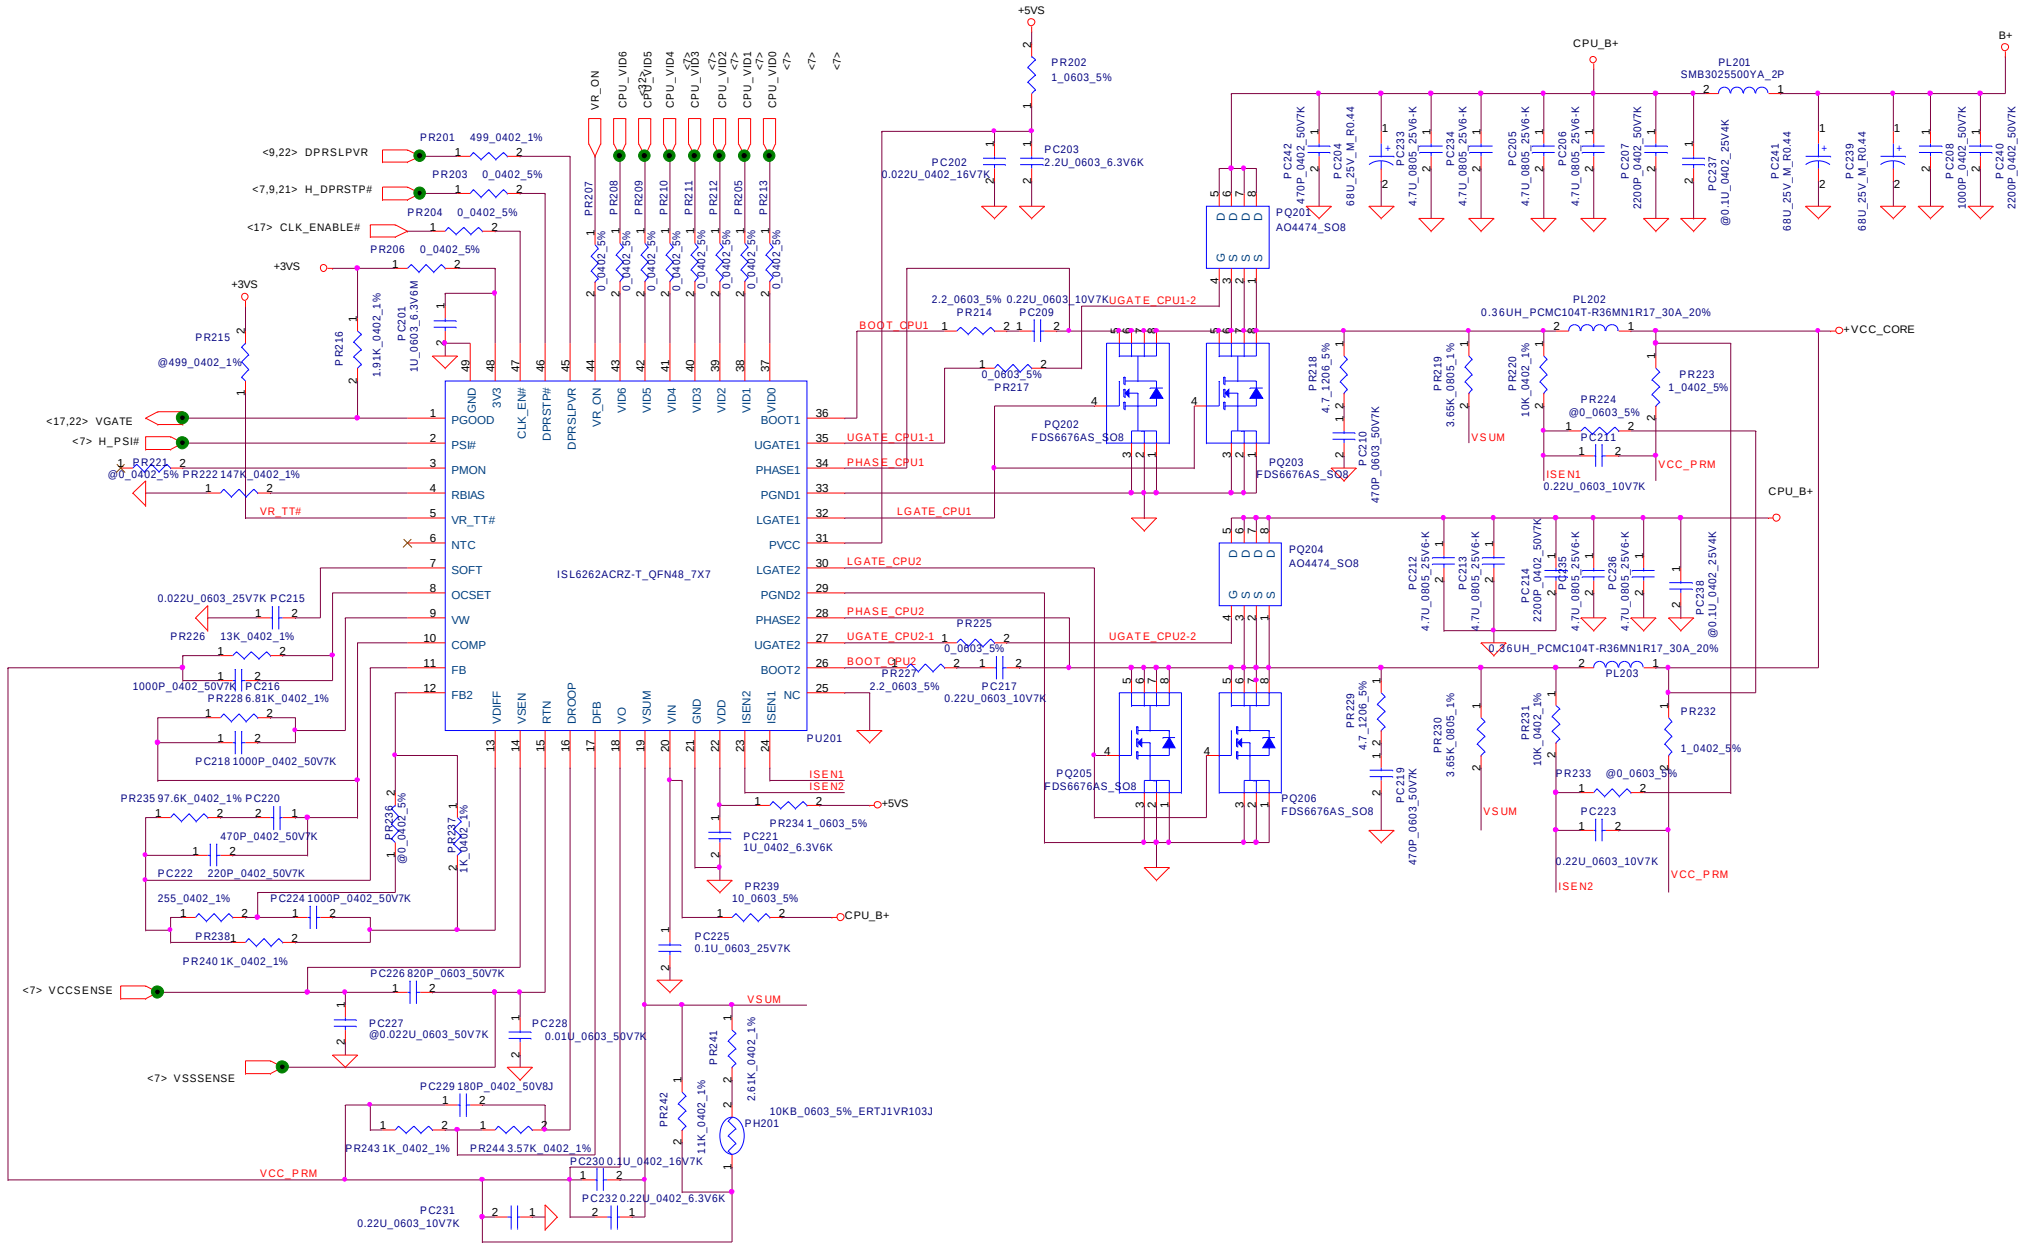

Compal Electronics, Inc.

Title: +CPU_CORE

Size: Custom | Document Number | Rev: 0.3

Date: Saturday, January 05, 2008 | Sheet 43 of 46

Item	Fixed Issue (Reason for change)	PAGE	Modify List	Date	Phase
1	Transation Fail	08	C41、C42、C43、C44 Change ESR=7m ohm	11/21	SI-1
2	Disable TV out function from Docking	11、34	R61、R62、R63 change to 75 Ohm、TV_DCONSEL_0、TV_DCONSEL_1 connect to GND	11/07	SI-1
3	Update Connetor Library		CRT(JCRT1)、HDMI(JHDMI1)、ESATA(JP53)、Finger print(JJP24)、FAN(JP2)、Speaker(JP60)、Multi bay(JP12)、Dual LED(D53、D12)	11/17	SI-1
4	Delete LVDS B channel	11、19	Schematic Delete	11/17	SI-1
5	USB camera Footprint error	19	Change U42 to G916-390T1UF SOT23, it adjustable mode, R1091=215K，R1093=100K	11/07	SI-1
6	Reserve Card reader D3E function	22、27	GPIO6= CR_CPPE#，GPIO22=CR_WAKE#	11/17	SI-1
7	Swap PCIE LAN and New card	22	Swap PCIE4 and PICE6	11/17	SI-1
8	Add HDCP ROM for ICH9M	22、31	Add HDCP ROM for ICH9M	11/17	SI-1
9	Change G sensor control from SB、LED drive by +5VS	22、33	Change G sensor control from SB	11/17	SI-1
10	Avoid Battery mode can't boot issue	22、39	Add +3VALW GD to EC_RSMRST# to fix Battery mode can't boot issue	11/17	SI-1
11	Add G sensor ST and Bosch	24	Add G sensor ST and Bosch	11/17	SI-1
12	Change LAN solution (Marvell to Realtek)	25	Change LAN solution (Marvell to Realtek)	11/17	SI-1
13	LAN can't work	25	U46 Change to correct transformer type	11/17	SI-1
14	Cardreader schematic review and update, add D3E function	27	R709-->10K、R402-->8.2K、R704-->Stuff、R705-->@、U37-->@、Cardreader LED-->+5VS、add D3E function	11/17	SI-1
15	Jack can't detect normal	28	R1059 change from 39.2 to 39.2K	11/17	SI-1
16	Speaker work un normal	28	Add and Stuff C1362、R1065、R596	11/17	SI-1
17	HP audio team recommend	28、29	C285~C292、C1352、C1354 change to 0.022U、Amp output setup to 15.6 dB、Reserve C305、C306 for GNDA and GND	11/17	SI-1
18	Audio jack can't detect normal	29	Add Pull up resistor R401 to +3VALW	11/17	SI-1
19	Docking HP audio test fail	29	Add C295□BC296 to avoid DC level, and add R409、R410 to reduce HP out level	11/17	SI-1
20	Leakage problem	32	Correct direction pretect leakage	11/07	SI-1
21	EC pin define update	32	Delete EC_PME#、SYSON PU、SUSP# PU、LID_SW# change to +3VALW、Delete CLKRUN#、R582->@ for C0 chip、CIR PU+5VL、add 100P to BATT_OVP(EC_recommend)	11/07	SI-1
22	Can't Hibernation(SLP_S4#)	32	Connect SLP_S4# to SB	11/17	SI-1
23	EC can't receive docking present	34	CONA# change +3VL	11/12	SI-1
24	HDMI can't detect	35	DDC _EN must enable 、TMDS_B_HPD# inverse	11/07	SI-1
25	LVDS power on timing	19	C238 change to 0.047u to meet TI timing	01/03	SI-2
26	Prevent WWAN nosie	21	Add 12p on HDA_SDOUT and HDA_SDOUT	01/03	SI-2
27	Power leakage	21、31	Change HDCP ROM to +3VS power plane	01/03	SI-2
28	Prevent WLAN leakage	26	Add Diode prevent WLAN leakage	01/03	SI-2

Compal Electronics, Inc.

Title: PIR

Size | Document Number: Montevina Blade UMA LA4101P | Rev: 0.3

Date: Saturday, January 05, 2008 | Sheet 44 of 46

Item	Fixed Issue (Reason for change)	PAGE	Modify List	Date	Phase
29	New card PTH connector GND	26	New card PTH connector GND	01/03	SI-2
30	Change Cardreader LED control	27	Change Cardreader LED control	01/03	SI-2
31	Change SPDIF to SPDIF1	28	Change to SPDIF1	01/03	SI-2
32	Shut down pop noise	29	Change C293 to 1U	01/03	SI-2
33	Change BT power to +3VS	30	Change BT power to +3VS	01/03	SI-2
34	EMI Request	31	SPI_FSEL#、SPI_CLK_R、SPI_FWR# reserver RC	01/03	SI-2
35	Reserver 0 ohm co lay with common choke	35	Reserver 0 ohm co lay with common choke	01/03	SI-2
36	Sparate+5VS and +3VS power timing	36	Sparate+5VS and +3VS power timing	01/03	SI-2
37	Keyboard backlight reserve a 0805 size resistor	33	Keyboard backlight reserve a 0805 size resistor	01/03	SI-2
38	Change Lid switch connector type	33	Change Lid switch connector type	01/03	SI-2
39					
40					
41					
42					
43					
44					
45					
46					
47					
48					
49					
50					
51					
52					
53					
54					
55					
56					

Compal Electronics, Inc.

Title: PIR 2

Size	Document Number	Rev
	Montevina Blade UMA LA4101P	0.3

Date: Saturday, January 05, 2008 Sheet 45 of 46

Version Change List (P. I. R. List) for Power Circuit

Item	Page #	Title	Date	Request Owner	Issue Description	Solution Description	Rev.
1	37	DC Connector /CPU_OTP	11/06	Compal	Add PD4 & PC12	Add PD4 & PC12	
2	39	3.3VALWP/5VALWP	11/06	Compal	for Layout	Change PQ301 cancel PQ303	
3	38	Charger	11/06	Compal	EMI solution	Add pc128	
4	43	+CPU_CORE	11/06	Compal	EMI solution	Add PC240	
5	39	3.3VALWP/5VALWP	11/14	Compal	for Layout	Change PL303 and PC310	
6	38	Charger	12/31	Compal	EMI solution	Add PC129, PC130, PC131, PC132, PC133	
7	43	+CPU_CORE	12/31	Compal	EMI solution	Add PC242	
8	39	3.3VALWP/5VALWP	12/31	Compal	PWR request	Add PU302, control signal changed to ACOFF	
9							
10							
11							
12							
13							
14							

Compal Electronics, Inc.

Title: Power Changed-List History-1

Size: Custom | Document Number: Montevina Blade UMA LA4101P | Rev: 0.3

Date: Saturday, January 05, 2008 | Sheet 46 of 46